

© Robert McNeel & Associates, 11/28/2019.

## **Table of Contents**

Table of Contents	2
1 - Introduction	1
The Rhino interface	1
Rhino commands	2
Using templates	3
Start from the menu	3
Start from a toolbar icon	5
Start from the command line	7
Undo a mistake	9
Command history	9
Command options	
Repeat the last command	11
Cancel a command	11
Get help any time	12
2 - Rhino Objects	13
Why NURBS modeling	13
Points	13
Curves	14
Surfaces	14
Closed and open surfaces	15
Trimmed and untrimmed surfaces	15
Surface isoparametric and edge curves	17
Curve and surface degree	17
Control points	19
Control point visibility	
Change control point locations	19
Add, delete, or redistribute control points	19
Polysurfaces	20
Solids	20
Light-weight extrusion objects	21
Polygon mesh objects	22
3 - Selecting Objects	23
Select and deselect objects	23
Choose Objects menu	25
Select objects with windows	25
Other ways of selecting objects	28

Sub-object selection	29
4 - Navigating Viewports	
Viewport title	
Viewport projection	
Parallel	
Perspective	
Two Point Perspective	
Viewport navigation	
Mouse navigation	
Key and mouse combinations	
Viewport display modes	
Wireframe	
Shaded	
Rendered	
Raytraced	
Other shaded modes	
5 - Accurate Modeling	
The Rhino cursor	
Grid snap	
Ortho mode	
Object snaps	42
Persistent object snaps	
One-time object snaps	
Object snaps using references	44
Constrain cursor movement	44
Ortho	44
Distance constraint	
Angle constraint	45
Distance and angle together	45
SmartTrack <sup>™</sup>	
Coordinate systems	47
Right-hand rule	47
Construction plane coordinates	47
Relative coordinates	
World coordinates	
Elevator mode	49
6 - Create Surfaces from Curves	
Surface from edge curves	

Extrude curves	
Loft curves	55
Revolve curves	56
Revolve curves with a rail	
Sweep along one rail curve	
Sweep along two rail curves	61
7 - Edit Curves and Surfaces	
Join	63
Explode	67
Trimming and Splitting	69
Trim	
Split	71
Untrim	
8 - Transforms - Move, Copy, Rotate, and Scale	75
Move	75
Move objects by dragging	77
Move objects using elevator mode	77
Copy objects	80
Rotate	
Scale	
Mirror	
9 - Organization - Layers, Groups, and Blocks	
Layers	
Popup layer list	
Layers panel	
Groups	
Blocks	
10 - Annotation: Dimensions and Text	93
Dimensions	93
Annotation Text	94
Leaders	94
Dots	95
Hatching	
Hidden line removal	96
Notes	
11 - Curve and Surface Analysis	97
Measure distance, angle, and radius	
Direction	97

Visual surface analysis	
Curvature analysis	
Environment map	
Zebra	
Draft angle analysis	
Edge evaluation	
Diagnostics	
12 - Render	
Lights	101
Materials	
Environment	
Ground Plane	
Render Preview	
13 - Solids and Transforms - Pull Toy	
Enter coordinates	
Draw the pull toy body	
Draw the axles and wheel hubs	
Draw the lug nuts	
Array the lug nuts	
Draw the tires	113
Mirror the wheels	
Draw the eyes	
Make the pull cord	
14 - Tutorial: Revolve Curves - Flashlight	
Set up the guides	
Draw the body profile curve	
Draw the lens profile curve	
Build body and lens surfaces	
Use History	
15 - Tutorial: Sweep, Loft, and Extrude - Headphones	
Create the speaker shell	
Sub-object selection	
Create the padding and cover	
Create the mounting bracket	
Create the headband	
Round the headband ends	
Create the speaker wire	
Mirror the headphone parts	

Learn more	
16 - Tutorial: Loft and Sweep - Boat	
Lay out the hull curves	
Check the curves for fairness	
Fix the curvature	
Improve the curve further	
Create the 3-D curves	
Revise the curves	
Loft the hull surfaces	
Create the other side of the hull	
Build the transom	
Add the deck	
Compromise between concept and reality	
17 - Tutorial: Point Editing and Blending - Penguin	
The body	
The eyes	
The beak	
The feet	
The tail	
The wings	202
Finishing touches	
Add a light and materials	
18 - Tutorial: Trace Images - Dragonfly	
Place the reference images	211
Trace the chest and body	
Create the body segments	
Create the tail	
Create the chest	
Create the head	
Add the neck	235
Create the eyes	237
Trace the wings	
Create the legs	
19 - Tutorial: Flow Along a Surface - Wrap Text	
Create the planar reference plane	246
Create text objects to wrap	
20 - Tutorial: Blocks - Mechanical Part	
Create solid shapes	251


Drill the holes	
Copy the holes	
Make a 2-D drawing	
Dimension the 2-D drawing	
21 - Tutorial: Layouts - Title Block	
Layout viewports	
Insert a title block	

# 1 - Introduction

Modeling in 3-D is the process of creating a mathematical representation of an object's surfaces. The resulting model is displayed on your screen as a two-dimensional image. Rhino provides tools for creating, displaying, and manipulating these surfaces.

## The Rhino interface

The image below illustrates some of the major features of the Rhino window.

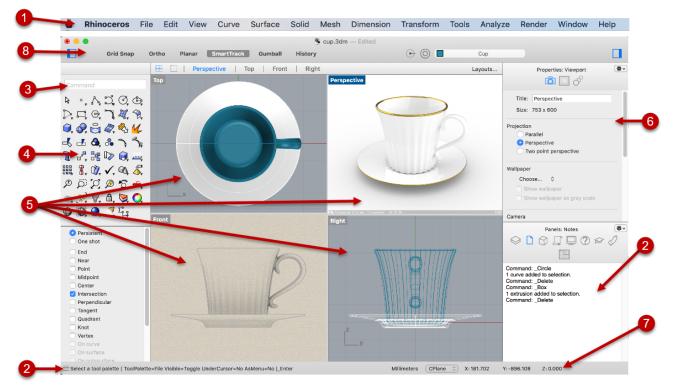

#### Menu (1)

The menus group Rhino commands by function.

#### History window (2)

The command history window displays the previous commands and prompts.

#### Command box (3)

The command box displays a typed command. Once the command is accepted, the prompts, options and a Value box appear in this space.

#### Toolbars (4)

Toolbars contain graphical icons for initiating commands. Many toolbar icons have a second command that you can access by right-clicking the icon. The tooltip that appears when you hover over the icon tells you what the left and right mouse button do.

#### To access the command on the first line

Click the icon with the **left mouse button**.

#### To access the command on the second line

Click the icon with the right mouse button.

**Note**: If you are using a one-button mouse or a track pad, to access the second command, hold the **Option** key and click the icon.

#### Viewports (5)

Viewports display the Rhino working environment.

#### Sidebar (6)

The right sidebar contains layers, properties, and other settings. The left sidebar contains the toolbar and the object snap list.

#### Status bar (7)

The status bar is located at the bottom of the Rhino window. It displays the current coordinate system, the cursor location and system unit.

#### Top panel (8)

The top panel has quick access to layers, object properties and toggles of modeling aids.

### **Rhino commands**

Rhino is a *command-driven* program. In other words, all actions are activated by named commands such as **Line**, **Box**, or **CurvatureAnalysis**.

**Tip**: To learn more about a command, use the Command Help panel.

Commands are accessed through the *menus*, or the *toolbars*, or by *typing* the command name. In the next sections, you will explore using these methods. You may find one method easier than another. The choice is yours, and there is no preference for one method over another.

In the exercises, you will use Rhino's commands, navigation tools, shaded modes, render, and use some basic object manipulation.

Tip: To cancel a command any time, press the Esc key.

In this session you will:

- Start a command by choosing from the menu.
- Start a command by choosing from a toolbar icon.
- Start a command by typing.

#### To start your first Rhino model

- 1. Start Rhino.
- 2. On the File menu, click New Using Template.
- 3. Double-click Small Objects Centimeters.3dm in the Standard templates.

## **Using templates**

A *template* is a file that serves as a starting point for a new Rhino model. When starting a new model, Rhino provides default templates that set units appropriate for the model size, provide a few layers, and display a standard four-viewport layout.

Custom templates can include any kind of document information such as units, viewport layouts, layers, and even geometry. If you find yourself creating similar models over and over, set up and save a model as a template (see the **SaveAsTemplate** command in the Help). That way you will not have to spend time formatting your models each time you make a new one. You can start a new model from your own template, and start from there.

## Start from the menu

Most Rhino commands are located in the menus.


#### Start the Cone command

On the **Solid** menu, click **Cone**.


Use the **CommandHelp** command to display the **Command Help** panel before starting the Cone command.

#### Draw the cone


1. At the **Base of cone...** prompt, in the **Top** viewport, click the left mouse button to pick the center point for the base of the cone.

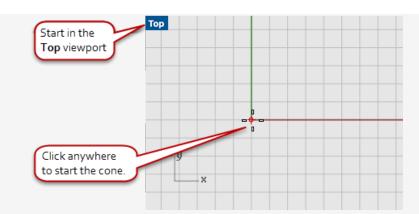


2. At the **Radius...** prompt, in the **Top** viewport, drag the mouse, and click to draw the cone's base.

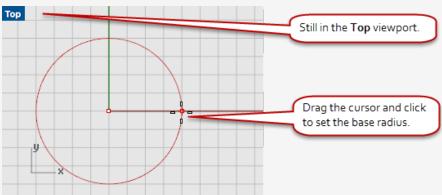

3. At the **End of cone** prompt, in the **Front** viewport, drag the mouse up and down. Watch what happens in the **Perspective** viewport.

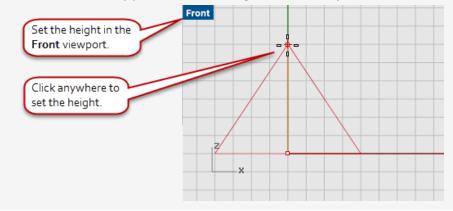

4. Click to place the end of the cone.

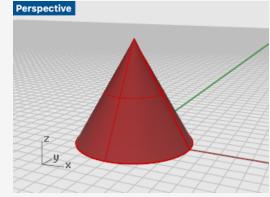


## Start from a toolbar icon

Toolbars provide a graphic interface to the commands.

#### To display a button tooltip, hover your mouse over the icon

The command names that are activated with the left and right mouse click or with the Option key + mouse click appear.

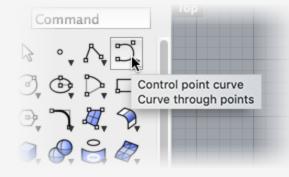

### Start the Curve command


On the toolbar docked on the left side of the Rhino window, click the icon for Control point curve.

Find help for the Curve command in the **Command Help** panel.


#### Draw the curve

1. At the **Start of curve...** prompt, in the **Top** viewport, click the mouse to start the curve.


2. At the **Next point...** prompts, in the **Top** viewport, click a few more points.

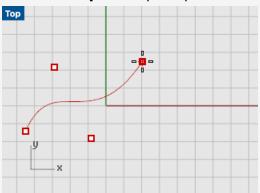

3. At the **Next point...** prompts, move the mouse into the **Front** viewport and click a few more points.

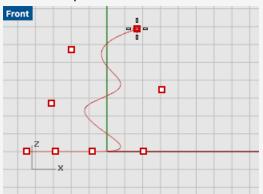


4. At the **Next point...** prompts, move the mouse into the **Right** viewport and click a few more points.

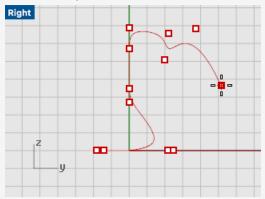

5. Right-click, press **Enter**, or press the **Spacebar** to complete the curve.

6. Look at the curve in the **Perspective** viewport.

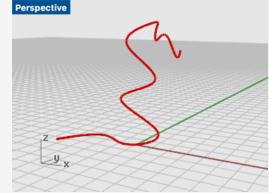

#### Admire your work

In the **Perspective** view, drag with the right mouse button to rotate the view.

### Start from the command line

You can start a command by typing the command name.

#### Start the Sphere command by typing

 With the command prompt clear (if there is text at the command prompt, press the Esc key), just start typing Sphere.

When you type the first letter of a command, a list of possible commands appears.


2. When the command name **Sphere** appears, press **Enter**, or choose **Sphere** from the list.

Find help for the Curve command in the **Command Help** panel.


#### Draw the sphere

The default option for the **Sphere** command is **Center, Radius**, so you can simply start drawing the center of the sphere.

2. At the **Center of sphere...** prompt, in the **Perspective** viewport, click the mouse anywhere in the viewport to pick the center point for the sphere.

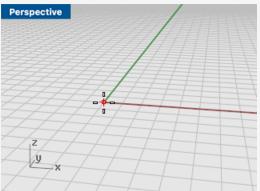


3. At the **Radius...** prompt, in the **Perspective** viewport, move the mouse away from the center point, and click to draw the sphere.

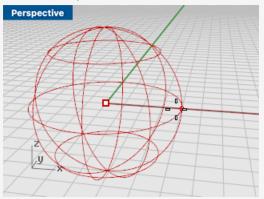

4. In the **Perspective** viewport, right-click the **viewport title**, and on the menu, click **Shaded**.

You can also use the **View** menu to set the viewport to **Shaded** mode. Shaded mode lets you see surfaces as opaque objects rather than wires.

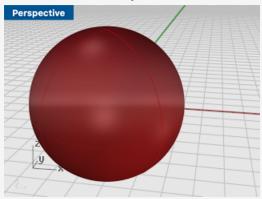

#### For more information on display modes

- 1. On the Rhinoceros menu, click Preferences.
- 2. In the Rhino Preferences dialog box, click Display Modes.
- 3. In the **Display Modes** dialog box, click the ? button at the upper-right corner.

### Undo a mistake

If you did something you did not want to do, you can undo your actions.

#### Undo a command

On the Edit menu, click Undo.

Or press the **Command**  $\mathfrak{H}$  and **Z** keys.


You can undo a series of commands, or **Redo** the **Undo** if you go too far.

## Redo commands

On the Edit menu, click Redo.
 Or press the Shift, Command X, and Z keys.

## Command history

You can display command history in the **Command History** panel in the right sidebar, or click the command history icon in the lower left corner of the screen to display temporarily.

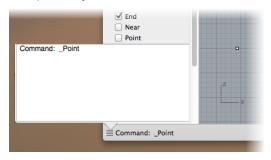

## **Command options**

Command options change how a command acts. For example, when you draw a circle, the circle is normally drawn on the active construction plane. The **Circle** command has several options including **Vertical** and **AroundCurve**.

#### To choose a command option

1. Start typing Circle.

As soon as you have typed enough letters to identify the command, the **Circle** command automatically completes at the prompt.

2. Press Enter.

The options for the **Circle** command appear:

Center of circle Deformable Vertical 2 Point 3 Point Tangent Around Curve Fit Points

3. Click **Vertical**, or type **V** to draw a circle vertical to the active construction plane.

## **Repeat the last command**

Many tasks in Rhino are repetitive. You might want to move or copy several objects, for example. Methods for repeating commands are provided.

#### enter return

#### To repeat the last command

These all perform the same function:

- Press the **Enter** key when no command is active.
- Press the **Spacebar**.
- Click the right mouse button in a viewport and select a command to repeat.

**Note**: Some commands, such as **Undo** and **Delete** do not repeat. Instead, the command prior to these commands is repeated. This prevents you from accidentally undoing too many commands or deleting objects accidentally.

Also, you often want to repeat the command you were using before undoing a mistake. To suit your own way of working, you can define the list of commands that do not repeat in **Rhinoceros > Preferences > General > Never repeat these commands**.

## **Cancel a command**

Whenever you run the wrong command or do something wrong in the command procedure, you can cancel the command several ways.

#### esc

#### To cancel the current command

When a command is running:

Press the Esc key.

The command line is cleared and returns to the **Command** prompt.

Click a toolbar button or click a command on a menu.
The current command is canceled immediately and the chosen comm

The current command is canceled immediately and the chosen command runs.



## 😮 Get help any time

The *Rhino Help* file is the major resource for detailed information on specific commands.

#### To get help on a specific command

On the Help menu, click Command Help. Or, click the ? icon in the right sidebar.

The **Command Help** panel displays the Help topic for the current command.

Find the answers to frequently asked questions at: *Rhino Support*. ۲

# 2 - Rhino Objects

The fundamental geometric objects in Rhino are points, curves, surfaces, polysurfaces, solids, light-weight extrusion objects, and polygon mesh objects.

This chapter goes into some detail to explain the mathematical basis for Rhino modeling. It is not necessary to understand everything in this chapter to start using Rhino.

## Why NURBS modeling

NURBS (non-uniform rational B-splines) are mathematical representations that can accurately model any shape from a simple 2-D line, circle, arc, or box to the most complex 3-D free-form organic surface or solid. Because of their flexibility and accuracy, NURBS models can be used in any process from illustration and animation to manufacturing.

NURBS geometry is an industry standard for designers who work in 3-D where forms are free and flowing; where both form and function is important. Rhino is used in marine, aerospace, and automobile interior and exterior design. Makers of household and office appliances, furniture, medical and sports equipment, footwear, and jewelry use Rhino to create free-form shapes.

NURBS modeling is also widely used by professional animators and graphic artists. The advantage of using NURBS over using polygon modelers is that NURBS surfaces have no facets. The models can be rendered at any resolution. A mesh can be created from the model at any resolution.

#### See also

For more information about the mathematics of NURBS, see *What are NURBS*? at *http://www.rhino3d.com/nurbs/* 

For perhaps more than you want to know, see the Wikipedia article, *Non-uniform Rational B-Spline* at *https://en.wikipedia.org/wiki/Non-uniform\_rational\_B-spline*.

## Points


Point objects mark a single point in 3-D space. They are the simplest objects in Rhino. Points can be placed anywhere in space. Points are most often used as placeholders.

~		0	0	o
0			0	0
	0	0		

## Curves

A Rhino curve is similar to a piece of wire. It can be straight or wiggled, and can be open or closed. A *polycurve* has several curve segments joined together end to end.

Rhino provides many tools for drawing curves. You can draw straight lines, polylines that consist of connected line segments, arcs, circles, polygons, ellipses, helices, and spirals. You can also draw curves using curve *control points* and draw curves that pass through selected points.

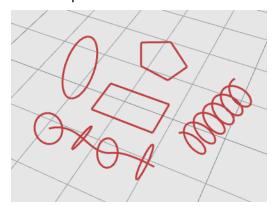


Curves in Rhino include lines, arcs, circles, free-form curves, and combinations of these. Curves can be open or closed, planar, or non-planar.

## Surfaces

A surface is like a rectangular stretchy rubber sheet. The NURBS form can represent simple shapes, such as planes and cylinders, as well as free-form, sculptured surfaces.

All surface creation commands in Rhino result in the same object: a NURBS surface. Rhino has many tools for constructing surfaces directly or from existing curves.

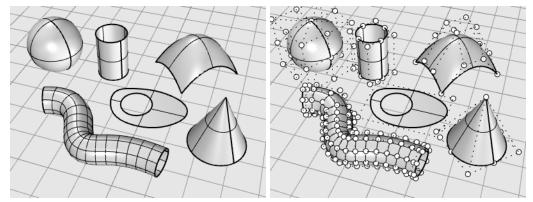


All NURBS surfaces have an inherently rectangular organization.

Even a closed surface such as a cylinder is like a rectangular piece of paper that has been rolled up so two opposite edges are touching. The place where the edges come together is called the *seam*.

#### **Closed and open surfaces**


A surface can be open or closed. An open cylinder is closed in one direction. A torus (donut shape) is closed in two directions.

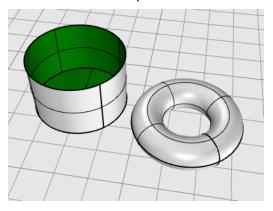


#### Trimmed and untrimmed surfaces

Surfaces can be trimmed or untrimmed. A trimmed surface has two parts: a surface that underlies everything and defines the geometric shape, and trimming curves that mark sections of the underlying surface that are trimmed away.

Trimmed surfaces are created with commands that trim or split surfaces with curves and other surfaces. Some commands create trimmed surfaces directly.

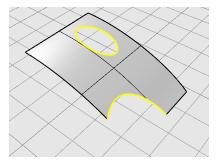


The shape of a surface is still defined by a set of control points arranged in a rectangular pattern.

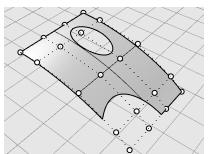


Since it can be important for you to know if a surface is trimmed, the **Properties** command lists the trimmed or untrimmed state of the surface. Some Rhino commands work only with untrimmed surfaces and some software does not import trimmed NURBS surfaces.


Trimming curves lie on the underlying surface. This surface may be larger than the trimming curves, but you will not see the underlying surface because Rhino does not draw the part of the surface that is outside the trimming curves. Every trimmed surface retains information about its underlying surface geometry. You can remove the trimming curve boundaries to make the surface untrimmed with the **Untrim** command.

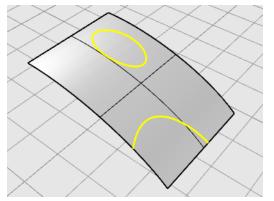


If you have a trimming curve that runs across a surface, the trimming curve itself does not have any real relationship to the control point structure of the surface. You can see this if you select such a trimmed surface and turn its control points on. You will see the control points for the whole underlying surface.

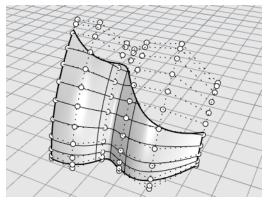

If you create a surface from a planar curve, it can be a trimmed surface. The illustrated surface was created from a circle. The control points display shows the rectangular structure of the surface.

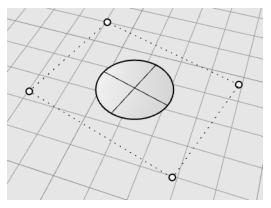


The **Untrim** command removes the trimming curve from the surface to get back to the underlying untrimmed rectangular surface.

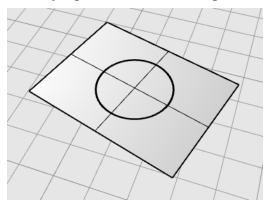

#### Surface isoparametric and edge curves

In wireframe view, surfaces look like a set of crossing curves. These curves are called *isoparametric curves* or *isocurves*. These curves help you visualize the shape of the surface. Isoparametric curves do not define the surface; they are merely a visual aid that allows you to see the surface on the screen. When a surface is selected, all of its isoparametric curves highlight.

Edge curves bound the surface. Surface edge curves can be used as input to other commands.

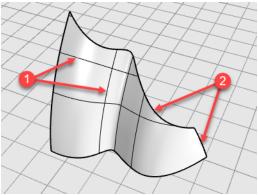

Isocurves (1), Edge curves (2).

#### Curve and surface degree

A NURBS curve is defined by four things: degree, control points, knots, and an evaluation rule.

NURBS functions are rational polynomials and the degree of the NURBS is the degree of the polynomial.

A polynomial is a function like  $y = 3x^3 - 2x + 1$ . The "degree" of the polynomial is the largest power of the variable. For example, the degree of  $3x^3 - 2x + 1$  is 3; the degree of  $-x^5 + x^2$  is 5, and so on.


From a NURBS modeling point of view, the (degree –1) is the maximum number of "bends" you can get in each span. This determines how much you can affect the shape of the curve.

#### For example:


• A degree-1 curve must have at least two control points. A line has degree 1. It has zero bends.



A degree-2 curve must have at least three control points.
 A parabola, hyperbola, arc, and circle (conic section curves) have degree 2. They have one bend.

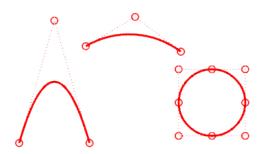


A degree-3 curve must have at least four control points.
 A cubic Bézier has degree 3. If you arrange its control points in a zig-zag shape, you can get two bends.



For more information about curve geometry, see the Wikipedia article, Gallery of Curves at *https://en.wikipedia.org/wiki/Gallery\_of\_curves*.

## **Control points**

Control points influence the shape of a curve or surface. The control point holds such information as location, direction, and weight. You can make subtle changes in the shape of a curve or surface by moving the location of its control points. Rhino offers many tools for editing control points. Some of the later tutorials show control point manipulation.

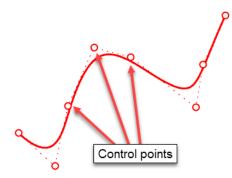

#### **Control point visibility**

To edit curves and surfaces by manipulating control points, use the **PointsOn (F10)** command to turn the control points on.

When you are finished with control-point editing, use the **PointsOff (F11)** command or press **Esc** to turn them off.

Control points of polysurfaces cannot be turned on for editing with PointsOn. Editing the control points of polysurfaces could separate the edges of the joined surfaces creating "leaks" in the polysurface. A special **SolidPtOn** command turns on grip points for polysurfaces, which act like control points.

#### **Change control point locations**

When you move control points, the curve or surface changes, and Rhino smoothly redraws it. Rhino's transform commands, such as Move, Copy, Rotate, and Scale, can manipulate individual or multiple points.

#### Add, delete, or redistribute control points

Adding control points to a curve gives you more control over the shape of the curve. Commands such as **InsertControlPoint**, **InsertEditPoint**, and **InsertKink** add control points to curves.

Manipulating control points also lets you remove kinks, make curves uniform, and add or subtract detail.


Some commands such as **Rebuild**, **Fair**, **ChangeDegree**, and **Smooth** offer some automated solutions for redistributing control points over a curve or surface.

Other commands, such as control point dragging and nudging, **MoveUVN**, and **HBar** let you manually control the location of individual or groups of control points.

The **Delete** key removes selected curve control points. This changes the shape of the curve.

## Polysurfaces


A *polysurface* consists of two or more surfaces that are joined together. A polysurface that encloses a volume of space defines a solid.

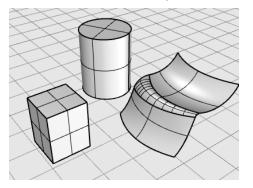

## Solids


A solid is a surface or polysurface that encloses a volume. Solids are created anytime a surface or polysurface is completely closed. Rhino creates single-surface solids, polysurface solids, extrusion solids and mesh solids.

A single surface can wrap around and join itself. Example commands include **Sphere**, **Torus**, and **Ellipsoid**. Control points can be displayed on single-surface solids and moved to change the surface.

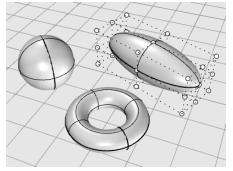


Some Rhino commands create polysurface solids. **Pyramid**, **Cone**, and **TruncatedCone** are examples of commands that create polysurface solids.

The **SolidPtOn** command turns on grip points for polysurfaces, which act like control points.

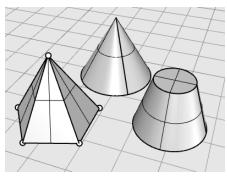


## **Light-weight extrusion objects**

Light-weight extrusion objects use only a profile curve and a length as input instead of the network of isocurves normally needed for NURBS objects. The **Box**, **Cylinder**, **Tube**, and **ExtrudeCrv** commands create extrusion objects. Extrusion objects can be closed with a planar cap or open. These objects will be converted to polysurfaces by some commands if necessary to add more information for editing.

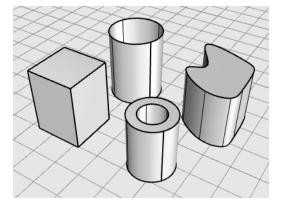

### Polygon mesh objects

Because there are many modelers that use polygon meshes to represent geometry for rendering, animation, stereolithography, visualization, and finite element analysis, the **Mesh** command translates NURBS geometry into polygon meshes for export. Also, the Mesh creation commands **MeshSphere**, **MeshBox**, **MeshCylinder**, etc., draw mesh objects.

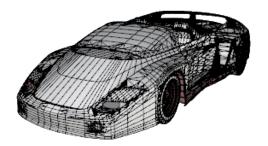

**Note**: There is no easy way to convert a mesh model into a NURBS model. The information that defines the objects is completely different.

However, Rhino has a few commands for drawing curves on meshes and extracting vertex points and other information from mesh objects to assist in using mesh information to create NURBS models.

# 3 - Selecting Objects

Most operations you will do in Rhino require you to select one or more objects. Objects can be selected by clicking anywhere on the object. Click away from the object to deselect it. This method lets you select one object at a time.

Objects can be selected before you start a command. This is called *prepick*. Prepicking is handy for selecting input objects for many commands. The prepicked objects act as input for the first prompt to select objects.

Objects can also be selected during a command sequence anytime the command prompts you to select objects.

By default, objects change color to yellow when they are selected so you can see which objects are selected. This color can be customized to suit you in Rhino Preferences > Colors > Object display > Selected objects.

## Select and deselect objects

## Practice selecting objects


1. Open the tutorial model **Select Objects.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Select Objects)


2. In the **Perspective** viewport, click the sphere to select it.

Notice that the Perspective viewport shows the objects in Shaded mode. The other viewports use Wireframe mode.


In Shaded mode, you can click anywhere on the object to select it. You don't have to aim for one of the wires.

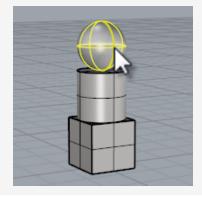

 Hold the **Shift** key and select the cylinder. The cylinder is added to the selection.

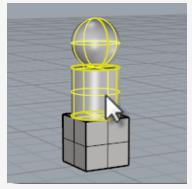

4. Hold the **Command**  $\mathfrak{X}$  key and click the sphere again. The sphere is removed from the selection.

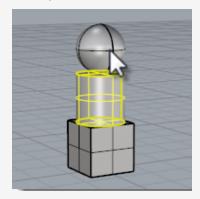

 Click away from the objects, or press the Esc key. The selection is canceled.



s	h	iff	
0			

#### To select additional objects

Hold the Shift key while clicking the objects.

				9	t
сo	m	m	а	n	d

esc

#### To remove objects from the selection

• Hold the **Command**  $\mathfrak{H}$  key and click the objects again.


To cancel the selection

Click away from the objects, or press the **Esc** key.

## **Choose Objects menu**

If you click a location that is very close to the place where several objects are close to each other, it is possible that Rhino will not be able to determine which object you want to select. When this happens, a selection menu will appear with a list the possible objects.

As move the mouse over the object name in the list, each object highlights. You can also scroll through the potential objects using the arrow keys on your keyboard. When the object you want to select highlights, click or press the **Enter** key to select it. Choose **None** to cancel the selection.

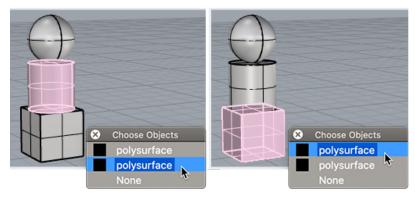

Choose Object menu.

### Select objects with windows


Another method is to make a *window* selection or a *crossing* selection to select multiple objects in one operation.

You can click in an open area of the screen and drag to create a selection window.

A window selection selects all objects completely enclosed by the window. A crossing selection selects all objects that are enclosed by the window or any object the window crosses.


#### To make a window selection

Click in an open area of the screen and drag to the right.

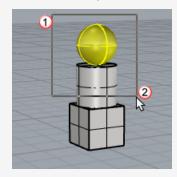

#### To make a crossing selection

Click in an open area of the screen and drag to the left.

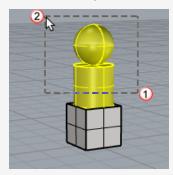

#### To add objects

• Hold the **Shift** key while making a window or crossing selection.

#### To remove objects

• Hold the **Command**  $\mathbb{H}$  key while making a window or crossing selection.


#### Practice window and crossing select

1. In the **Perspective** viewport, click and drag a window around the sphere as shown in the illustration below.




The sphere is selected.

2. In the **Perspective** viewport, hold the **Shift** key then click and drag a window section from left to right around the box and the cylinder as shown in the illustration below.

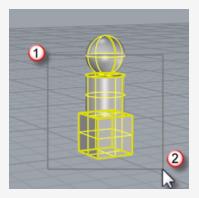

The cylinder and box are added to the selection.

3. In the **Perspective** viewport, hold the **Command ૠ** key then click and drag a crossing selection from right to left over the box and cylinder as shown in the illustration below.

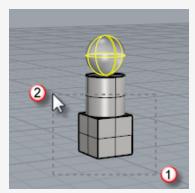

The cylinder and box are removed from the selection.


## Other ways of selecting objects

Rhino has many commands and methods for selecting objects. You can select an object by name, layer, color, type; by capturing with boundaries or crossing fences; by volume shapes, by group name and many others. Search the Help for the topic *Selection commands*.

#### Practice selection by object type


1. In the Value box, type SelAll.

The SelAll command selects all visible, unlocked objects in the model.

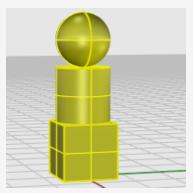


2. Type SelNone.

The SelNone command removes all of the currently selected objects from the selection.

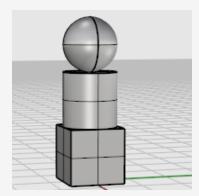


### 3. Type SelSrf.

The SelSrf command selects all visible, unlocked surfaces. In this case, only the sphere is a surface, the other objects are polysurfaces.

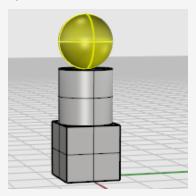

4. Type SelPolysrf.

The SelPolysrf command adds all polysurfaces to the selection. In this case, the cylinder and box are polysurfaces.

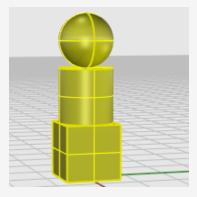

5. Press the **Esc** key.

The Esc key clears the selection the same as the SelNone command.

# Sub-object selection


You can select sub-parts of objects to use in commands, for example, select a surface edge to use as input for a Loft or ExtrudeCrv operation. The available parts include polysurface faces; surface and polysurface edge curves; control points; mesh vertices, faces, boundaries, and edges; and objects within a group. Search the Help for the topic *Sub-object selection*.

### To select parts of objects for use with other commands

Press and hold both the **Command** H and **Shift** keys at the same time and click an object part.

#### **Practice sub-object selection**


1. In the **Perspective** viewport, press the **Command ℋ** and **Shift** keys and click a face of the box as shown in the illustration below.

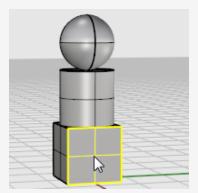

The face you select highlights.

2. Press the **Delete** key.

The face of the box is separated from the box solid and deleted.

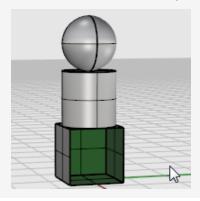

# 4 - Navigating Viewports


Viewports are windows in the graphics area that display views of your model.

You can customize the viewports to suit your preferences. The size of viewports is adjustable; they can be any rectangular size and shape.

Each viewport has its own construction plane and grid that the cursor normally moves on and a projection mode. To toggle between a small viewport and one that fills the graphics area, double-click the viewport title.

# Viewport title

The viewport title has some special functions for manipulating the viewport. To re-size a viewport, drag the viewport border. You can rename viewports, and use predefined viewport configurations from the viewport title menu.




 Click the title to make the viewport active without disturbing the view or the set of selected objects.

Double-click the viewport title to maximize the viewport.
 Double-click again to restore the viewport layout.

### To use the viewport title menu

Right-click the viewport title to display the viewport title menu.

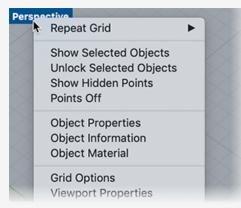

The viewport title menu contains most of viewport and display related commands. The same commands can be found in the **View** menu on the main menu bar.

# **Viewport projection**

Graphical *projection* is used in technical drawing to project an image of a threedimensional object onto an imaginary fixed plane.

The viewport projection can be parallel, three-point perspective, or two-point perspective. The viewport projection is set in Viewport Properties. When no object is selected, the Properties panel shows viewport properties.


	í 🔲 🖓	
Title	Perspective	
Size	893 x 796	
rojectic		
0 F	arallel rospective wo point perspective	
F F F T	arallel hyspective wo point perspective rr	_
F F T Vallpape Che	arallel rospective wo point perspective	

In the default four-viewport layout, there are three parallel viewports (Top, Front and Right) and one perspective viewport.

For more information about graphical projections, see https://en.wikipedia.org/wiki/Graphical\_projection.


## Parallel

In a parallel view, all the grid lines are parallel to each other, and identical objects look the same size, regardless of where they are in space. Parallel views are also called orthogonal views in some systems.

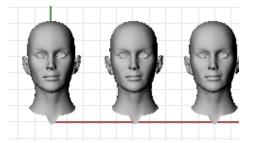

### Perspective

A perspective view, uses three-point perspective. Grid lines converge to a vanishing point. This provides the illusion of depth. Perspective projection makes objects farther away look smaller.

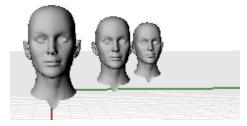

### **Two Point Perspective**

In a two-point perspective view, objects look smaller as their horizontal distance increases, but look the same as their vertical distance increases.



Perspective (left) vs. Two Point Perspective (right).

# **Viewport navigation**

Working in 3-D on a computer requires visualizing 3-D objects drawn on a 2-D medium - the computer screen. Rhino provides tools to help do this.

Rhino's easy view navigation helps you visualize your model. You can look at you model from any direction, look at the whole model, or look into the details. You can change your view in the middle of a command to see precisely where you want to select an object or pick a point.

### **Mouse navigation**

Dragging with the right mouse button easily manipulates the views so you can look at the model from various angles. Mouse navigation works differently in parallel and perspective viewports. In parallel viewports, right mouse drag pans the view. In a perspective viewport, right mouse drag rotates the view, and you must use the **Shift** key modifier to pan the view.

#### **To pan the view**

- In a viewport with a parallel projection, such as the **Top** viewport, drag the mouse with the right mouse button held down.
- In the **Perspective** viewport, hold the **Shift** key, and drag with the right mouse button held down.



#### 📲 redo view changes

If you get lost, there are several ways to get yourself reoriented:

- Press the Home key to step back through your view changes.
- Press the End key to step forward through your view changes.
- To bring all your objects into view, use the **Zoom** command, **Extents** option.

#### To rotate a perspective view

In the **Perspective** viewport, drag the mouse with the right mouse button held down to rotate the view and see the objects from a different angle.

#### To zoom in and out

- ▶ Hold down the Command \overline key and drag up and down with the right mouse button held down.
- If you have a mouse with a wheel, you can also scroll the wheel to zoom in and out.

### Key and mouse combinations



In parallel viewports (for example: Top, Front, and Right), **drag** with the right mouse button.

In perspective viewports, hold the **Shift** key, and **drag** with the right mouse button.



### RotateView

In perspective viewports, **drag** with the right mouse button.

**Note**: Rotating a parallel view is not common. It is a special operation that should be used rarely and with caution.

In parallel viewports (for example: Top, Front, and Right), hold the **Command**  $\mathbb{H}$  and **Shift** keys, and **drag** with the right mouse button.




Hold the **Command**  $\mathbb{H}$  key, and **drag** up and down with the right mouse button, or rotate the mouse wheel.

# Viewport display modes

You can view your model in a variety of wireframe, shaded and rendered methods that depend on your needs. Wireframe mode usually offers the fastest display speed. Shaded modes offer the ability to view surfaces and solids with shading to help you visualize the shapes.


### Wireframe

In **Wireframe** mode, surfaces look like a set of curves that cross each other. These curves are called *isoparametric curves* or *isocurves*. Isocurves do not actually define the surface. They are merely a visual aid.

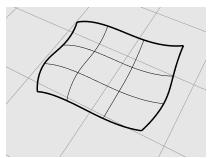

# To set wireframe mode

- Open the sample model, Start.3dm.
   (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Start)
- 2. Click the left mouse button in the **Perspective** viewport to make it active. An active viewport is the viewport where all your commands and actions take place.
- 3. Right-click on the viewport title menu, and click Wireframe.

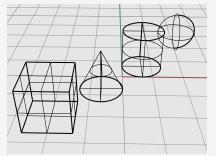


### Shaded

The **Shaded** modes, (for example, Shaded, Rendered, Artistic, and Pen) display surfaces and solids with render meshes to show surfaces.





1. On the viewport title menu, click **Shaded**.

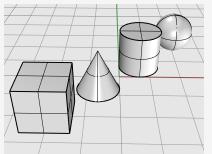

2. Rotate your view by holding down the right mouse button and dragging from the bottom of the view upwards.

You are now under the objects looking up. The construction plane grid helps you stay oriented.

3. Press the **Home** key to undo your view changes.




The Rendered mode shows objects with lighting and render materials applied.





The Raytraced mode displays objects with materials and raytraces the scene and lighting in real-time.

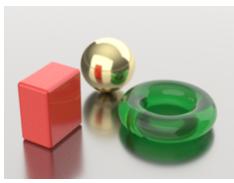

### **Other shaded modes**

Other display modes and custom settings are described in the Rhino Help.




Artistic (left) and Pen (right) display modes.

# 5 - Accurate Modeling

The cursor can always move freely, but sometimes you may need to put some restrictions on the cursor. You can restrict the cursor's movement to the construction plane grid, a distance or an angle from a point, snap to specific locations on existing objects, or enter Cartesian coordinates to locate points in 2-D or 3-D space.


# The Rhino cursor

The Rhino cursor consists of a marker and a cross. The marker usually stays at the center of the cross. The cross always follows the mouse movement.

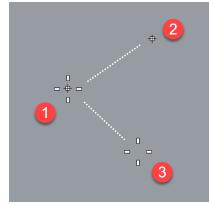

Rhino cursor (1), Marker (2) and Cross (3)


The marker may leave the cross when a constraint is in effect. For example, when Elevator mode is active, a *tracking line* connected to the marker displays. The location of the marker is picked when you click the left mouse button.

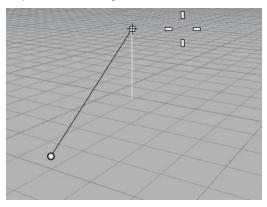

# Grid snap

Grid snap constrains the marker to the crossing points of an imaginary grid that extends infinitely in the x- and y-directions.

Click **Grid Snap** in the top panel to turn grid snap on and off. Use the Grid command to set the snap spacing and other options.

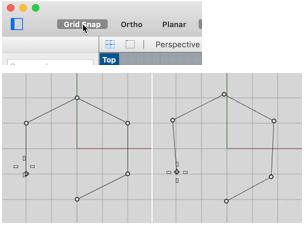


Grid snap on (left), Grid snap off (right)

# Ortho mode

Ortho mode constrains the marker movement or object dragging to a specific set of angles. By default, this is parallel to the grid lines, but you can change this.


Click **Ortho** in the top panel to turn ortho on and off.

Press and hold the **Shift** key to temporarily toggle the ortho mode.

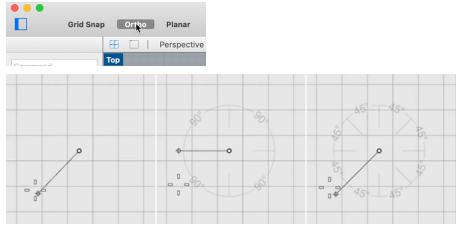

Ortho off (left), Ortho 90° (center), Ortho 45° (right)

Ortho is active after the first point for a command. For example, after picking the first point for a line, the second point is constrained to the ortho angle.

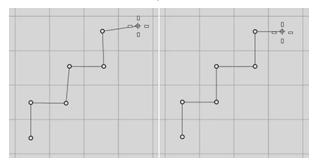

Ortho off (left), Ortho on (right)

If you need a different angle for only a single operation, angle constraint is faster to use. Enter a specific angle for one operation instead of changing the ortho angle and then changing it back.

# **Object snaps**

When Rhino asks you to pick a point, you can use object snaps to pick a precise location on an existing object. When you move the cursor near a location on an object that corresponds to an object snap, the marker jumps to that location.

#### The Osnap control

Object snaps are set in the Osnap control. The Osnap control is located at the bottom of the left sidebar.


<ul> <li>Persistent</li> <li>One shot</li> </ul>	Front
End Near Point Midpoint Center	

### Persistent object snaps

A persistent object snap stays on until you turn it off. You can turn on as many persistent object snaps as you need.

#### Turn on persistent object snaps

In the Osnap panel, select **Persistent** and then click object snap check boxes.



### **One-time object snaps**

Multiple persistent object snaps may interfere with one another, so you can also turn on an object snap for a single pick. One-time object snaps override persistent object snaps. This lets you keep your persistent object snaps set, but to override them as needed with a one-time object snap.

Turn on one-time object snaps
In the Osnap panel, select <b>One shot</b> and then click an object snap check box.
<ul> <li>Persistent</li> <li>One shot</li> <li>End</li> <li>Near</li> <li>Point</li> <li>Midpoint</li> <li>Center</li> <li>Intersection</li> <li>Perpendicular</li> </ul>
-Or-
<ul> <li>Click the Osnap button in the top panel. In the pop-up, select <b>One shot</b> and then click an object snap check box.</li> </ul>

<ul> <li>Persistent</li> <li>One shot</li> <li>End</li> <li>Near</li> <li>Point</li> <li>Midpoint</li> <li>Center</li> <li>Intersection</li> </ul>	

- -Or-
- During a command, type an object snap name such as, cen (center), int (intersection), tan (tangent), and press Enter.

Object snaps normally take precedence over grid snap or other constraints. In some situations object snaps work in conjunction with other constraints. You will see examples of this later in this chapter. For more information, including video demonstrations, see the Rhino help topic *Object snaps*.

### To temporarily suspend all persistent object snaps

In the **Osnap** panel, click the **Disable all** button.

All persistent object snaps will be suspended, but remain their checking status.

### To turn on one object snap and turn all others off with one click

In the Osnap panel, hold Alt and click the object snap you want to turn on. All other object snaps will turn off.

### **Object snaps using references**

Some special object snaps let you select multiple reference points or add other advanced controls.

#### To turn on complex object snaps

During a command, when you are at a prompt to pick a point, type one of these commands:

From, PerpendicularFrom, TangentFrom, AlongLine, AlongParallel, OnCrv, OnSrf, OnPolysurface, OnMesh, PersistentOnCurve, PersistentOnSurface,

PersistentOnPolySurface and PersistentOnMesh.

See the Rhino help topic *Object snaps* for more information about these object snaps.

## **Constrain cursor movement**

When entering points, you can restrict the cursor to a distance or angle from the previous point.

### Ortho

Ortho restricts the cursor movement to a 90-degree angle from the last point created. **Note**: The default angle is 90 degrees, but any angle can be used. You can change Ortho angle in **Rhino Preferences > Modeling Aids > Snaps**.

#### Example: Draw a line using Ortho

- 1. Type Line.
- 2. At the Start of line prompt, place the first point.
- 3. At the End of line prompt, drag the cursor away from the start point.
- 4. Click **Ortho** in the top panel to toggle Ortho on and off while dragging the cursor. You will see the cursor jump to 90 degrees when Ortho is on and drag freely when Ortho is off.


**Note**: A shortcut for toggling Ortho on and off temporarily is to hold down the **Shift** key.

#### **Distance constraint**

The distance constraint restricts the distance the cursor can travel from the previous point. Set the distance constraint during a command by typing a number at the command prompt.

#### Example: Draw a line using a distance constraint

- 1. Type Line.
- 2. At the **Start of line** prompt, place the first point.
- At the End of line prompt, type a number, and press Enter.
   Once you have set the distance, drag the line around. You will see that the marker cannot move away from the first point more than the set distance.
   You can also use other snaps such as Grid snap or an object snap to point the line in a direction.
- 4. Drag the line around the first point until it heads the direction you want it to go, and pick a point for the end of the line.

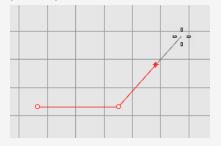

### Angle constraint

Angle constraint is similar to Ortho, but you can set any angle. The angle constraint setting is only in effect for the next pick.

#### Example: Draw a line using an angle constraint

- 1. Type Line.
- 2. At the **Start of line** prompt, place the first point.
- 3. At the **End of line** prompt, type < followed by an angle value, such as **35**.

The angle symbol < is used because it is similar to the symbol used in geometry to indicate an angle.

- 4. Once you have set the angle, drag the line around the first point. You will see that the marker jumps around the first point in 35-degree increments.
- 5. Drag the line to the distance you want and pick a point for the end of the line.

### Distance and angle together

Distance and angle constraints can be used at the same time. The order you enter the distance and angle does not matter.

#### Example: Draw a line using a distance and angle together

- 1. Type Line.
- 2. At the **Start of line** prompt, place the first point.
- 3. At the **End of line** prompt, type a distance, and press **Enter**.
- 4. At the next **End of line** prompt, type the < character and an angle value, and press **Enter**.
- 5. Drag the line.


You will see that the marker is restricted to the distance from the first point and at increments of the angle you set.



SmartTrack is a system of temporary reference lines and points drawn in the Rhino viewport using implicit relationships among 3-D points, other geometry, and the coordinate axes directions.

Temporary infinite lines (tracking lines) and points (smart points) can be used by object snaps just like real lines and points.

You can snap to intersections of the tracking lines, perpendiculars, and directly to smart points as well as intersections of tracking lines and real curves. The tracking lines and smart points are displayed only for the duration of a command.

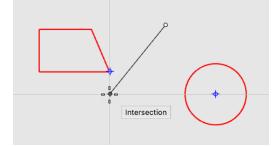


# **Coordinate systems**

Rhino uses two coordinate systems: construction plane coordinates and world coordinates. Construction plane coordinates are defined for each viewport. World coordinates are fixed in 3-D space.

For more information about coordinate systems, see www.mathopenref.com/coordinates.


### **Right-hand rule**

Coordinate systems follow what is called the *right-hand rule*. The right-hand rule can help you determine the direction of the z-axis in a coordinate system. Form a right angle with the thumb and forefinger of your right hand. When your thumb points in the positive x-direction, your forefinger points in the positive y-direction, and the palm of your hand faces in the positive z-direction.

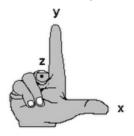

### **Construction plane coordinates**

Each viewport has its own *construction plane*. A construction plane is like a tabletop that the cursor moves on unless you use coordinate input, elevator mode, object snaps, or a few other instances where input is constrained. By default, each viewport's construction plane is independent of those in other viewports.

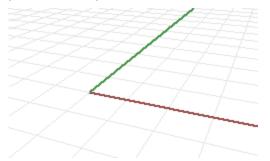

Rhino's standard viewports come with construction planes that correspond to the viewport. An exception is the default Perspective viewport, which uses the World Top construction plane, the same as the default Top viewport.

The grid helps you visualize the construction plane. The dark red line represents the construction plane positive x-axis for that viewport. The dark green line represents the construction plane positive y-axis for that viewport. The red and green lines meet at the construction plane origin (0,0) for that viewport.

**Note**: By default there is no line showing the construction plane z-axis in order to cut down on clutter on the screen.


#### Example: Draw a line using 2-D construction plane coordinates

- 1. Type Line.
- 2. At the **Start of line** prompt, type **1,1**.

These are the construction plane coordinates for the start point of the line in the format **x**,**y** where **x** is the x-coordinate and **y** is the y-coordinate of the point. There are no spaces between the coordinate values.

3. At the **End of line** prompt, type **4,2**.

A line is drawn starting at 1 unit from the construction plane origin in the positive x-direction and 1 unit from the construction plane origin in the positive y-direction and ending at 4 units from the origin in the positive x-direction and 2 units from the origin in the positive y-direction.

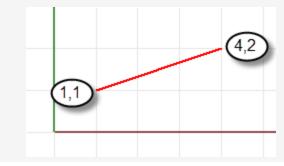

#### 3-D construction plane coordinates

You can also use 3-D coordinates to place points that do not lie on the construction plane. To use 3-D coordinates, during a command, at a prompt requesting a point, type the coordinates in the format **x**,**y**,**z** where **x** is the x-coordinate, **y** is the y-coordinate, and **z** is the z-coordinate of the point.

#### Example: Draw a point in 3-D using construction plane coordinates

#### 1. Type Point.

#### 2. At the Location of point object prompt, type 3,4,10.

This places a point object 3 units from the construction plane origin in the x-direction, 4 units from the origin in the y-direction, and 10 units from the origin in the z-direction.

#### **Relative coordinates**


Use relative coordinates to locate points according to their relationship to the previous active point. Rhino remembers the last point used, so you can enter the next point relative to it. Relative coordinates are useful for entering a list of points where the relative locations instead of absolute locations of the points are known.

To enter relative coordinates, at a command prompt, type the coordinates in the format **rx**,**y** where **r** signifies that the coordinate is relative to the previous point.

#### Example: Draw a line using relative coordinates

- 1. Type Line.
- 2. At the **Start of line...** prompt, click to place the first end of the line.
- 3. At the **End of line...** prompt, type **r2,3**, and press **Enter**.

The line is drawn to a point 2 units in the x-direction and 3 units in the y-direction from the last point.

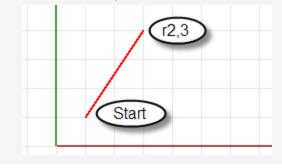

### World coordinates

Rhino contains one world coordinate system. The world coordinate system cannot be changed. When Rhino prompts you for a point, you can type coordinates in the world coordinate system in the format **wx,y,z**.


The arrow icon in the lower left corner of each viewport displays the direction of the world x-, y-, and z-axes. The arrows move to show the orientation of the world axes when you rotate a view.

# **Elevator mode**

Elevator mode lets you pick points that are off the construction plane in the positive or negative z-direction. Elevator mode requires two point picks to define the point. The first point sets the base point. The second specifies how far the final point is above or below the base point.

To move the marker in the construction plane z-direction, hold the **Command**  $\mathbb{H}$  key and click a point on the construction plane, and then drag vertically from the construction plane and click to pick a point.

Using elevator mode to move your pick point vertically from the construction plane lets you work in the Perspective viewport more easily.



#### Example: Draw a 3-D curve using elevator mode

- 1. Type Curve.
- 2. At the Start of Curve prompt, in the Perspective viewport, place the first point.
- 3. At the **Next point of curve...** prompt, pick a second point in the **Perspective** viewport.
- 4. At the **Next point...** prompt, hold the **Command ℋ** key and pick a point in the **Perspective** viewport.

This is the base point for the elevator mode action. After the base point is specified, the marker is constrained to a tracking line perpendicular to the construction plane that passes through the base point.

5. Drag the mouse in the **Perspective** viewport.


A tracking line displays indicating that the marker is constrained to move perpendicular to the construction plane.

6. Pick a second point to specify the z-coordinate of the desired point.

-Or-

Type a number to specify the height above the construction plane. Positive numbers are above the construction plane; negative numbers are below.

You can use other constraints such as coordinates, object snaps, or grid snap for the first point, and you can use object snaps for the height.

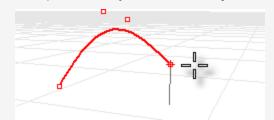

For a short video demonstration of using elevator mode, search the Rhino Help for "Elevator mode."

#### See also

For more information about the mathematical principles involved in 3-D modeling, see: *www.mathopenref.com*.

# 6 - Create Surfaces from Curves


One way of working in 3-D is to draw curves that represent edges, profiles, cross-sections, or other surface features and then to use surfacing commands to create surfaces from those curves. Curves can be free-standing curves or the edges of existing surfaces.

# Surface from edge curves


You can create a surface from three or four curves that define the edges of the surface.



- Open the tutorial model EdgeSrf.3dm. (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > EdgeSrf)
- On the Surface menu, click Edge Curves.
   Optional: Review the Help topic for the EdgeSrf command in Rhino Help.
- 3. At the **Select 2, 3, or 4 open curves** prompt, select the four curves as shown in the illustration below.

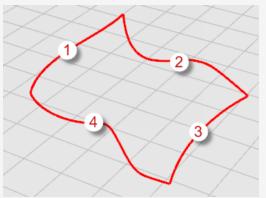

To select the curves, you can click each individual curve using the **Shift** key, or you can use a window or crossing selection to select all of the curves at once. To review selecting objects, see *Chapter 3, Selecting Objects*. A surface is created from the curves, which define its edges.

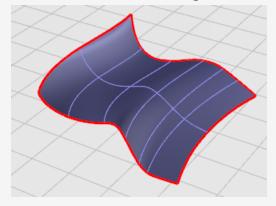

# **Extrude curves**


Surfaces can be created by extruding curves in a straight line perpendicular to the construction plane.

## Create an extruded surface


1. Open the tutorial model **ExtrudeCrv.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Extrude)

- 2. On the **Surface** menu, click **Extrude Curve**, and then click **Straight**. *Optional:* Review the Help topic for the ExtrudeCrv command in Rhino Help.
- 3. At the **Select curves to extrude** prompt, select the curve (1) as shown in the illustration below.

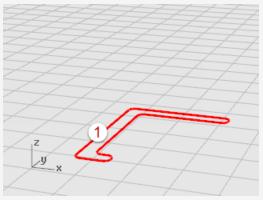

4. At the **Extrusion distance** prompt, drag a distance with your mouse and click.

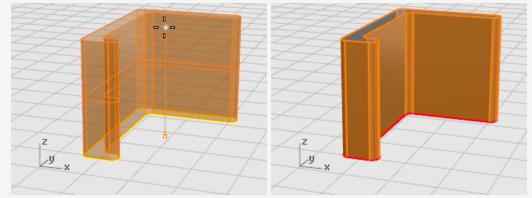

# Loft curves

Lofting creates a smooth surface that blends between selected curves. The curves define "ribs" for the surface you are creating.

# Create a lofted surface


1. Open the tutorial model Loft.3dm.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Loft)

2. On the **Surface** menu, click **Loft**.

Optional: Review the Help topic for the Loft command in Rhino Help.

3. At the **Select curves to loft** prompt, select the three curves (1), (2), and (3) as shown in the illustration below, and press **Enter**.

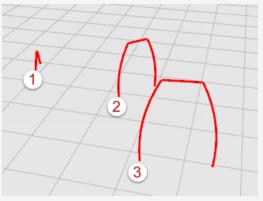


**Tip**: Select the curves by picking near the same end where the numbers are. This avoids twisting the loft surface. In this model, you can use any selection method. The Loft command will sort out the order of the curves. In other more complex cases, picking the curves near the same end may be important, and you may have to make adjustments for the loft to work properly.

4. in the **Loft** dialog box, click the drop-down menu under **Style** to try some of the options.

The default style is **Normal**. As you change the style, the preview will update in real time to show you what the results will be.

5. In the **Loft Options** dialog box, click **Loft**.

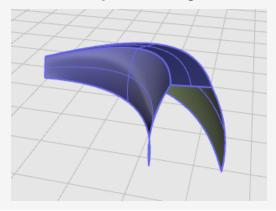

# **Revolve curves**

2

Revolving creates a surface by revolving curves about a *revolve axis*. The curve defines the silhouette of the revolved surface. This action is sometimes called *lathing* in other programs.

## Create a revolved surface


1. Open the tutorial model **Revolve.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Revolve)

- 2. In the **Osnap** panel, click **End**.
- 3. On the **Surface** menu, click **Revolve**.


*Optional:* Review the Help topic for the Revolve command in Rhino Help.

4. At the **Select curves to revolve** prompt, select the curve (1) and press **Enter**.

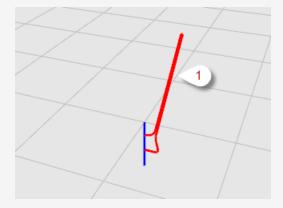


5. At the **Start of revolve axis** prompt, snap to one end of the line (2) that defines the revolve axis.


**Note**: A reference line is not strictly necessary; you can pick any two points to define the axis.

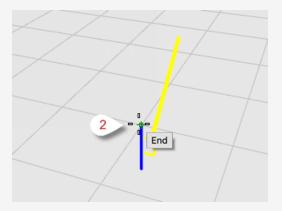

6. At the **End of revolve axis** prompt, snap to the other end of the line (3) that defines the revolve axis.

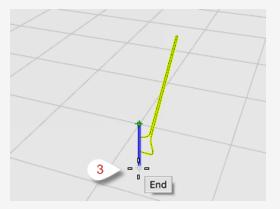

At the Start angle... prompt, click the Full Circle option.
 The Full Circle option creates a complete 360-degree surface.

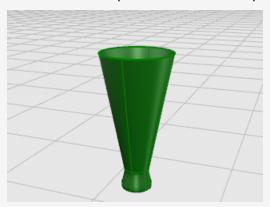

# **Revolve curves with a rail**

Rail revolve creates a surface by revolving a *profile curve* around a reference *axis* while at the same time following a *rail curve* as closely as possible. The *profile curve* defines the silhouette of the surface, and the *rail curve* defines a path the profile curve will try to follow.




1. Open the tutorial model **RailRevolve.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > RailRevolve)


2. On the **Surface** menu, click **Rail Revolve**.

*Optional:* Review the Help topic for the RailRevolve command in Rhino Help.


3. At the **Select profile curve** prompt, select the profile curve (1).

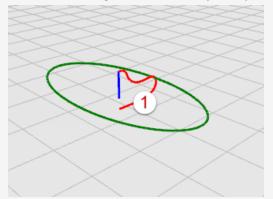


4. At the **Select rail curve...** prompt, select the rail curve the revolve will follow (2).

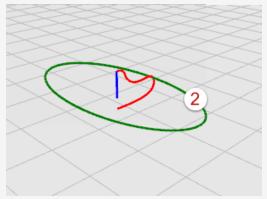

5. At the **Start of RailRevolve axis** prompt, snap to an endpoint of the axis line (3).

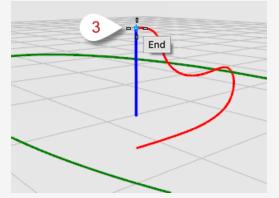

6. At the **End of RailRevolve axis** prompt, snap to the other end of the axis line (4).

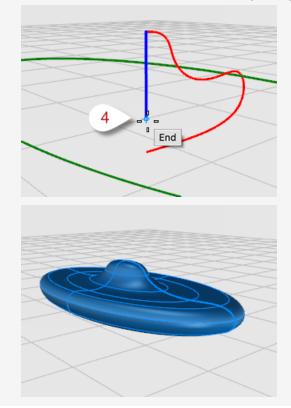

# Sweep along one rail curve


Sweeping with one rail creates a smooth surface with from multiple *cross-section curves* and a single *rail* curve. The *cross-section curves* define the surface shape, and the *rail* curve defines a path the surface will follow.

# Create a sweep surface with one rail

- Open the tutorial model Sweep1.3dm.
   (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Sweep1)
- 2. On the **Surface** menu, click **Sweep 1 Rail**.

*Optional:* Review the Help topic for the Sweep1 command in Rhino Help.


3. At the **Select rail** prompt, select the rail curve (1).

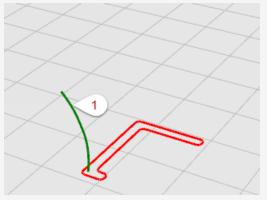


4. At the **Select cross section curves...** prompt, select the cross-section curve (2), and press **Enter**.

Only one cross-section curve is used in this example.

5. At the **Drag seam point to adjust...** prompt, press **Enter**. No adjustment is necessary in this case.

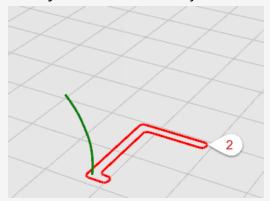

In the Sweep 1 Rail Options dialog box, click Sweep.
 The default Freeform option will be used.

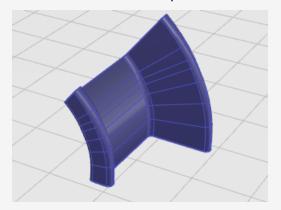

# Sweep along two rail curves

Sweeping with two rails creates a smooth surface with from multiple *cross-section curves* and two *rail curves*. The *cross-section curves* define the surface shape, and the *rail curves* define the path the two edges of the surface will follow as closely as possible. Use the Sweep2 command when you want to control the location of the edges of the surface; for example, when the using the edges of other surfaces as the rail curves.

## Create a sweep surface with two rail curves

1. Open the tutorial model **Sweep2.3dm**.


2

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Sweep2)


2. On the Surface menu, click Sweep 2 Rails.

*Optional:* Review the Help topic for the Sweep2 command in Rhino Help.


- 3. At the Select first rail... prompt, select the first rail curve (1).
- 4. At the Select second rail... prompt, select the second rail curve (2).

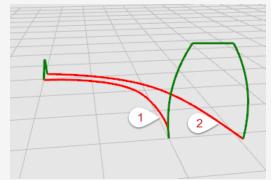

5. At the **Select cross section curves** prompt, select the two cross-section curves (3) and (4), and press **Enter**.

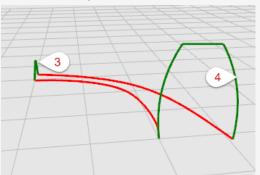

In the Sweep 2 Rails Options dialog box, click Sweep.
 No further adjustments are needed in this case.

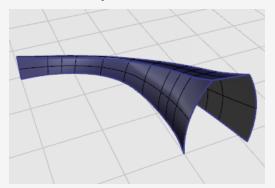

# 7 - Edit Curves and Surfaces

The editing operations in this section break objects apart, cut holes in them, and put them back together. Some of these commands join curves to curves, or surfaces to surfaces or polysurfaces, and break a composite curve or polysurface into its components.

The commands: Join, Explode, Trim, and Split apply to curves, surfaces, and polysurfaces.



The Join command connects curves or surfaces together into one object.

Join turns lines that touch end to end into polylines, curves that touch end to end into polycurves, and surfaces and polysurfaces that touch on an edge into polysurfaces or solids.

When a curve is selected first, surface edges or mesh edges can be joined with the curve to create a polyline or polycurve.




1. Open the tutorial model Join Curves.3dm

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Join Curves)

2. Select all of the curves using a window or crossing.


The command history displays **5 curves added to selection**.

The Object Type in the Properties panel shows 5 open curves.

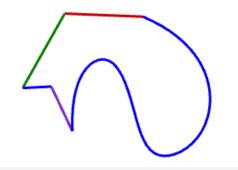

3. On the **Edit** menu, click **Join**.

*Optional:* Review the Help topic for the Join command in Rhino Help. The command history displays **5 curves joined into one closed curve**. The **Object Type** in the **Properties** panel shows **closed curve**.

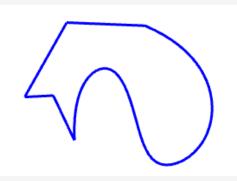

# Join surfaces into a polysurface


- Open the tutorial model Join Surfaces.3dm. (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Join Surfaces)
- Select both of the surfaces using a window or crossing.
   The command history displays 2 surfaces added to selection.
   The Object Type in the Properties panel shows 2 surfaces.



3. On the **Edit** menu, click **Join**.


The command history displays **2 surfaces or polysurfaces joined into one open polysurface**.

The **Object Type** in the **Properties** panel shows **open polysurface**.

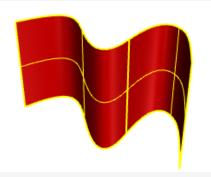




- Open the tutorial model Join Solid.3dm. (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Join Solid)
- Select all of the surfaces using a window or crossing.
   The command history displays 6 surfaces added to selection The Object Type in the Properties panel shows 6 surfaces.

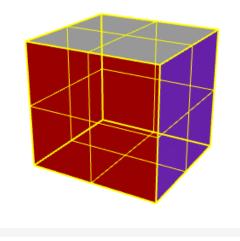

3. On the **Edit** menu, click **Join**.

The command history displays 6 surfaces or polysurfaces joined into one closed polysurface.

The **Object Type** in the **Properties** panel shows **closed solid polysurface**.

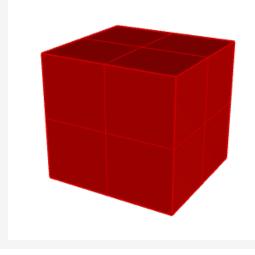

# \rm 🖌 Explode

The **Explode** command removes the connection between joined curves and polysurfaces. Explode works on any object that can be reduced to its component parts.



1. Open the tutorial model Explode Curves.3dm.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Explode Curves)

2. Select the curve.

The command history displays **1 curve added to selection.** 

The **Object Type** in the **Properties** panel shows **closed curve**.



3. On the **Edit** menu, click **Explode**.

*Optional:* Review the Help topic for the Explode command in Rhino Help. The command history displays **Exploded a curve into 5 segments**. The **Object Type** in the **Properties** panel shows **5 open curves**.




**Note**: For the illustration, the **ScalePositions** command was used to separate the individual curves. The Explode command does not move the curves.

### 存 Explode a polysurface into individual surfaces

- Open the tutorial model Explode Polysurface.3dm. (Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Explode Polysurface)
- 2. **Select** the polysurface.

The command history displays **1 polysurface added to selection.** 

The **Object Type** in the **Properties** panel shows **open polysurface**.

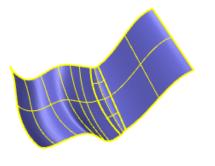


3. On the **Edit** menu, click **Explode**.

The command history displays Exploded a polysurface into 3 surfaces.

The **Object Type** in the **Properties** panel shows varies.

Three surfaces were created, two surfaces and a trimmed surface. Select each surface individually to check the object type.

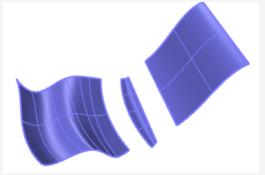

**Note**: For the illustration, the **ScalePositions** command was used to separate the individual surfaces. The Explode command does not move the exploded surfaces.

### **Trimming and Splitting**

The **Trim** and **Split** commands are similar. They both cut objects with other objects. When you trim an object, you select the parts to remove and they are deleted. When you split an object, no parts are deleted.



### Trim

The Trim command cuts and deletes selected portions of an object at the intersection with another object used as a cutter.

#### Trim curves


1. Open the tutorial model Trim Curves.3dm.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Trim Curves)

2. On the Edit menu, click Trim.

Optional: Review the Help topic for the Trim command in Rhino Help.

- 3. At the Select cutting objects prompt, select the blue curve (1) as illustrated below, and press Enter.
- 4. At the Select object to trim prompt, select the right side of the red circle (2) and the black rectangle (3), and press Enter.

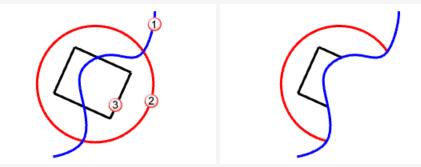

The circle and the rectangle are trimmed by the blue curve.

# 🕂 Trim surfaces


1. Open the tutorial model **Trim Surfaces.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Trim Surfaces)

- 2. On the **Edit** menu, click **Trim**.
- 3. At the **Select cutting objects** prompt, select the red surface as illustrated below, and press **Enter**.



4. At the **Select object to trim** prompt, select the right side of the red circle and the black rectangle, and press **Enter**.

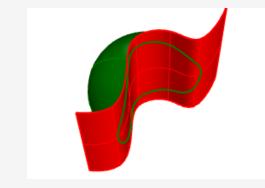

# 📕 Split

The Split command divides objects into parts using other objects at the intersection with another object used as a cutter.




1. Open the tutorial model **Split Curves.3dm**.


(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Split Curves)

2. On the Edit menu, click Split.

*Optional:* Review the Help topic for the Split command in Rhino Help.

- 3. At the **Select object to split...** prompt, select the red circle (1) and the black rectangle (2), and press **Enter**.
- 4. At the **Select cutting objects** prompt, select the blue curve (3) as illustrated below, and press **Enter**.

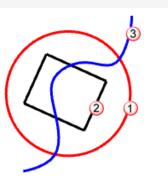

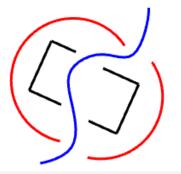


The red circle and the black rectangle are split by the blue curve. **Note**: For the illustration, the individual curves were moved. The Split command does not move the split objects.

# Split surfaces

1. Open the tutorial model **Split Surfaces.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Split Surfaces)

2. **Select** the green sphere.

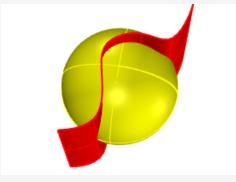

**Note**: This is an example of pre-picking input for a command. You can select the input for the first prompt of most commands.

- 3. On the **Edit** menu, click **Split**.
- 4. At the **Select cutting objects** prompt, select the red surface, and press **Enter**.





The sphere is split by the red surface.

**Note**: For the illustration, the split surface was moved. The Split command does not move the split objects.



The Untrim command removes trim curves from a surface restoring the underlying untrimmed object.

# Untrim surfaces

1. Open the tutorial model **Untrim Surfaces.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Untrim Surfaces)

2. Press **F10** to turn on the control points for the green surface.


The control point array shows that this surface is actually a trimmed sphere. When the trim curves are removed, the surface fills in to reform the original sphere.



3. On the Edit menu, click Untrim.


Optional: Review the Help topic for the Untrim command in Rhino Help.

4. At the **Select edge to untrim...** prompt, select the edge of the hole (1) as illustrated below.

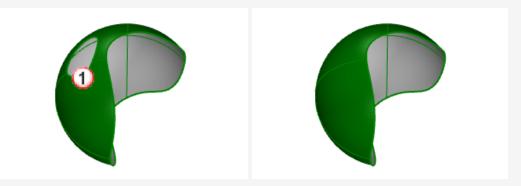

The hole edge is deleted causing the hole to be removed.

5. At the next **Select edge to untrim...** prompt, select the edge of the surface (2) as illustrated below.

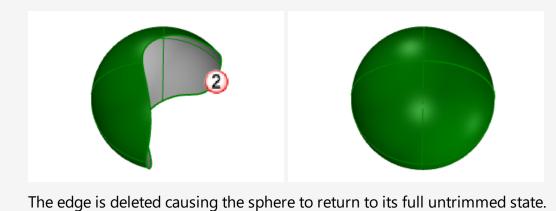

# 8 - Transforms - Move, Copy, Rotate, and Scale

Transforms change the location, rotation, number and shape of whole objects by moving, mirroring, arraying, rotating, scaling, shearing, twisting, bending, and tapering. The transform commands do not break the objects into pieces or cut holes in them.

**Note**: For all of the following exercises, the images were captured using **Shaded** mode display.

### Move

Use the **Move** command when you want to move an object a certain distance or if you want to use object snaps to place an object accurately.


You can pick these locations on the screen or type coordinates in the Value box.

#### Practice moving objects

The object of this exercise is to move a sphere from the center of the sphere to the coordinate system origin at 0,0,0.

The **Move** command requires a *from* and *to* location.


- 1. Start a new model.
- 2. Draw a **Sphere** anywhere on the screen.

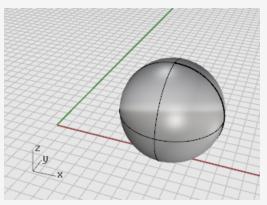


- 3. Select the sphere.
- 4. On the Transform menu, click Move.

Optional: Review the Help topic for the Move command in Rhino Help.

5. At the **Point to move from** prompt, with the **Center** object snap on, move the mouse around the edge of the sphere until the **Center** tooltip displays and click.

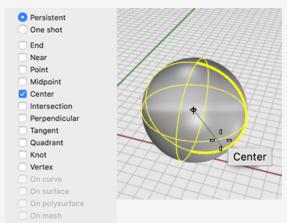

6. At the **Point to move to** prompt, type **0,0,0**.
The center of the sphere moves to the 0,0,0 coordinate point. **Tip**: Simply typing **0** is a shortcut for the coordinates **0,0,0**.

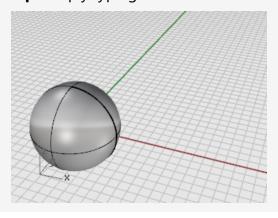

#### Move objects by dragging


The quickest way to move objects is to click the object and drag it. Rhino provides tools for accuately dragging objects. You can drag objects in any viewport. Object snaps help align objects to each other.

#### Practice dragging objects

1. Open the tutorial model **Drag Objects.3dm**.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > User's Guide > Drag Objects)

- 2. In the **Osnap** panel, turn on the **Center**object snap.
- 3. In the **Perspective** viewport, hold down the mouse button and move the mouse on the cone's bottom edge until the **Center** object snap tooltip displays.
- 4. Drag the cone until the center of the cone's base lines up with the top surface of the cylinder, and the **Center** object snap for the cylinder's top face displays.

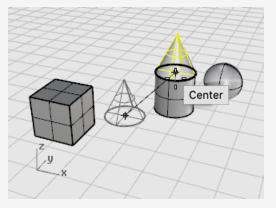

5. Release the mouse button to place the cone.

**Note**: Dragging with accuracy like this can be tricky. Keep your eye on the object snap tooltips.

#### Move objects using elevator mode

You can press the **Command** 光 key to move objects in the z-direction. This is called *elevator mode*. See *Chapter 5, Accurate Modeling, Elevator mode*.

Elevator mode is similar to **Ortho**, except the movement is vertical to the active construction plane.

To practice using elevator mode to move vertically, you are going to move the box to a location five units above the center of the sphere.


Using elevator mode to move objects vertically lets you work in the **Perspective** viewport more often.

# Move the box with reference to another object


**Note**: For the following images, the Display Mode **Shade-highlight selected surfaces and polysurfaces** option has been turned on.

(Rhinoceros > Preferences > Display Modes > Shaded > Objects > Selection)

- 1. Turn Ortho off.
- 2. On the Transform menu, click Move.
- 3. In the **Perspective** viewport, rotate the view so the sphere is toward the front.
- 4. Select the box.

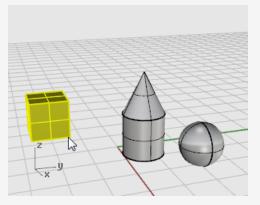


5. At the **Point to move from...** prompt, turn on the **End** object snap and click the lower right corner of the box.

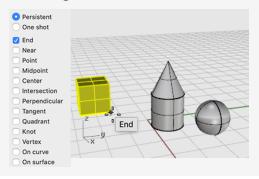


6. At the **Point to move to** prompt, turn on the **Center** object snap.

Drag the box around the equator of the sphere until the **Center** tooltip displays.

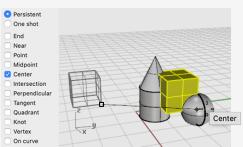

- 7. Hold down the **Command**  $\mathfrak{H}$  key, and click at the center of the sphere.
- 8. Release the mouse button and the **Command**  $\mathbb{H}$  key, and start to drag the box. The box can now move only up and down in the z-direction.

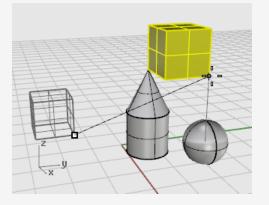

In the Value box, type 5, and press Enter.
 The box will be placed so that the selected end of the box is 5 units in the z-direction from the center of the sphere.

### **Copy objects**


The **Copy** command makes copies of objects. Like the **Move** command, the **Copy** command requires a *from* and *to* location.

# Practice copying objects


1. On the **Transform** menu, click **Copy**.

*Optional:* Review the Help topic for the Copy command in Rhino Help.

2. In the **Perspective** viewport, **select** the cone and the cylinder.

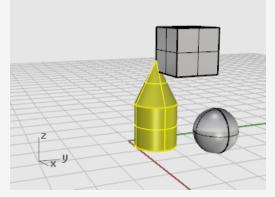


3. At the **Point to copy from...** prompt, click anywhere in the **Top** viewport.

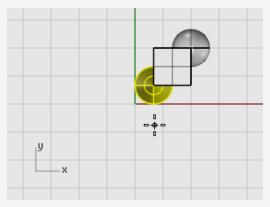

4. At the **Point to copy to...** prompts, click where you want the copies.

5. When you have enough copies, press **Enter** or right-click the mouse to end the command.

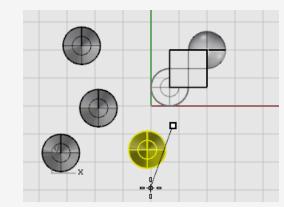


#### Rotate

The Rotate command rotates an object around a center point.




1. Open the tutorial model Rotate-Scale.3dm.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Rotate-Scale)

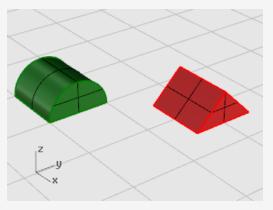

2. Select the green half-cylinder as shown in the illustration below.

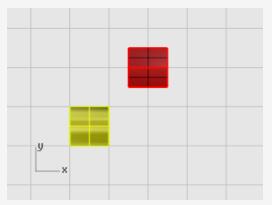


3. On the **Transform** menu, click **Rotate**. *Optional:* Review the Help topic for the Rotate command in Rhino Help. 4. in the Top viewport at the **Center of rotation...** prompt, with the **End** object snap on, click the lower left corner of the half-cylinder as shown in the illustration below.

<ul> <li>Persistent</li> <li>One shot</li> </ul>					
🕑 End					
Near		_	_		
Point					
Midpoint					
Center		- <b>0</b> -			
Intersection		<sup>®</sup> En	d		
Perpendicular			-		
Tangent	y				
Quadrant					
Knot		×			
Vertex					


- 5. In the status bar turn **Ortho** on.
- 6. At the **Angle or first reference point...** prompt, drag the cursor to the right as shown in the illustration below, and click.

This establishes the base angle for the rotation.

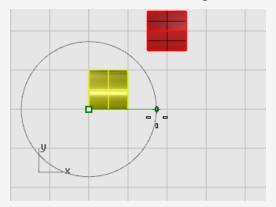

7. At the **Second reference point...** prompt, drag the cursor up as shown in the illustration below, and click.

The half cylinder rotates 90 degrees counter-clockwise.

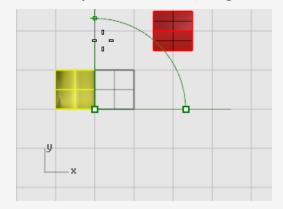


### Scale

The **Scale** commands give you control over the direction of the scale. You can re-size objects uniformly in one, two, or three directions, or scale an object with a different scale factor in each direction.

# **I** Scale the prism

1. In the same Rotate-Scale model, **select** the red prism shape.

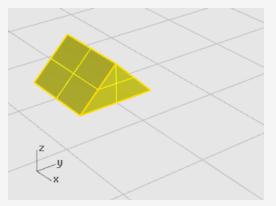


2. On the **Transform** menu, click **Scale**, and then click **Scale 3-D**.

*Optional:* Review the Help topic for the Scale command in Rhino Help.

3. At the **Base point...** prompt, with the **End** object snap on, click the left corner of the prism as shown in the illustration below.


This sets the base point from which the object will grow or shrink.

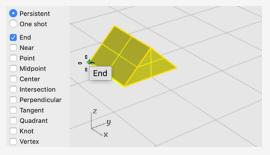


**Note:** In this simple example, you will first show the object's original size by picking two points, a base point and a first reference point. Then you will show the object's new size by picking a second reference point.

4. At the **Scale factor or first reference point...** prompt, click the right corner of the prism as shown in the illustration below.

The distance between the base point and the first reference point sets the original size for the scale operation.

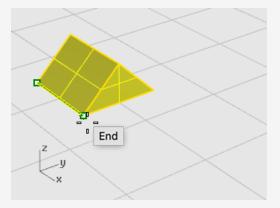

- 5. At the **Second reference point...** prompt, drag the cursor to the right. The object grows as you drag the cursor.
- 6. Click to set the new object size as shown in the illustration below.

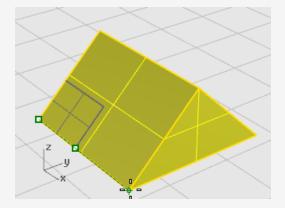

#### Enter a number to set the scale factor

- To make the object twice its original size, at the Scale factor... prompt, in the Value box, type 2.
- To make the object half its original size, at the Scale factor... prompt, in the Value box type .5.

#### Scale an object to a specific size

To make the prism in this example 2.35 units along the original side, at the Second reference point... prompt, in the Value box, type 2.35.


### Mirror

In this exercise, you are going to practice another basic editing command: **Mirror**. The **Mirror** command makes a reverse-image copy of the object. Objects are mirrored across a line that you draw in a viewport.


# Mirror an object

1. Open the tutorial model Mirror Objects.3dm.

(Help menu > Learn Rhinoceros > Tutorials and Samples > User's Guide > Mirror Objects)

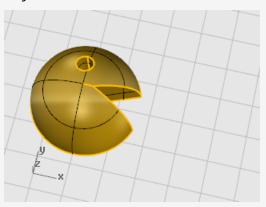


- On the Transform menu, click Mirror.
   Optional: Review the Help topic for the Mirror command in Rhino Help.
- 3. On the status bar, turn **Ortho on**.
- 4. Select the object.

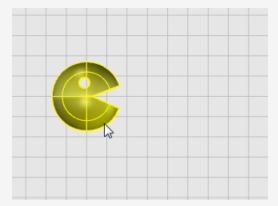

5. At the **Start of mirror plane...** prompt, in the **Top** viewport, click to the right of the face as shown in the illustration below.



6. At the **End of mirror plane...** prompt, drag the cursor toward the bottom of the screen, and click to end the mirror line.

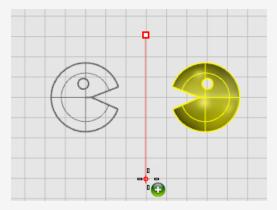

# 9 - Organization - Layers, Groups, and Blocks

Rhino offers aids to organize your work. Each method offers a different approach to model organization. These include:

- Layers let you assign a layer designation to objects.
- Groups associate objects so they can be selected as one.
- Blocks let you store and update an association of objects.

### Layers

Layers are a way of grouping objects and applying certain characteristics to all objects that have that layer assignment.


Layer states include a layer name, the color used to display the objects, and the on/off and locked/unlocked status of all the objects on a layer. Objects are always created on the current layer. This layer assignment can be changed later. Objects on layers that are off are not visible in the model. Objects on locked layers cannot be selected but can be snapped to.

#### Popup layer list

The popup layer list is a shortcut for the most common tasks related to layers.

#### To open the popup layer list

- In the top panel, click the Layer pane.
  - The layer pane displays the current layer.

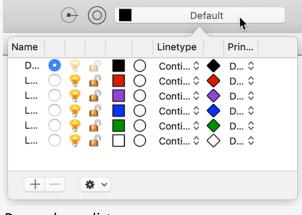

Popup layer list.

In the Popup layer list you can:

- 🌳 Change the on/off state
- Change the locked/unlocked state

Change the layer color

- Set the current layer
- Name or rename the layer

In addition, right-click a layer name to perform these actions:


- Select objects on that layer
- · Change selected objects to that layer
- Copy objects to that layer

#### Layers panel

Use the Layers panel for more detailed layer management.

#### To open the Layers panel

In the lower section of the right sidebar, click the **Layers** panel icon.

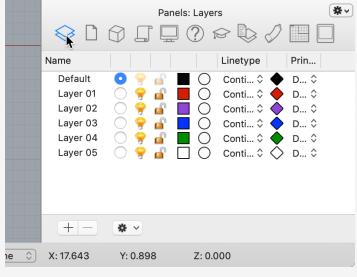

Layers panel.

In the **Layers** panel, in addition to the actions you can perform in the Popup layer list, you can also:

- Create new layers and sublayers
- Delete layers
- Move layers up or down in the layer list
- Elevate a sublayer
- Set the layer render material

- Set the layer linetype
- Set the layer print color
- Set the layer print width

Right-click in the Layers panel to display a menu offering additional layer functions.

Create new layer Create new sublayer Delete layer Edit layer
Expand all layers Collapse all layers Select all layers Invert selection
Duplicate layer Duplicate layer and objects
Select objects on layer Move objects to this layer Copy objects to this layer Show only this layer
Show selected layers Hide selected layers Lock selected layers Unlock selected layers
Show columns

Review the Help topic for the Layers panel in Rhino Help.

# 🔕 Groups

A *group* is a collection of objects that can be selected as one object to be moved, copied, rotated, or other transforms, and to apply properties such as object color. Grouping objects assigns a group name to each object. Objects that have the same group name assigned to them belong to the group. The **Group** command groups objects for selection. A group can contain one or more sub-groups. The **Ungroup** command destroys the group.

When a group is copied, all of the individual objects are copied. Adding copies of each object to the model's database, which increases the model size.

For more information about groups, open the Help topic for the Group command.

## Blocks

A block is another way of associating various objects together to form a single object. The **Block** command creates a *block definition* in the model's database. Using a block definition uses less memory than using groups.

When you edit the block definition, all instances of the block are changed to match the new definition. Blocks streamline modeling, reduce the model size, and promote standardization of parts and details. Block definitions can be stored outside the model using *linked blocks*.

Exploding a block instance places the block geometry using the instance location, scale, and rotation.

The **Insert** command places *instances* of a block definition in your model. The instance refers to the block definition in the database.

You can scale, copy, rotate, array, and otherwise transform block instances in the model.

To edit geometry in a block definition, double-click a block instance, or use the **BlockEdit** command.

The **BlockManager** command displays a dialog box that lists all the block definitions in the model. Use the **Block Manager** dialog box to view block properties, export a block definition to a file, delete a block definition and all its instances, update a block definition from a file, find out what blocks are nested in other blocks, and count the number of block instances in the model.


# **10 - Annotation: Dimensions and Text**

Rhino's dimension commands let you add annotation features to the model:

- Dimensions
- Annotation Text
- Leaders
- Dots
- Hatching
- Create a 2-D hidden-line drawing
- Notes

# Dimensions

You can dimension objects in your model with your choice of font, units display, decimal precision, text and arrow size, and text alignment.

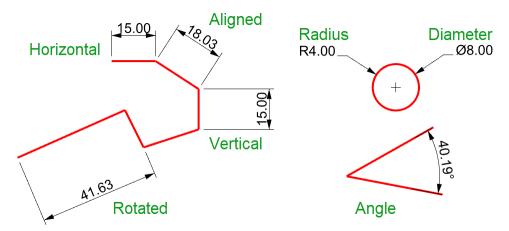


Dimension commands cover a wide range of dimensioning possibilities:

- Dim Places horizontal and vertical dimensions depending on the direction you pick the points.
- DimAligned Creates an aligned dimension.
- DimRotated Creates a rotated dimension.
- DimAngle Creates an angular dimension.
- DimRadius Creates a radius dimension.
- DimDiameter Creates a diameter dimension.

After dimensions are placed, you can select all dimensions, edit dimension text, turn control points on to move dimension elements, and delete dimensions.


Dimensions are created using the current annotation style. Create new annotation styles to control text size and font, and other annotation properties. Use the settings in **Document Settings** (File > Settings > Annotation Styles) to create new styles and set the properties of existing styles.

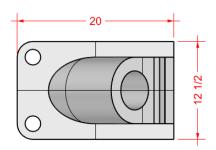

**Note**: Changing your geometry will update the dimensions attached to it. Changing the dimension number will not update the associated geometry.

### **TEXT** Annotation Text


The Text command places annotation text in your model.



Catalog 3-968B




The Leader command draws an arrow leader with text.

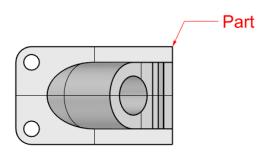




The **Dot** command places a text dot.

Dots are always parallel to the view. Dots are displayed in the layer color. Dot size is constant on the screen. As you zoom in and out, the dot displays the same size.

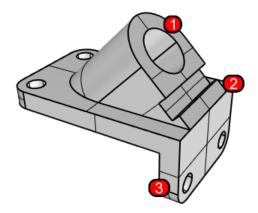




The **Hatch** command creates a pattern of lines to fill a selected bounding curves.

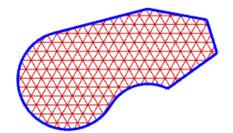

# **Hidden line removal**

The **Make2D** command creates curves from selected objects as silhouettes relative to the active construction plane. The silhouette curves are projected flat and then placed on the world x,y-plane.

The Make2D command options create the 2-D drawings from the current view, current construction plane, create a four-view layout using US or European projection angles, set layers for the hidden lines, and display tangent edges.

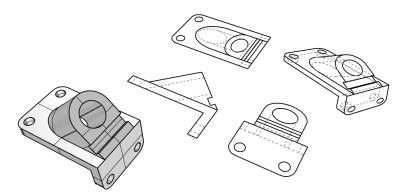



With the **Notes** command you can store text information in your model file. Type information directly into the **Notes** panel. If you leave the **Notes** panel displayed when you close and save the model file, it will display the next time the file is opened.

# 11 - Curve and Surface Analysis

Since Rhino is a mathematically accurate NURBS modeler, it includes tools to provide accurate information about the objects.

### Measure distance, angle, and radius

Some analysis commands provide information about location, distance, angle between lines, and radius of a curve. For example:

- **Distance** displays the distance between two points.
- Angle displays the angle between two lines.
- Radius displays the radius of a curve at any point along it.
- Length displays the length of a curve.

## **Direction**

Curves and surfaces have a *direction*. Many commands that use direction information display direction arrows and give you the opportunity to change (*flip*) the direction.

Every surface is roughly rectangular. Surfaces have three directions: *u*, *v*, and *normal*.


The u- and v-directions are like the weave of cloth or screen. The u-direction is indicated by the red arrow, and the v-direction is indicated by the green arrow. The colors match the grid axis colors. The normal direction is indicated by the white arrow. You can think of u-, v-, and normal-directions as corresponding to the x, y, and z of the surface.

These directions are used when mapping textures and inserting knots.

The **Dir** command displays the direction of a curve or surface.

The illustration shows the curve direction arrows. If the direction has not been changed, it reflects the direction the curve was originally drawn. The arrows point from the start of the curve toward the end of the curve.


The **Dir** command can also change the direction of a curve.

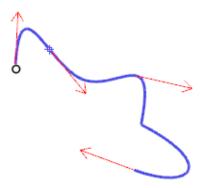

Curve direction.

Surface normals are represented by arrows perpendicular to the surface, and the u- and v-directions are indicated by arrows pointing along the surface. Closed surfaces always have the surface normals pointing to the exterior.

The **Dir** command can change the u-, v-, and normal-directions of a surface. This direction can be important if you are applying textures to the surface.

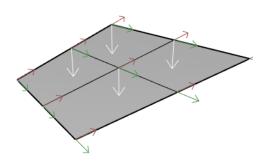


Surface direction.

#### Visual surface analysis

Visual surface analysis commands let you examine surfaces to determine *smoothness*. These commands use NURBS surface evaluation and rendering techniques to help you visually analyze surface smoothness with false color or reflection maps so you can see the curvature and breaks in the surface.

### Curvature analysis

The **CurvatureAnalysis** command analyzes surface curvature using false color mapping. It analyzes Gaussian curvature, mean curvature, minimum radius of curvature, and maximum radius of curvature.



#### Environment map

The **EMap** command displays a bitmap on the object so it looks like a scene is being reflected by a highly polished metal. This tool helps you find surface defects and validate your design intent.

The fluorescent tube environment map simulates tube lights shining on a reflective metal surface.





The **Zebra** command displays surfaces with reflected stripes. This is a way to visually check for surface defects and for tangency and curvature continuity conditions between surfaces.






#### Draft angle analysis

The **DraftAngleAnalysis** command displays the draft angle relative to the construction plane that is active when you start the command.


The pull direction for the **DraftAngleAnalysis** command is the z-axis of the construction plane. It also uses false color mapping.



# **8** Edge evaluation

Geometry problems such as Boolean or join failures can be caused by edges on surfaces that have become broken or edges between surfaces that have been moved through point editing so they create holes. An *edge* is a separate object that defines the surface's boundary.

The **ShowEdges** command highlights naked edges, non-manifold edges or all edges of the surface.

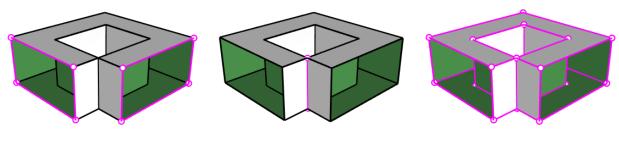

Naked edges

Non-manifold edges

All edges

The **Properties** command may tell you that a polysurface is open even though it looks closed. Some operations and export features require closed polysurfaces, and a model using closed polysurfaces is generally higher quality than one with small cracks and slivers.

When a surface is not joined to another surface, it has naked edges. Rhino provides a tool for finding the unjoined or "naked" edges. Use **Properties** command to examine the object details. A polysurface that has naked edges lists as an *open polysurface*. Use the **ShowEdges** command to display the unjoined edges.

Other edge tools let you split an edge, merge edges that meet end-to-end, or force surfaces with naked edges to join. You can rebuild edges based on internal tolerances. Other edge tools include:

- SplitEdge divides a surface edge at a designated point.
- MergeEdge merges edges that meet end to end.
- JoinEdge forces unjoined (naked) edges to join nearby surfaces.
- RebuildEdges redistributes edge control points based on internal tolerances.


### Diagnostics

Diagnostic tools report on an object's internal data structure and select objects that may need repair. The output from the **List**, **Check**, **SelBadObjects**, and **Audit3dmFile** commands is normally most useful to a Rhino programmer to diagnose problems with surfaces that are causing errors.

# 12 - Render

In addition to shaded previews, Rhino provides full-color rendering with lights, transparency, shadows, textures, and bump mapping.

Objects will render white until you add render color, highlight, texture, transparency, and bumps. These attributes are controlled through the **Properties** and **Materials** panels.

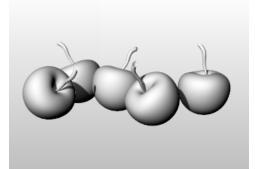

The process to render scenes consists of four basic steps:


- Add lighting.
- Assign materials.
- Set up the environment and a ground plane.
- Render.

Although the steps do not have to be done in this order, using this method makes setting up a scene more efficient. To improve quality, repeat these steps until the image looks right to you.

### 🔎 Lights


In every Rhino rendering there are light sources that Rhino uses to calculate how objects are illuminated. If you do not add any light sources to your scene, the default light is used. The default light is a directional light, with parallel rays, that acts as though you have a lamp shining over your left shoulder.

Use the **SpotlightsDirectionalLight**, **LinearLight**, **PointLight**, or **RectangularLight** commands to insert indoor lights. You can also turn on the **Sun**, a parallel light source, that can be defined by location, date and time.

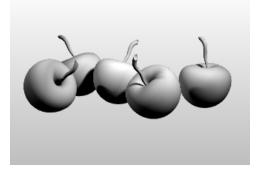

### Materials

Materials specify the color, finish, transparency, texture, and bump for use by the renderer. Set up or import materials in the Materials panel, then assign materials to layers or objects. You can drag materials from the material library and drop them onto objects.

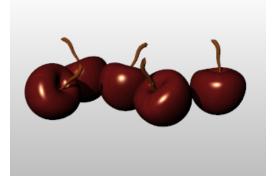

### Environment

Environments describe the space around the model. This space is reflected in objects and can provide overall lighting. The rendering properties include environment settings like background color and image.



### dround Plane

The ground plane provides an infinite horizontal platform for the image. The ground plane stretches to the horizon in all directions. Any material can be assigned to the ground plane. Set up a ground plane in the Ground Plane panel.




### **Render Preview**

Preview a rendering by setting a viewport to Rendered viewport mode.

### 13 - Solids and Transforms - Pull Toy

This tutorial demonstrates using solid primitives and simple transforms.

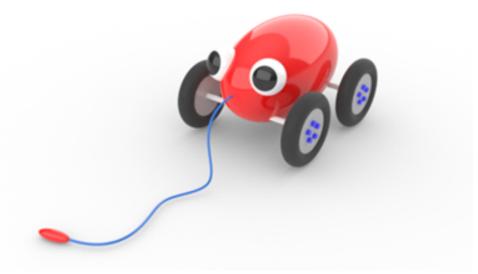


You will learn how to:

- Enter coordinates and use object snaps to place points precisely.
- Draw a free-form curve and polygon.
- Extrude a curve to create a surface.
- Use a polar array to copy objects in a circular pattern.
- Use Planar and Ortho mode.
- Create a pipe along a curve.

### **Enter coordinates**


When you pick a point with the mouse, the point lies on the *construction plane* of the active viewport unless you use a modeling aid such as object snap or *elevator mode*.

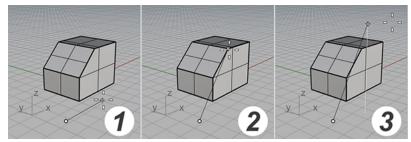

(1) The cursor moves on the construction plane. (2) An object snap is active. (3) The Elevator mode.


When Rhino prompts for a point, you can enter x-, y-, and z-coordinates instead of picking a point. Each viewport has its own construction plane on which its x- and y-coordinates lie. The z-coordinate for the active viewport is perpendicular to the x-y plane.

The grid is a visual representation of the construction plane. The intersection of the dark red and green lines is the origin point (x=0, y=0, z=0) of the coordinate system.

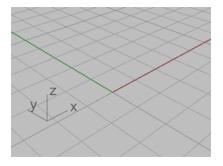

### Draw the pull toy body

This exercise uses x-, y-, and z-coordinates to place points accurately. When you type the coordinates, type them just as they are shown in this manual. The format is **x**,**y**,**z**. For example, type **10,5,6**. You must type commas to separate the numbers. These coordinates place the point at x=10, y=5, and z=6 in the active viewport.

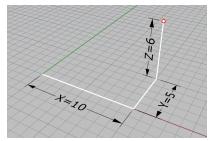

Whenever you type coordinates to place a point, look in all the viewports, so you can get an idea of how coordinate entry works.


#### Start the model

- 1. On the File menu, click New Using Template.
- 2. In the screen splash, double-click **Small Objects Centimeters.3dm** in the template list.



- 2. On the **Solid** menu, click **Ellipsoid** > **From Center**.
- At the Ellipsoid center... prompt, move the cursor to the Top viewport.
   When Rhino prompts for picking a point, moving the cursor to a viewport makes the viewport active/current.
- 4. Type **0,0,11**, and press **Enter**.


This places the center point of the ellipsoid at x=0, y=0, and z=11. Look at the point in the **Perspective** viewport.

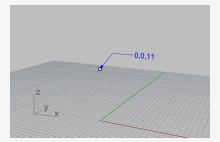

- 5. At the **End of first axis...** prompt, type **15**, and press **Enter**.
- 6. Move the cursor to the right to specify the direction and click.




- 7. At the End of second axis prompt, type 8, and press Enter.
- 8. Move the cursor up to specify the direction and click.

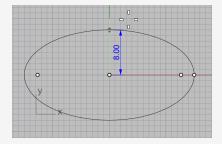

9. At the End of third axis prompt, type 9, and press Enter.

You now have an egg shape that has different dimensions in all three directions.

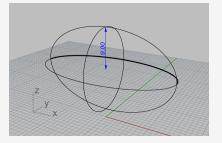


### Draw the axles and wheel hubs

The axles and wheel hubs are cylinders. The axles are long, thin cylinders, and the wheel hubs are short, fat cylinders. You are going to make one axle and one complete wheel. You will then mirror the complete wheel to the other side. You can then either mirror or copy the complete axle and wheel set to the front of the toy.

### Create the axle


- 1. Rotate the perspective viewport so that you are looking along the x-axis as illustrated.
- 2. Turn on **Shaded** display mode in the **Perspective** viewport.

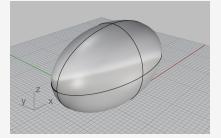

- 3. On the **Solid** menu, click **Cylinder**.
- 4. At the **Base of cylinder...** prompt, move the cursor to the **Front** viewport.
- 5. Type 9,6.5, and press Enter.


When you only type x- and y-coordinates, the z-coordinate is automatically 0.

6. At the **Radius...** prompt, type **0.5**, and press **Enter**.

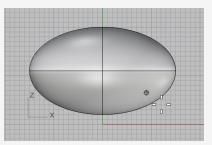

- 7. At the **End of cylinder** prompt, in the command options, check **Both Sides**.
- 8. Type **10**, and press **Enter**.


A cylinder 20 centimeters long is created.

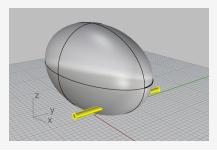



### Create a wheel hub


- 1. On the **Solid** menu, click **Cylinder**.
- 2. At the **Base of cylinder...** prompt, move the cursor to the **Front** viewport, type **9,6.5,10**, and press **Enter**.
- 3. At the **Radius...** prompt, type **4**, and press **Enter**.

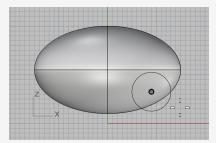

4. At the End of cylinder prompt, uncheck Both Sides.

5. Type **2**, and press **Enter**.

You have created a cylinder that represents a wheel hub.

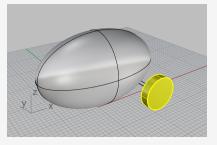


### Draw the lug nuts

You will make the lug nuts by extruding a hexagonal polygon curve.



- 1. On the **Curve** menu, click **Polygon** > **Center, Radius**.
- 2. At the **Center of inscribed polygon...** prompt, type **6**, and press **Enter**. This sets the NumSides option to 6.
- 3. Move the cursor to the **Front** viewport, type **9,8,12**, and press **Enter**. This places the polygon on the surface of the wheel hub.
- 4. At the Corner of polygon... prompt, type 0.5, and press Enter.
- 5. Move the cursor to the right ,and click to specify the orientation of the hexagon.

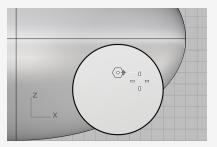

# Make a solid from the hexagon


- 1. In the **Perspective** viewport, select the hexagon you just created.
- 2. On the **Solid** menu, click **Extrude Planar Curve > Straight**.
- 3. At the **Extrusion distance...** prompt, in the command options:
  - Uncheck BothSides

Check Solid


#### Check DeleteInput

4. Move the cursor away from the wheel hub.

The extrusion direction in preview defines the positive direction for the next step.

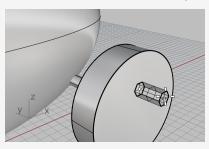

5. Type **0.5**, and press **Enter**.

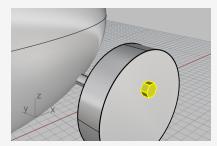


### Array the lug nuts


To create the lug nuts on the first wheel, you are going to use a polar (circular) array. An array is a set of copies of an object. A polar array copies the objects around a central point. The objects are rotated as they are copied.

# Array the nuts around the center


- 1. In the **Front** viewport, select the lug nut.
- 2. On the **Transform** menu, click **Array** > **Polar**.
- 3. At the **Center of polar array...** prompt, in the object snap control, check **Center**.



4. Move the cursor near the hub edge to until the cursor snaps to the center of the hub and click.

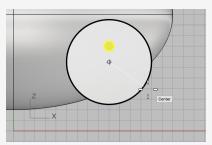

- 5. At the **Number of items...** prompt, type **5**, and press **Enter**.
- 6. At the Angle to fill... prompt, press Enter.
- 7. At the **Press Enter to accept** prompt, preview the result and press **Enter**.

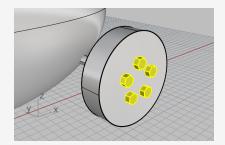

### Draw the tires

The tire is a solid form called a *torus*, which looks like a donut. When you are drawing a torus, the first radius is the radius of a circle around which the "tube" is drawn. The second radius is the radius of the tube itself.


To draw the tire, you will draw the center of the torus tube a bit larger than the diameter of the wheel hub. The tube itself is slightly larger than the hub. This makes it dip into the hub.




- 1. On the **Solid** menu, click **Torus**.
- 2. At the **Center of torus...** prompt, in the **Object Snap** control, select **One shot**, and click **Between**.



3. In the **Perspective** viewport, move the cursor near an edge of the wheel hub until the Cen tooltip appears and click.

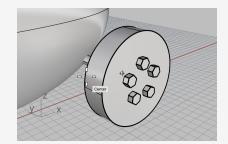


 Move the cursor near the other edge until the Cen tooltip appears and click. This places the center of the torus at the middle of the hub "between" the centers of two circles that make up the edges of the wheel hub.

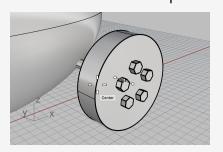


5. At the **Radius...** prompt, move the cursor to the **Front** viewport, type **5**, and press **Enter**.

This makes the radius of the torus tube one unit bigger than the wheel hub.

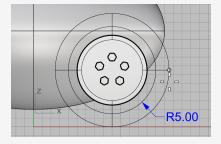

6. At the **Second radius...** prompt, type **1.5**, and press **Enter**.

This makes the inner dimension of the torus tube 0.5 units smaller than the wheel hub.

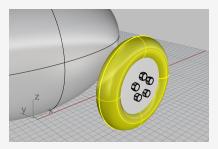


### **Mirror the wheels**

Now that you have a whole wheel with tire created, use the Mirror command to create the other three.

# Mirror the wheel to the other side


1. In the **Top** viewport, window select the wheel as illustrated.

Be sure to select all the wheel parts.

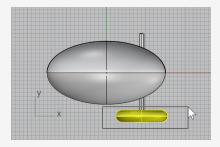

- 2. On the Transform menu, click Mirror.
- 3. At the Start of mirror plane... prompt, at the command line, click the XAxis option.


A mirrored copy of the wheel is made across the construction plane x-axis.

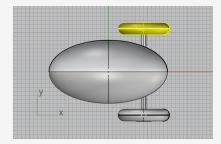



# Mirror the front wheels and axle


1. In the **Top** viewport, window select the wheels and axle as illustrated.

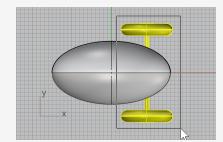

2. On the **Transform** menu, click **Mirror**, or right-click to repeat the command.


3. At the **Start of mirror plane...** prompt, at the command line, click the **YAxis** option.

A mirrored copy of the wheel set is made across the construction plane y-axis.

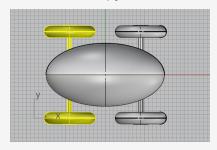

### Draw the eyes


You are going to draw a sphere on the body ellipsoid to represent an eye.




- 1. On the **Solid** menu, click **Sphere > Center, Radius**.
- 2. At the **Center of sphere...** prompt, in the **Object Snap** control, click **On surface**.



3. In the **Perspective** viewport, select the body ellipsoid, and pick a point on the surface as illustrated.

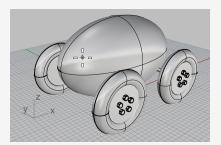


4. At the **Radius...** prompt, type **3**, and press **Enter**.

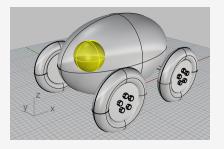


# Mirror the eye

1. In the **Top** viewport, select the eye.

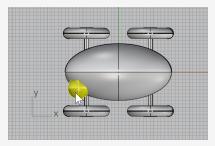

- 2. On the **Transform** menu, click **Mirror**.
- 3. At the **Start of mirror plane...** prompt, type **0** (this is a shortcut for typing 0,0,0), and press **Enter**.
- 4. At the **End of mirror plane...** prompt, with **Ortho** on, drag the cursor to the left and click.

A mirrored copy of the eye is created on the opposite side across the x-axis.

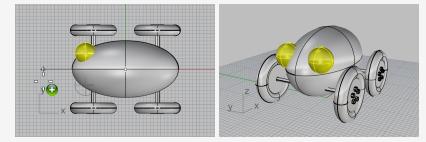

### Make the pull cord

To make the cord, you are going to draw a free-form curve using elevator and planar mode. When the curve is complete, use the **Pipe** command to make it a thick solid.

#### Set up the view

- 1. **Zoom** out in all the viewports; you are going to need some space in front of the body ellipsoid to work.
- 2. In the top panel, turn **Planar** mode on, and turn **Ortho** off.



3. In the **Object Snap** control, click **Disable** to turn off all object snaps.


In the **Object Snap** control, select **Persistent** and check **Disable all** to turn off all object snaps.






- Create the pull cord at the front of the toy
- 1. On the Curve menu, click Free-form > Control Points.
- 2. At the **Start of curve...** prompt, in the **Top** viewport, hold the **Command**  $\Re$  key and click near and inside the front end of the body ellipsoid.


This only activates the **Elevator** mode. You have not placed the start point of the curve yet.

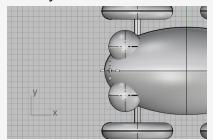

3. Move the cursor to the **Front** viewport, drag the cursor upwards near the end of the ellipsoid, and click.

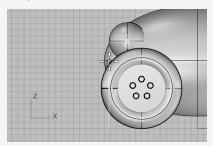


4. At the **Next point...** prompt, return to the **Top** viewport, move the cursor left and click.

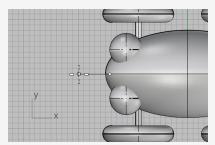


Planar mode keeps successive points at the same construction plane elevation. Elevator mode and object snaps override Planar mode. Watch the curve in the **Front** and **Right** viewports.

5. Place the third point in the **Front** viewport.

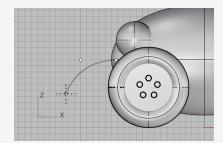

6. Turn off **Planar** mode and click several more points in the **Top** viewport to create a free-form curve. Press **Enter** when done.

Notice that the points are placed on the **Top** construction plane.

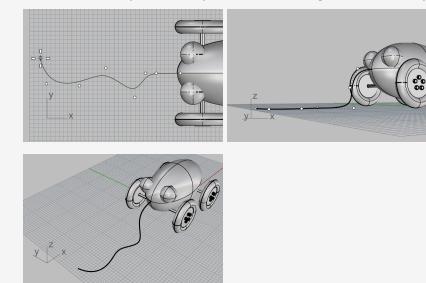





Draw a small **Ellipsoid** to represent a handle at the end of the curve.

- 1. On the **Solid** menu, pick **Ellipsoid** > **From Foci**.
- 2. At the **First focus...** prompt, hold the **Alt** key and check **End** object snap.

Holding the **Alt** key while clicking an object snap checkbox temporarily enables an object snap when they are all disabled.



3. In the **Top** or **Perspective** viewport, while holding the **Alt** key, snap to the end of the cord curve and click.

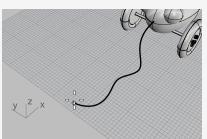

4. At the **Second focus...** prompt, drag the cursor along the cord curve direction about 5 units.

You can see the distance you are dragging the cursor from the last point in the status bar.


 Rotation:
 90

 X location:
 -0.64


 Millimeters
 CPlane
 X: 0.256
 Y: -4.855
 Z: -14.077
 4.944

The status bar displays the distance between the cursor and the previous point.

5. Click to place the second focus point.

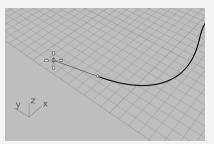


6. Drag the cursor to specify an appropriate size for the handle and click.

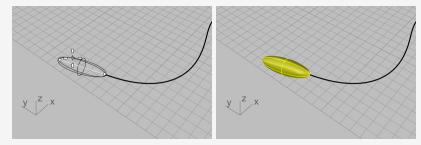

# **C** Thicken the curve with a pipe

- 1. **Select** the cord curve.
- 2. On the **Solid** menu, click **Pipe**.
- 3. At the Start radius... prompt, type 0.2, and press Enter.
- 4. At the End radius... prompt, press Enter.
- 5. At the **Point for next radius...** prompt, press **Enter**.

The pipe will be the same radius for the full length of the curve.

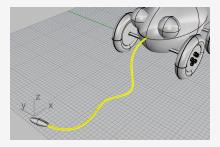

### 14 - Tutorial: Revolve Curves - Flashlight

Creating surfaces from curves and joining the surfaces together allows you greater freedom for modeling the shape.

This tutorial introduces the concept of drawing curves and one method of creating surfaces from those curves.



You will learn how to:

- Add guides to help drawing the profile curves.
- Draw free-form curves.
- Edit control points.
- Revolve curves around an axis to create surfaces.
- Use History.

You will use guides as a frame of reference for drawing the profile curves of the flashlight.

#### To download the tutorial model

- 1. On the Rhino Help menu, click Learn Rhinoceros, and then click Tutorials and Samples.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Flashlight.3dm**.

### Set up the guides

Guides are infinite construction lines that only display when you are picking a point for a command or when you are dragging objects.

E	Add	guides

- 1. Click anywhere in the **Front** viewport to make it active.
- 2. Run the Grid command, and uncheck Show Grid and Show Grid Axes.


This hides the construction plane grid so you can easily see the guides you are going to add.

3. In the top panel, turn on **SmartTrack**.




Note: Guides will not display when SmartTrack or Osnap is off.


4. Hold down **Alt**, and click on the **Point** checkbox in the **Object Snap** control. This turns on the **Point** object snap and turns off all the others.



- 5. Type **AddGuide**, and press **Enter**.
- 6. Snap to a point, move the cursor vertically or horizontally, and click to add a guide. If the cursor cannot move vertically or horizontally, hold down **Shift** to temporarily enable **Ortho** mode.

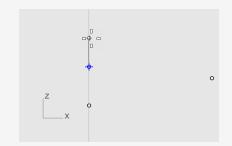

7. Add more guides as illustrated.

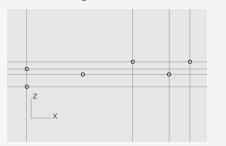

**Tip:** If a guide is not added properly, use the **RemoveGuide** command to remove the guide.

### Draw the body profile curve

You are going to draw a *profile curve* that you will use to revolve and create the flashlight body.

2	Draw the body curve

1. In the top panel, click the **Layer** pane, and click the light bulb of the **Points for guides** layer to turn it off.


⊕ ⊚ ■	Default
Name	Linetype Prin
Default Points fo	<ul> <li>Conti ◊ ◆ D ◊</li> <li>Conti ◊ ◆ D ◊</li> </ul>

- 2. On the **Curve** menu, click **Free-Form > Control Points**.
- 3. Set command options to Degree=3 and PersistentClose=Off.
- 4. At the **Start of curve...** prompt, in the **Front** viewport, snap to the lower-left intersection of the guides and click.



Note: When guides display, Intersect and Near object snaps are always turned on.

5. At the **Next point...** prompt, continue placing points as illustrated. Press **Enter** when done.




All the points will be placed either on a guide or at an intersection of two guides.

**Note:** The first and last two points must be placed along the y-axis so the surface created from the curve will be smooth at both ends.

### Draw the lens profile curve


Make another profile curve for the lens.

- Create the outer lens profile curve
- 1. On the **Curve** menu, click **Free-Form > Control Points**.
- 2. At the **Start of curve...** prompt, in the **Front** viewport, hold down **Alt** and place the first point as illustrated.

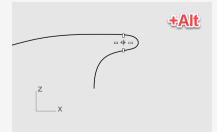


Note: Holding down Alt hides the guides and avoids snapping to the guides.

3. At the **Next point...** prompt, release **Alt** and place the second point.

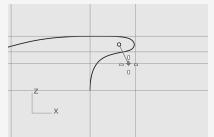

4. For the third point, hold down **Shift**, snap to the lowest guide, click, and press **Enter** to end the curve.

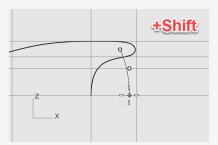


**Note:** Holding down **Shift** enables **Ortho** mode. The second and third points are placed along the y-axis.



1. In the top panel, turn **SmartTrack** off to disable guides.

- 2. On the **Curve** menu, click **Offset > Offset Curve**.
- At the Select curve to offset... prompt, set the command options Distance=1.5 and Cap=None.
- 4. Select the outer lens profile curve in the **Front** viewport, move the cursor to the left and click.

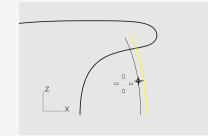


- Connect the inner and outer lens profile curves
- 1. On the **Curve** menu, click **Line** > **Single Line**.
- 2. In the **Object Snap** control, check **End**.

•	Persistent One shot
	End
C	Near
	Point

3. Snap to the upper ends of the lens profile curves.

This creates a line to fill the gap.

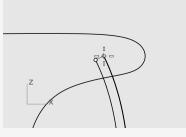

- 4. Select the line and the lens profile curves.
- 5. On the **Edit** menu, click **Join**.


The curves and line are joined into a polycurve.

### **Build body and lens surfaces**

To make the body and lens surfaces, you will revolve the body and lens profile curves 360 degrees. You will use two curve ends to establish the revolve axis.


#### Create the flashlight body and lens

1. Right-click on the **Perspective** viewport title, and select **Shaded**.

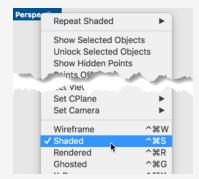

**Note:** The Shaded display mode uses render meshes to display surfaces so you can see the surfaces when they are created.


2. Select the body and lens profile curves.

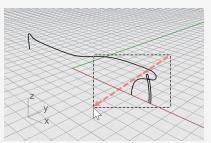

**Tip:** Drag the cursor from right to left, the dashed rectangle is the crossing selection window. All objects that intersect or are within the rectangle will be selected.


3. In the top panel, click **History**.

The next command will have History recorded.




4. On the **Surface** menu, click **Revolve**.


5. At the **Start of revolve axis** prompt, snap to an end of the body profile curve and click.

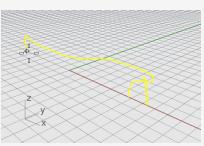

6. At the **End of revolve axis...** prompt, snap to the other end and click.

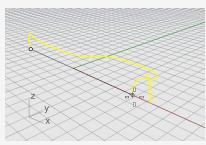

7. Click Full Circle in command options.

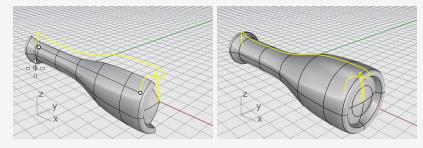


### **Use History**

We recorded History when building the flashlight body and lens surfaces. In the next section, we will change the shape of the body profile curve and let History update the body surface.

#### Edit the body profile curve


1. In the **Front** viewport, select the body profile curve.

The body profile curve and surface are overlapped. The **Choose Objects** menu pops up because Rhino cannot tell what you are going to select. You will have to select **curve** from the list.

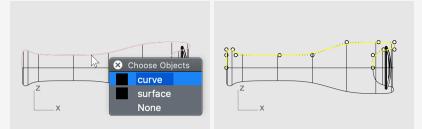

**Note:** When you select a single curve, its control points turn on automatically. The control points turn off when you deselect the curve. If you need control points to stay on when a curve is deselected, select the curve, and press **F10**.

2. Drag the control points to change the shape of the body profile curve. History updates the body surface for you.

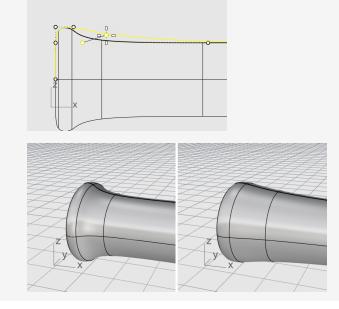

### 15 - Tutorial: Sweep, Loft, and Extrude -Headphones

This tutorial demonstrates how to create surfaces from profile curves.



You will learn how to:

- Use sub-object selection to preselect objects for a command.
- Create a surface from a planar curve.
- Loft, revolve, sweep, and extrude surfaces.
- Cap planar holes to create a solid.
- Draw a helix around a curve.
- Match curve ends.
- Create solid pipes.
- Mirror objects.
- Use layers.
- Use object snaps.

#### To download the tutorial model

- 1. On the Rhino Help menu, click Learn Rhinoceros, and then click Tutorials and Samples.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Headphone.3dm**.

### **Create the speaker shell**

The speaker shell is created using a lofted surface, a one-rail sweep, a solid extrusion of a planar curve, and a surface fillet. The resulting geometry is joined into one solid.


One way to create a surface is to use existing curves as a guide. When lofting through curves, the curves are used as a guide for creating a smooth surface.



1. Right-click on the **Perspective** viewport title, and on the viewport title menu, click **Shaded**.

The Perspective viewport is now in the Shaded display mode.


2. Select the three circular curves, with a crossing selection as illustrated.

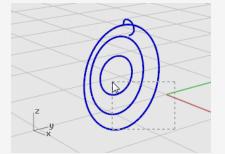


- 3. On the **Surface** menu, click **Loft**.
- 4. At the **Drag seam point to adjust...** prompt, note the display of the curve direction arrows at the seam points.

In this model, they are nicely lined up, so you do not need to adjust them.

Press Enter.

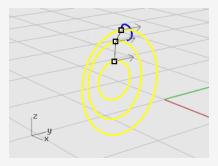

5. In the Loft Options dialog box, click Loft to create the loft.

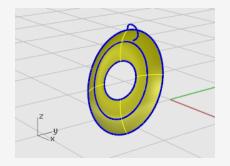


- Polysurface faces
- Surface and polysurface edge curves
- Mesh vertices, faces, and edges
- Objects within a group

This action is called *sub-object selection*.

#### Extrude the surface edge

Extrude the lofted surface edge in the center to make a magnet housing on the convex side of the speaker shell.


1. Hold down **Command**  $\mathfrak{H}$  and **Shift** to select the surface edge at the center of the lofted surface.

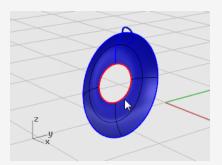

2. On the **Solid** menu, click **Extrude Planar Curve > Straight**.

3. At the **Extrusion Distance...** prompt, move the cursor to the convex side, type **2**, and press **Enter**.

This makes a solid cylinder for the magnet housing that is two units thick and extends from the original surface edge.

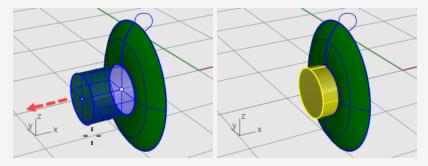


**Note**: The cylinder you just created is an extrusion object (solid). The housing cylinder needs to be open on the bottom.


In the next step, you will use *sub-object selection* to remove the bottom face.

### Remove the bottom surface

1. Hold down **Command**  $\mathfrak{H}$  and **Shift**, and click to select the bottom face.

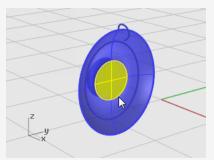


2. Press the **Delete** key.

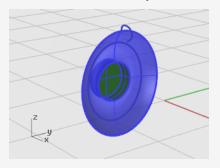


Fillet or round off the edge of the cylinder surface

- On the Solid menu, click Fillet Edge > Fillet Edge.
   The current Next Radius setting should be 1.
- 2. At the **Select edges to fillet...** prompt, select the edge at the top of the cylinder, and press **Enter**.

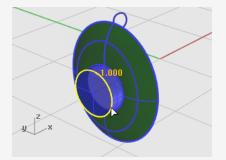

3. At the Select fillet handle to edit... prompt, press Enter.

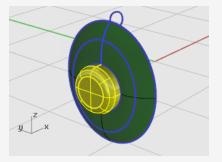


Surfaces that share an edge can be joined into a polysurface. In the next step, you will join all the surfaces.

## Join the surfaces

- 1. Select the surface and the polysurface.
- 2. On the Edit menu, click Join.

To join surfaces, you must select surfaces that are adjacent to each other and the edges must match.

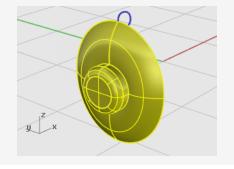

## Create the padding and cover

Sweep a curve around the edge of the speaker cone to create the padding around the edge of the speaker.




1. On the **View** menu, click **Zoom** > **Zoom Extents All**.

All viewports are zoomed in or out to show all the objects.


2. Hide or **Delete** the three curves used for the loft.

## Sweep a curve along one rail

- 1. On the **Surface** menu, click **Sweep 1 Rail**.
- 2. At the **Select rail** prompt, select the loft surface outer edge.

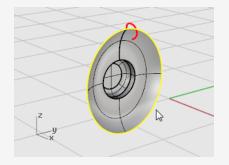


- 3. At the **Select cross section curves** prompt, select the cross section curve at the top of the speaker as shown, and press **Enter**.
- 4. In the Sweep 1 Rail Options dialog box, enable Refit rail, and click Sweep.

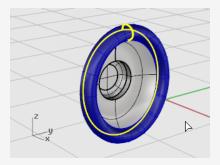




### Make a surface from planar curves

1. Hold down **Command**  $\mathbb{H}$  and **Shift**, and click to select the inner edge of the padding as illustrated.

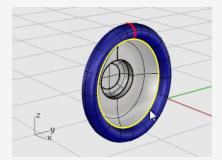

2. On the **Surface** menu, click **Planar Curves**.

A planar surface is created at the base of the padding.

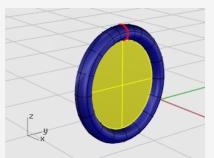

This fills the area at the base of the padding with a planar surface created from the edge of the sweep.

## **Create the mounting bracket**

The next part is the bracket that holds the speaker to the headband. Since the speaker unit is complete, you can turn its layer off and make the Bracket layer current.

#### **Reset the layers**


- 1. In the top panel, click the Layer pane where it shows Speaker.
- 2. Make Bracket the current layer, and turn on the layer Bracket Shape Curves.
- 3. Turn all other layers off.

## Reset the view


On the View menu, click Zoom > Zoom Extents All to zoom in on the bracket shape curves in all viewports.

### Extrude a curve into a solid

1. Select the closed curve.

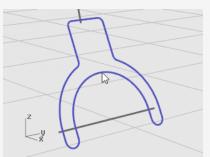

- 2. On the **Solid** menu, click **Extrude Planar Curve > Straight**.
- 3. At the **Extrusion distance...** prompt, move the cursor to the left, type **1**, and press **Enter**.

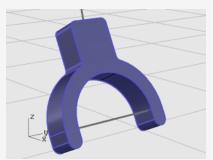


# Fillet the edges


- 1. On the **Solid** menu, click **Fillet Edge** > **Fillet Edge**.
- 2. At the **Select edges to fillet...** prompt, type **0.2**, and press **Enter**.
- 3. At the **Select edges to fillet...** prompt, click **Chain Edges**, and select the front edge of the bracket.

The entire edge of the solid should highlight.

4. Press **Enter** to close that edge selection.

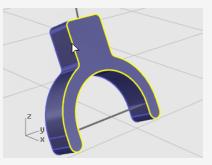


- 5. At the **Select edges to fillet...** prompt, click **Chain Edges**, and select the back edge of the bracket.
- 6. Press **Enter** to close that edge selection.

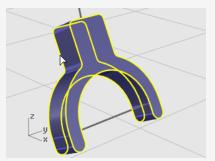

7. Press **Enter** to finish the edge selection.


8. At the **Select fillet handle to edit...** prompt, press **Enter**.

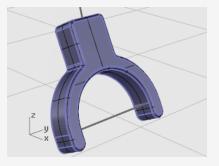

This rounds all of the sharp edges.


# Create a tubular surface from the shape curves

- 1. Select the curve at the top of the bracket.
- 2. On the **Solid** menu, click **Pipe**.
- 3. At the **Start radius...** prompt, in the command options, select **Flat** for **Cap** and uncheck **Thick**.
- 4. Type **0.3**, and press **Enter.**
- 5. At the End radius... prompt, press Enter.
- 6. At the **Point for next radius...** prompt, press **Enter**.

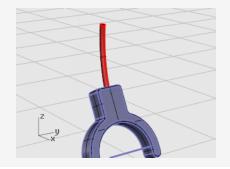


## Generation Second Transformed Second Transformed Second Se

- 1. Select the curve at the bottom of the bracket.
- 2. On the **Solid** menu, click **Pipe**.

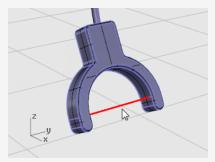

- 3. At the **Start radius...** prompt, type **0.2**, and press **Enter**.
- 4. At the End radius... prompt, press Enter.
- 5. At the **Point for next radius...** prompt, press **Enter**.

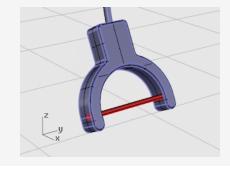

## **Create the headband**

The headband consists of a series of ellipses swept along a path.



### Reset the layers

- 1. In the top panel, click the **Layer** pane.
- 2. Make **Headband** the current layer, and turn on the layer **Headband Shape Curves**.


Turn all other layers off.

# 

On the View menu, click Zoom > Zoom Extents All to zoom in on the headband shape curves in all viewports.

# Create an ellipse perpendicular to a curve


- 1. Turn **Ortho** on.
- 2. On the **Curve** menu, click **Ellipse** > **From Center**.
- 3. At the **Ellipse center...** prompt, click **Around Curve**.
- 4. Select the curve.

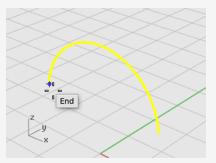

5. At the **Center of ellipse** prompt, snap to an endpoint of the headband curve and click.


Use the **End** object snap.

- 6. At the End of first axis prompt, type 0.5, and press Enter.
- 7. At the **End of first axis** prompt, drag the cursor in the x-direction and click.

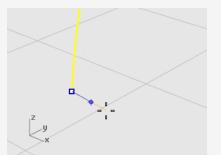


8. At the **End of second axis** prompt, type **2**, and press **Enter**.

9. At the **End of second axis** prompt, drag the cursor in the y-direction and click.

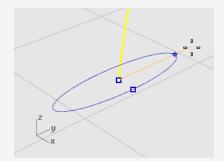


## Array a curve along a path

- 1. Select the ellipse.
- 2. On the **Transform** menu, click **Array** > **Along Curve**.
- 3. At the **Select path curve** prompt, select the headband curve.

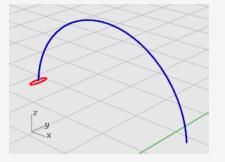


- 4. In the Array Along Curve Options dialog box, under Array Along Curve Method, set the Number of items to 3.
- 5. Under **Orientation**, click **Freeform**, and click **Array**.

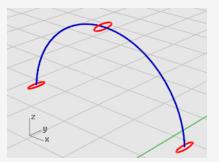


### Scale the ellipse

1. Select the center ellipse.

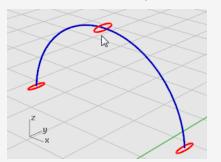


- On the Transform menu, click Scale > Scale 1-D.
   Scale1D stretches an object in one direction.
- 3. At the **Base point...** prompt, press **Enter**.
- 4. At the Scale factor or first reference point... prompt, type 2, and press Enter.
- 5. At the **Scale direction...** prompt, drag the cursor in the y-direction and click.

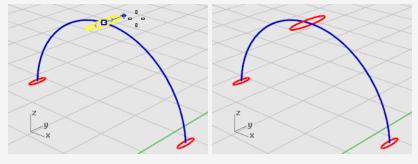


This makes the center ellipse larger.

# Sweep along one rail

- 1. On the **Surface** menu, click **Sweep 1 Rail**.
- 2. At the **Select rail** prompt, select the headband curve.
- 3. At the **Select cross section curves** prompt select the three ellipses, and press **Enter**.

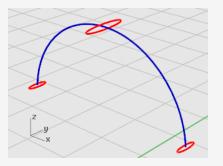

- 4. At the **Drag seam point to adjust...** prompt, examine the direction and seam points of the curves to make sure they are not twisted, and press **Enter**.
- 5. In the Sweep 1 Rail Options dialog box, click Sweep.

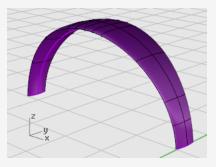


## Round the headband ends

Use the same ellipse that formed the first cross-section curve for the headband to create a rounded end for the headband. Start by splitting the ellipse in half.




- 1. On the **View** menu, click **Zoom** > **Zoom Window**.
- 2. In the **Perspective** viewport, drag a rectangle to enclose the left end of the headband to zoom in.

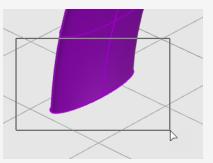


# Split the ellipse in half

- In the Object Snap control, hold down **Alt** and click the **Quadrant** object snap.
   The Quadrant object snap is enabled. All the others are disabled at the same time.
- 2. On the Edit menu, click Split.
- 3. At the **Select objects to split...** prompt, click the **Point** option.
- 4. At the Select curve to split prompt, select the ellipse.

5. At the **Point to split curve** prompts, snap to the two quadrants at the narrow axis of the ellipse and click, and then press **Enter**.

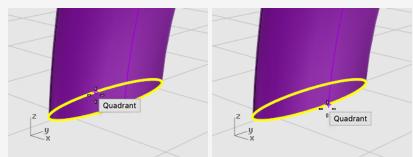


The ellipse is split into two halves.

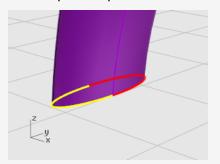




### Create a surface of revolution

1. Select the left half of the ellipse.

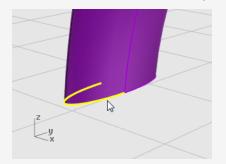


2. On the **Surface** menu, click **Revolve**.


3. At the **Start of revolve axis** prompt, snap to the end of the ellipse half and click.

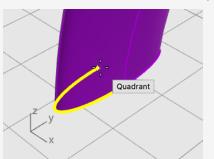


4. At the **End of revolve axis** prompt, snap to the other end of the ellipse half and click.

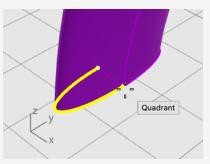


5. At the **Start angle...** prompt, snap to the ellipse at the outer edge of the headband and click.

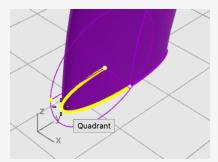

At the **Revolution angle...** prompt, rotate the view to see the other side.
 Swing the mouse cursor down and snap to the other side of the ellipse and click.

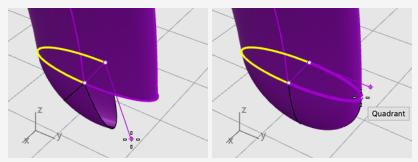


A rounded surface is created at the end of the headband.

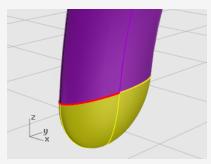




1. Select the rounded end.

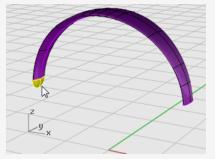

- 2. On the **Transform** menu, click **Mirror**.
- 3. At the **Start of the mirror plane** prompt, type **0**, and press **Enter**.

4. At the **End of the mirror plane** prompt, drag the mirror line in the y-direction as illustrated, and click.


Hold down **Shift** to help move the cursor in the ortho direction.

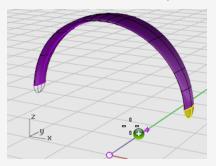



- ک<sup>ا</sup> Join the surfaces
- 1. Select the surfaces.
- 2. On the **Edit** menu, click **Join**.

Three surfaces are joined into one polysurface.

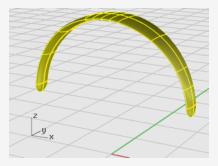

### Create the speaker wire

Use a separate layer to create the speaker wire.

## Reset the layers


- 1. In the top panel, click the **Layer** pane.
- Make Wire Shape Curves the current layer and turn on the layer Wire.
   Turn all other layers off.



• On the View menu, click Zoom > Zoom Extents All.


# <sup>⊷</sup>ℓ∕ Make the helix

- 1. On the Curve menu, click Helix.
- 2. At the **Start of axis...** prompt, click **Around Curve**.
- 3. At the **Select curve** prompt, select the long free-form curve.

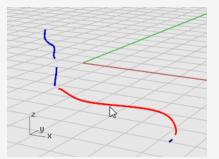

- 4. At the Radius and start point... prompt, type 1, and press Enter. This sets the radius for the helix.
- 5. At the Radius and start point... prompt, set Turns=30 and Num Points Per Turn=8.
- 6. At the Radius and start point... prompt, in the Right viewport drag the cursor to the left and click.

Hold down **Shift** to help move the cursor in the ortho direction.

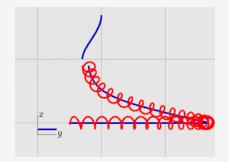





### Reset the view

- 1. On the **View** menu, click **Zoom** > **Window**.
- 2. In the **Perspective** viewport, zoom in on the left end of the helix you just created.


- Match and join the helix to the end curves
- 1. On the **Curve** menu, click **Curve Edit Tools > Match**.

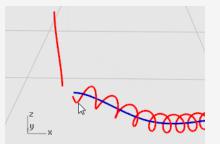

- 2. At the **Select open curve to change pick near end** prompt, select near the left end of the helix.
- 3. At the **Select open curve to match pick near end...** prompt, select near the lower end of the vertical curve.

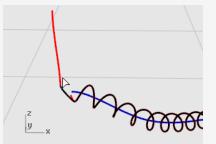


- 4. In the **Match Curve** dialog box, under **Continuity**, click **Tangency**, and enable **Join**.
- 5. Repeat steps 1 through 4 for the other end of the helix.

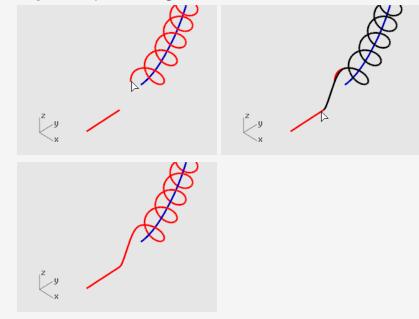


# Create the speaker wire

- 1. On the **Solid** menu, click **Pipe**.
- 2. At the **Select rail** prompt, select the extended helical curve.
- 3. At the Start radius... prompt, type 0.2, and press Enter.
- 4. At the End radius... prompt, press Enter.
- 5. At the **Point for next radius** prompt, press **Enter**.

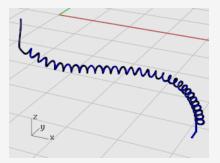

# Create the second wire

- 1. Select the curve at the top left.
- 2. On the **Solid** menu, click **Pipe**.
- 3. At the **Start radius...** prompt, type **0.1**, and press **Enter**.
- 4. At the End radius... prompt, press Enter.
- 5. At the **Point for next radius** prompt, press **Enter**.

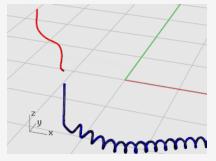

## Mirror the headphone parts

Mirror the parts to create the parts for the other side of the headphones.

### Reset the layers

- 1. In the top panel, click the **Layer** pane.
- 2. Turn on all layers.




On the View menu, click Zoom > Zoom Extents All.

### Delete all the shape curves

- 1. Press Esc to deselect anything currently selected.
- 2. On the Edit menu, click Select Objects > Curves.
- 3. Press the **Delete** key.

## Mirror the left half of the headphones

1. In the **Front** viewport, window select the speaker, bracket, small wire, and rotated ellipse as illustrated.

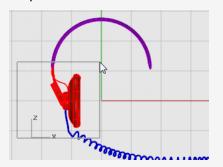


2. On the Transform menu, click Mirror.

The **Mirror** command depends on which viewport is active. It uses the construction plane in the active viewport to define the mirror plane. The mirror plane is perpendicular to the construction plane. Two points define the line in this plane about which the selected objects are mirrored.

3. At the **Start of mirror plane** prompt, type **0**, and press **Enter**.

This is the first point of the mirror line.

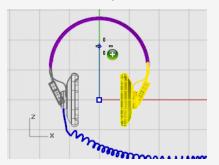

4. At the **End of mirror plane** prompt, turn on **Ortho**, and drag the mirror line straight up and pick.






For a video tutorial showing a more sophisticated modeling method for a headphone set using Rhino's Gumball feature, see: *Modeling stereo headphones*.

# 16 - Tutorial: Loft and Sweep - Boat

This tutorial demonstrates classic boat hull lofting techniques using typical plan and profile curves. The classic hull shape is based on a design from an old *Boat Builder's Handbook* magazine. Many designs similar to this are available over the Internet.

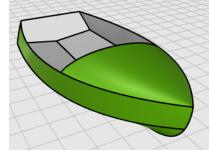

You will learn how to:

- Simplify the curves.
- Use curvature graph to improve fairness.
- Create 3-D curves from 2-D curves.
- Create surfaces from 3-D curves.

#### Marine terms used in this tutorial

#### Sheer

The fore-and-aft curvature from the bow to the stern of a ship's deck as shown in side elevation.

#### Chine

The intersection of the bottom and the sides of a flat or v-bottomed boat.

#### Transom

The planking forming the stern of a square-ended boat.

#### Fair

The meaning of *fair* is much debated in the marine industry and not easily defined. Although fairing or smoothing is traditionally associated with hull surfaces, all visible surfaces on any object can benefit from this process. In Rhino, the first cue for fairness in a surface is the spacing of the surface isocurves.


There are other characteristics of fair that curves and surfaces tend to have, although a curve or surface may be fair without exhibiting all of the characteristics. If you keep these characteristics in mind while modeling, you will end up with a better final product.

The guidelines for creating a fair surface include:

- Use the fewest possible control points to get the curve shape.
- Use the fewest possible curves to get the surface shape.

## Lay out the hull curves

The hull curves were created by tracing the original plans using a background bitmap. The first step is to check the curves for fairness before creating surfaces from them.

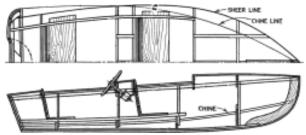

The designer's curves are illustrated. The sheer and chine are extended at the forward and aft ends to accommodate the lofting process.



### To download the tutorial model

- 1. On the Rhino Help menu, click Learn Rhinoceros, and then click Tutorials and Samples.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Victory.3dm**.

The curves are laid out on the **Plan** and **Profile** layers.

### Check the curves for fairness

Select each of the designer's curve pairs in plan and profile and use the **CurvatureGraph** command to determine if the curves are fair. In this case, the file has the original curves that were traced from the background bitmap. They are not fair. In other words, the curves do not smoothly transition from one end of the sheer to the other. Adjust points on any curve that is not fair. Start with the sheer (the curve at the top of the hull shape). It has the biggest impact on the appearance of the vessel.


## Check curvature

- 1. Select the sheer curve.
- 2. On the **Analyze** menu, click **Curve > Curvature Graph On** to start the **CurvatureGraph** command.
- 3. In the **Curvature Graph** dialog, increase **Display scale** to exaggerate the curvature variation.

We can tell that this curve has a poor curvature quality from its curvature graph.

4. Change the **Curvature hair** color as needed to make the curvature graph stand out from the background.


The illustration shows the curvature graph applied to the 2-D sheer in profile.

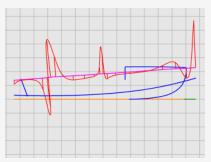


#### Note

The curvature graph should be continuous and exhibit the desired characteristics for the curve.


• When the curve is bending downward, the curvature graph will be above the curve. (1)

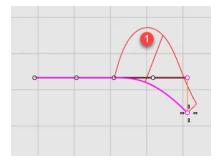

• Conversely, when the curve is bending upward, the curvature graph will be below the curve. (2)

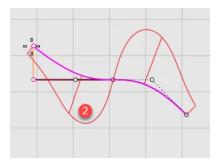

• The point of inflection (where the bending is reversing from one side to the other) is where the curvature graph crosses the curve. (3)

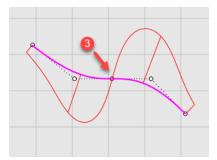


### Fix the curvature

Before doing any point editing to make a curve fair, you will rebuild the curve to remove excess control points. In general, rebuilding a curve involves using the Rebuild command along with examination with the CurvatureGraph command.


- When using the **Rebuild** command, do not use more points than you absolutely need.
- Use the **CurvatureGraph** command to check the curve for fairness after each change. If the curvature graph is still not satisfactory, move the control points until you have a smooth graph.
- Fair all of the curves in the model as needed before creating surfaces from bad curves.

## Rebuild the sheer curve

- 1. Select the sheer curve.
- 2. On the Edit menu, click Rebuild to start the Rebuild command.
- 3. In the **Rebuild** dialog box, change **Point count** to **6** and **Degree** to **5**.
- 4. Enable **Delete input**, and click **Rebuild**.

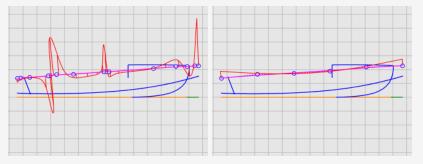


The curvature is improved, but it is not good enough. From the curvature graph, we can tell that the black curve in the right illustration is the real shape of the current sheer curve if we overstate it. It bends three times. We will improve the curve further by editing its control points to make it bend only once.

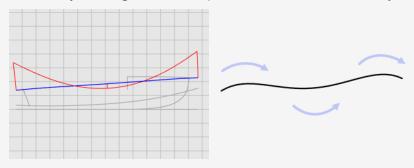

### Improve the curve further

The fine-tuning curvature of a curve requires moving control points a very short distance. It is not easy to do this with the normal mouse movement, so we can use Nudge Keys, the MoveUVN, or DragStrength commands to reduce moving strength. We will use the DragStrength command in this tutorial.




- 1. Select the sheer curve and press **F10** to turn on its control points.
- 2. Start the **DragStrength** command.
- 3. In the **Drag Strength** dialog, set the strength value to **5**.



Moving the mouse cursor in a distance on the screen will only move an object 5% of the distance.

- 4. In the **Front** viewport, select the four control points in the middle.
- 5. Use **Gumball** to move the control points in the y-axis.

Make the whole curvature graph below the sheer curve. It can be above the sheer curve if it is the design.

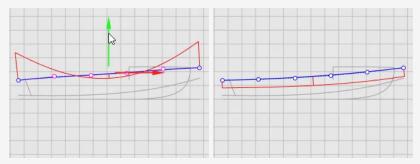

6. Close the **Drag Strength** dialog.

Drag strength returns to 100% when the dialog is closed.

7. Press **ESC** to turn off the curve control points.

#### See also

For more information about using Rhino's gumball feature, review the Help topic for the **Gumball** command.

Two video tutorials also help with learning to use the gumball



Hello Gumball! (https://vimeo.com/84954262)

Gumball Advanced (https://vimeo.com/260472052)


## **Create the 3-D curves**

So far, you have been working with 2-D curves. To loft the surfaces, you will use these planar curves to create 3-D curves. The planar curves can then be discarded.


With the **3D Curves** layer current, you will select the profile and plan view representations of each curve. You will use the **Crv2View** command to create the 3-D curve that combines the x-, y-, and z-coordinates of the 2-D curves. The 2-D curves must be planar for this command to work.




- 1. Set the **3D Curves** layer current.
- 2. Select the plan and profile representations of the sheer curve.

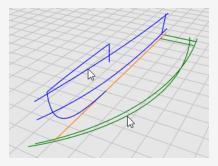


 On the Curve menu, click Curve from 2 Views to start the Crv2View command. A 3-D curve is created. It is the intersection of the two surfaces extruded from the two input curves.

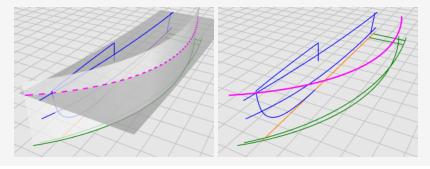

4. Repeat the **Crv2View** command for the chine curve.

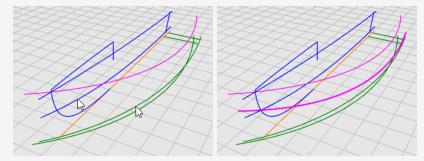

5. When you are satisfied that the proper curves were created, delete or hide the four input curves of the **Crv2View** command.

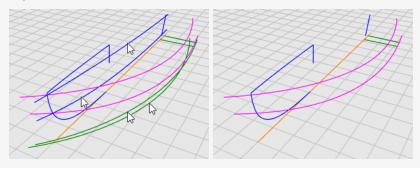


## **Revise the curves**


For the lofting process to work on the bottom panel, it cannot come to a point. The lofted shape must be rectangular. This is why the curves are extended beyond the centerline. The curves can be lofted into a rectangular surface that can then be trimmed back. Except for the bottom curve, the sheer and chine curves are already extended.



1. Select the centerline and the bow curve.

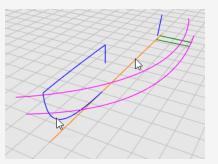


- 2. On the **Edit** menu, click **Trim** to start the **Trim** command.
- 3. Click the centerline near the forward end, and press **Enter**. The centerline is trimmed to the end of the bow curve.

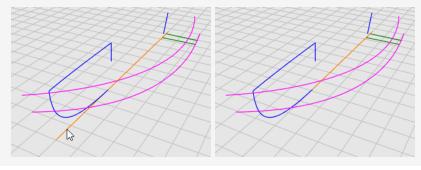


### **Extend the centerline**

- 1. On the **Curve** menu, click **Extend Curve** > **Extend Curve**.
- 2. At the Select boundary objects... Press Enter for dynamic extend prompt, press Enter.
- 3. At the **Select curve to extend...** prompt, set the command option **Type**=*Smooth*, and click the centerline near the forward end in the **Top** viewport.

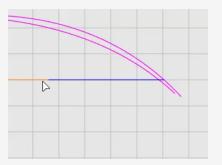

- 4. At the **End of extension...** prompt, click the command option **ToPoint**.
- 5. Move the cursor close to the ends of the shear and chine curves, but do not snap to them, click and press **Enter**.

The bottom curve for lofting is created.

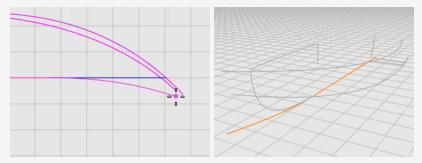


6. Press **ESC** to turn off the curve control points.

## Loft the hull surfaces


We have created three edge curves for one side of the hull. A lofted surface will be created from these curves.

## Loft sheer, chine, and bottom curves

- 1. Make the **Hull** layer current.
- 2. On the **Surface** menu, click **Loft**.
- 3. At the **Select curves to loft...** prompt, select the **sheer**, **chine**, and **bottom** curves in order and near the same ends, and press **Enter**.

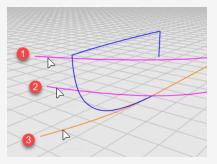

- 4. In the **Loft Options** dialog box, in the **Style** drop-down menu, click **Straight sections**.
- 5. Under **Cross-section curve options**, select **Rebuild with**, set the control point count to **10**, and click **Loft**.

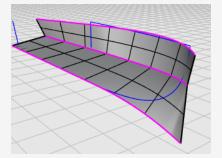


6. Hide the sheer, chine, and bottom curves.

## Create the other side of the hull

We have created one side of the hull. We will mirror the hull to the other side. Use both sides to trim each other. To make the both sides fully intersect, we will to extend the bottom surface before mirroring.

### Extend the bottom surface


- 1. On the **Surface** menu, click **Extend Surface**.
- 2. At the **Select an edge to extend...** prompt, set **Type=Smooth**.
- 3. Click the bottom edge, move the edge a short distance outward and click.

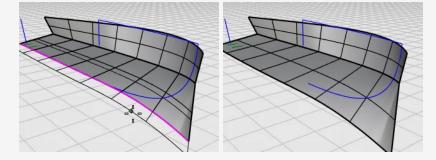

## Mirror the hull surfaces


- 1. In the **Top** viewport, select the hull.
- 2. On the Transform menu, click Mirror.
- 3. At the Start of mirror plane... prompt, click XAxis.

The hull is mirrored to the opposite side across the CPlane x-axis.

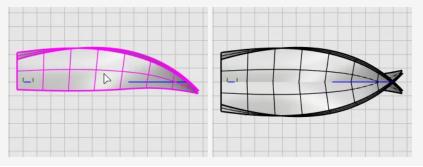

# **Trim the hull surfaces**

- 1. Select the hull surfaces on both sides.
- 2. On the **Edit** menu, click **Trim**.
- 3. In the **Front** viewport, crossing-select the hulls as illustrated, and press **Enter**. Drag the selection rectangle from right to left. Do not cross the blue bow curve.

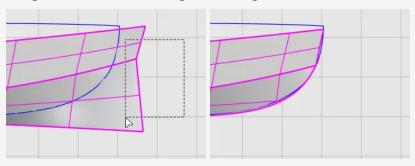


# **Build the transom**


The transom will be a surface created from a closed planar boundary.

# Trim the hull surfaces

1. Select the transom centerline.

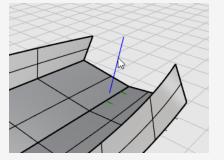


- 2. On the **Edit** menu, click **Trim**.
- 3. At the **Select object to trim...** prompt, enable **Extend Cutting Lines**. The line will work as an infinite line to trim the hull surfaces.
- 4. In the **Front** viewport, crossing select the hull behind the transom centerline. The hull surfaces are trimmed to the line.

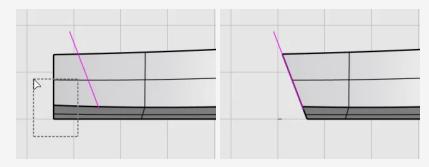

The transom edges do not form a closed boundary. We will add a line to fill the gap for creating the transom surface.


### Add a line to close the transom area

- 1. On the **Curve** menu, click **Line** > **Single Line**.
- 2. Pick the two corners with the **End** object snap to create a line.

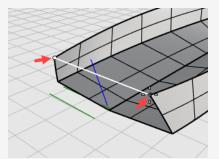

### Create the transom surface

- 1. On the **Surface** menu, click **Planar Curves** to start the **PlanarSrf** command.
- 2. At the **Select planar curves...** prompt, select the line and the transom edges, and press **Enter**.

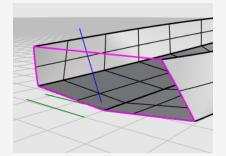

- 3. Select the hull and the transom surfaces.
- On the Edit menu, click Join.
   The surfaces are joined into a polysurface.

# 8 Check for errors

1. Select the hull.


#### 2. On the **Analyze** menu, click **Edge Tools** > **Show Edges**.

The command should report "Found 11 edges total; 3 naked edges, no nonmanifold edges."

If your hull has more edges or naked edges, the hull was not built correctly. You should start over and follow the steps carefully.

#### 3. In the Edge Analysis dialog, select Naked Edges.


The naked edges display as magenta. You should not see any naked edges other than the upper edges of the hull.

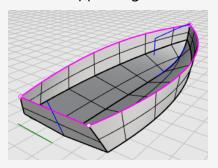

4. Close the Edge Analysis dialog.

# Add the deck

The last step is to create the deck surface. Two curves describe the silhouette of the deck. They will be used as references to create the cross-section curve of the deck. In the end, the deck surface will be created from a curve network.

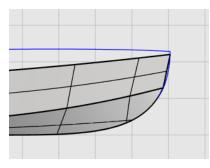


### Compromise between concept and reality


When building a 3-D model from a 2-D concept plan, it is usually the case that the 3-D model cannot exactly match the 2-D plan. How to compromise between a 2-D concept and a 3-D model is one of the modeling skills you will develop. In this case, the deck profile curve does not end at the hull corner. We will move the curve end to the hull corner.

#### Adjust the control points

1. Select the deck profile curve, press **F10** to turn on its control points.

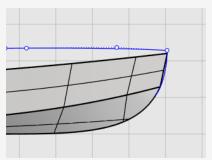


2. Drag the first control point, using the **End** object snap to move the point to the corner of the hull, and click.

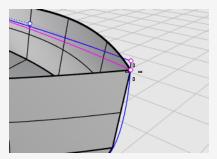


3. Press **ESC** to turn off the curve control points.

Project the vertical line on to the hull

- 1. On the **Curve** menu, click **Curve from objects > Project**.
- 2. At the **Select curves and points to project...** prompt, in the **Front** viewport, select the vertical line, and press **Enter**.

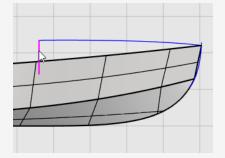


3. At the **Select surfaces...** prompt, select the hull, and press **Enter**. The line is projected onto both sides of the hull.

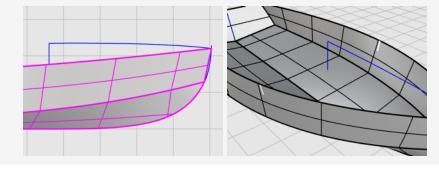

### Draw one half of the cross-section curve


- 1. In the top panel, click the **Planar** to turn on **Planar** mode.
- 2. On the **Curve** menu, click **Free-Form** > **Control Points**.
- 3. In the **Right** viewport, use the **End** object snap to place the first point at the end of the deck profile curve (1).
- 4. Hold down **Shift** to turn Ortho mode on, move the cursor to the right, and click to place the second point (2).
- 5. Release **Shift** and click to place the third point (3).

6. Snap to the upper end of the projected curve on the hull (4), click, and press **Enter** to finish the curve.

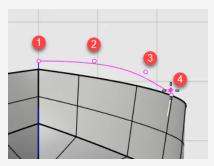

# Mirror the half of the cross-section curve

- 1. On the **Transform** menu, click **Mirror**.
- 2. At the **Select objects to mirror** prompt, in the **Right** viewport, select the half cross-section curve, and press **Enter**.

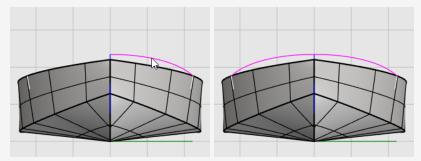

3. At the **Start of mirror plane...** prompt, click the **YAxis** option or type **Y**, and press **Enter**.


The curve is mirrored to the other side across the viewport y-axis.

- 4. Select the two half cross-section curves.
- 5. On the **Edit** menu, click **Join**.

The two half cross-section curves are joined into a polycurve.


#### $\mathbb{R}$ Create the deck surface from a curve network

The deck cross-section curve (1), the deck profile curve (2), and the upper edges of the hull (3) and (4) form a curve network that will be used to create the deck surface.

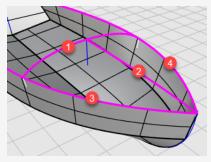

- 1. On the **Surface** menu, click **Curve Network** to start the **NetworkSrf** command.
- 2. At the **Select curves in network...** prompt, select the four curves, and press **Enter**.
- 3. In the Surface From Curve Network dialog box, under Edge matching, select Position for A, B, and C, and click OK.


The deck surface is created.

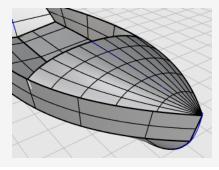




## 😚 Join the parts

- 1. Select all of the surfaces.
- 2. On the **Edit** menu, click **Join** to create a polysurface.

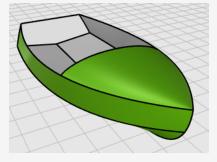

# 17 - Tutorial: Point Editing and Blending -Penguin

This tutorial demonstrates point-editing techniques including moving and scaling control points and adding knots to surfaces to increase control. In addition, you will use blends to create smooth transitions between surfaces.

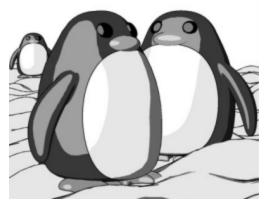

Rendered with Penguin renderer by Jari Saarinen.

You will learn how to:

- Rebuild surfaces to add additional control points.
- Insert knots in a surface to add control points in a specific location.
- Edit surface control points to define a shape.
- Scale control points to change the object shape.
- Use object snaps projected to the construction plane.
- Orient an object on a surface.
- Create smooth blends between surfaces.

#### To download the tutorial model

- 1. On the Rhino **Help** menu, click **Learn Rhinoceros**, and then click **Tutorials and Samples**.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Penguin.3dm**.

# The body

You can open the example model, **Penguin.3dm**, and try to match the shapes of the complete penguin on the hidden **Complete** layer as you are building the model. You can experiment with your own shapes, too.

The body and head are created from one sphere. The shape is formed by moving the control points in the sphere to create the head.


# Draw a sphere

- 1. On the **Solid** menu, click **Sphere > Center, Radius**.
- 2. At the **Center of sphere...** prompt, move the mouse cursor to the **Top** viewport.
- 3. Type **0**, and press **Enter**.

The center of the sphere is placed at the construction plane origin (0,0,0).

4. At the **Radius...** prompt, type **10**, and press **Enter**.


A sphere with a radius of **10** units is created.

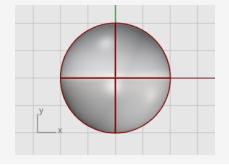

# Rebuild the sphere

Use the **Rebuild** command to add more control points to the sphere.


- 1. On the **Edit** menu, click **Rebuild**.
- 2. At the **Select curves, extrusions or surfaces to rebuild** prompt, select the sphere, and press **Enter**.
- 3. In the **Rebuild Surface** dialog box, set the **Point count** in the **U** and **V** directions to **8**, and the **Degree** in the **U** and **V** directions to **3**.
- 4. Check **Delete input**, and click **Rebuild**.

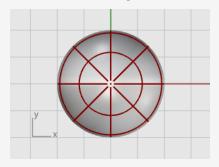

# Turn control points on

Use the **PointsOn** command or press **F10** to turn on the sphere's control points. Look in all the viewports at the structure of the control points.


The next step will change this structure so that moving the control points does not influence the whole sphere.

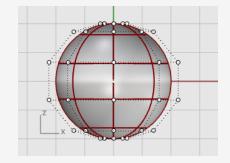


# Minsert knots

Use the **InsertKnot** command to insert two knots in the sphere in the area where you want the neck.

- 1. On the Edit menu, click Control Points > Insert Knot.
- 2. At the Select the curve or surface for knot insertion prompt, select the sphere.
- 3. At the **Point on surface to add knot** prompts, set the command option **Direction**=**U**.
- 4. Click on the sphere to insert two knots (isocurves) in the u-direction only as illustrated.

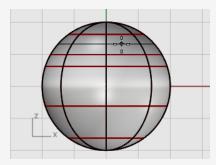


Examine the control point structure after inserting the knot.

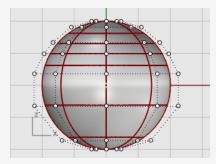


You will reposition control points to create the indentation for the neck and to reform the body shape.

# $\stackrel{\longrightarrow \bullet}{\longrightarrow \bullet}$ Flatten the bottom


1. In the **Front** viewport, window-select the control points near the bottom of the sphere.

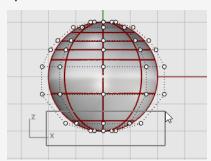


- 2. On the Transform menu, click Set XYZ Coordinates.
- 3. In the **Set Points** dialog box, check the **Set Z**, clear the **Set X** and **Set Y** check boxes, select **Align to World**, and click **Set Points**.
- 4. Drag the selected control points up, and click.

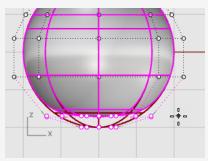


This will align all of the selected control points to the same z-value (up in the **Front** viewport), flattening the surface.

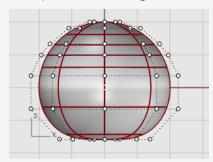




1. Window-select the top rows of control points in the Front viewport.

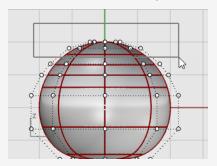

- 2. Click **Gumball** in the top panel to turn it on.
- 3. Drag the green arrow of the **Gumball** widget to move the control points up to shape the body.

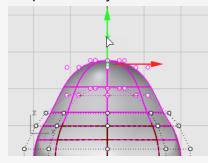

#### See also

For more information about using Rhino's gumball feature, review the Help topic for the **Gumball** command.

Two video tutorials also help with learning to use the gumball




Hello Gumball! (https://vimeo.com/84954262)

Gumball Advanced (https://vimeo.com/260472052)

# 🙇 Scale points


1. In the **Perspective** viewport, hold the **Shift** key and drag the **Gumball scale handle** (the small blue rectangle).

The control points are scaled in two directions.

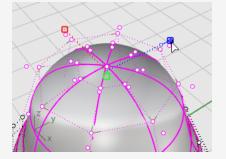


Look at different viewports to see the changes in the body shape as you move the control points closer to and farther from the center.

Match the example model or use your own shape.

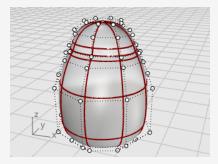

2. Drag the **Gumball scale handle** without holding the **Shift** key.

The control points are scaled in one direction. Make the body slightly flatter in the front and back direction near the head.

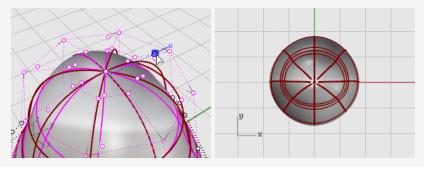

### The eyes


The eye is an ellipsoid shape that is oriented onto the surface.

# Create the eye

- 1. Start the **Ellipsoid** command.
- 2. In the **Top** viewport, place the center point anywhere.
- 3. At the **End of first axis** prompt, type **1.1**, and press **Enter**.

This constrains the distance from the center point to the end of the axis to 1.1 units.


4. Drag the cursor to the right and pick.

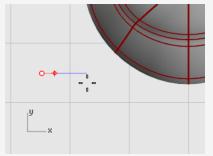


5. At the **End of second axis** prompt, type **1.1**, and press **Enter** to constrain the distance.

Using these constraints will create a circular ellipsoid when it is seen from the top.

6. Drag the cursor up or down in the **Top** viewport and pick.

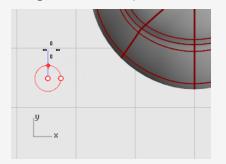


7. At the End of third axis prompt, type 0.5, and press Enter.

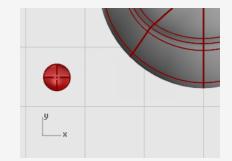

#### ∧ ∠


#### Orient the eye on the surface

- 1. Select the eye ellipsoid in the Top or Perspective viewport.
- 2. On the **Transform** menu, click **Orient > On Surface** to start the **OrientOnSrf** command.
- 3. At the **Base point...** prompt, in the **Top** viewport, pick the center of the ellipsoid.

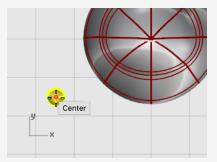


4. At the **Reference point for scaling and rotation** prompt, pick any point to the right or left of the eye ellipsoid.

The exact location is not important.

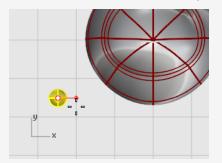

- 5. At the **Surface to orient on** prompt, select the penguin body.
- 6. In the **Orient on Surface** dialog box, click **Orient**.


7. At the **Point on surface to orient to...** prompt, move the cursor onto the head area where you want to place the eye and click.

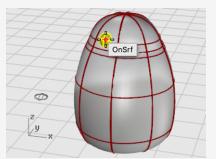



- 1. Start the **Mirror** command.
- 2. In the **Front** viewport, at the **Start of mirror plane...** prompt, type **0**, and press **Enter**.
- 3. At the **End of mirror plane...** move the mouse cursor along the y-axis with **Ortho** mode and click.

The second eye is created.

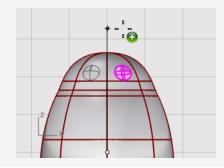

### The beak


The beak is another ellipsoid that you can edit to change the shape.

### Create the basic beak shape


- 1. Start the **Ellipsoid** command.
- 2. In the **Top** viewport, place the center point anywhere.
- 3. At the End of first axis prompt, type 3, and press Enter.

This constrains the distance from the center point to the end of the axis to three units.


4. Hold the **Shift** key, drag the cursor to the right, and pick.

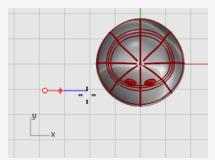

- At the End of second axis prompt, type 2, and press Enter.
   Using these constraints creates a circular ellipsoid when it is seen from the top.
- 6. Drag the cursor up or down in the **Top** viewport and pick.

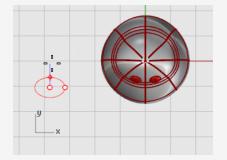


7. At the **End of third axis** prompt, type **1**, and press **Enter**.

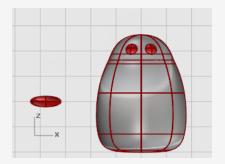


# **Shape the beak**


- 1. Select the beak and press **F10** to turn on the beak's control points.
- 2. In the **Front** viewport, window-select the upper row of points.
- 3. Drag the selected points up.

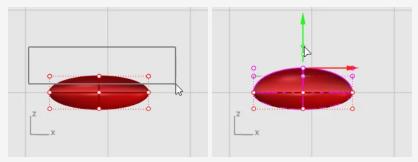

- 4. Window-select the middle points of the lower rows.
- 5. Drag the control points up to shape the beak.

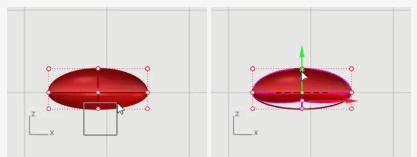

**Tip**: You can also try the **Nudge** keys (**Alt** + **Arrow** direction keys) to nudge the selected points.

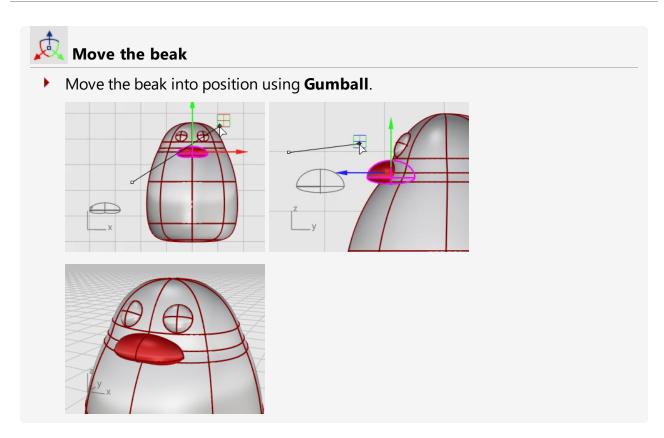

# The feet


The feet are created using another ellipsoid. Knots are added to help create the webbed toes.




- 1. In the Front viewport, start the Ellipsoid command.
- 2. Place the center point anywhere.
- 3. At the **End of first axis** prompt, type **1**, and press **Enter**. This constrains the distance from the center point to the end of the axis to one unit.
- 4. With **Ortho** on, drag the cursor up, and pick.



- 5. At the End of second axis prompt, type 3, and press Enter.
- 6. In the **Top** viewport, with **Ortho** on, drag the cursor up, and pick.

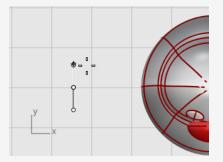

7. At the **End of third axis** prompt, type **3**, and press **Enter**.

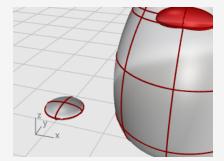


# Rebuild the ellipsoid

- 1. Use the **Rebuild** command to add more control points to the ellipsoid.
- 2. In the **Rebuild Surface** dialog box, set the **Point count** in the **U** and **V** directions to **8**.
- 3. Set the **Degree** in the **U** and **V** directions to **3**.
- 4. Check **Delete input**, and click **Rebuild**.

# Insert knots to create the webbed feet

- 1. Select the ellipsoid and start the InsertKnot command.
- 2. Enable **Symmetrical** and set **Direction=***V*.
- 3. Insert four knots (isocurves) in the ellipsoid as illustrated, and press Enter.

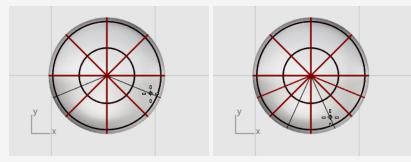


### Scale the points from the center


1. Windows-select the control points on both top and bottom of the ellipsoid as illustrated.

Hold the **Alt** key to avoid moving control points.


Hold the **Shift** key to add more control points to the selection.

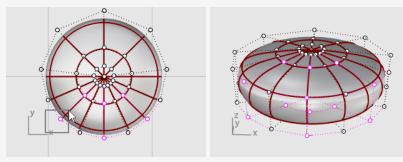


2. Start the **Scale2D** command, and in the **Top** viewport, pick the center point with the **Point** object snap as the **Base point**.

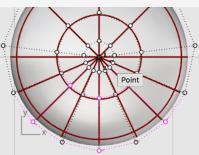

3. Pick another point away from the ellipsoid as the **First reference point**.

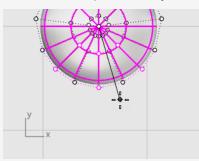


4. Drag the points to make the whole foot about twice the size of the original ellipsoid and click.

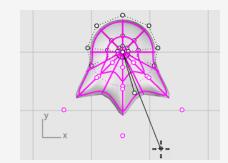


# 🙇 Move and rotate the foot into position

1. Use **Gumball** to move the foot in the **Top** and **Front** viewports under the penguin body.

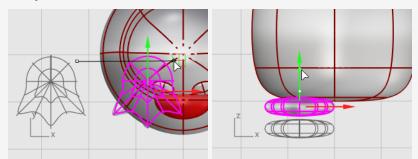


- 2. Select the foot in the **Top** viewport.
- 3. Click Gumball's blue rotation control, type **-15**, and press **Enter** to rotate the foot 15 degrees.

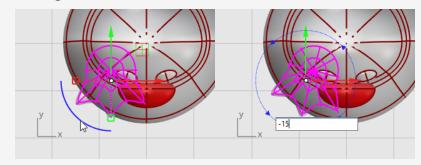

# Mirror the foot


- 1. Select the foot and start the **Mirror** command in the **Front** viewport.
- 2. Type **0**, and press **Enter** to place the start of the mirror plane at the construction plane origin.
- 3. Hold the **Shift** key to enable **Ortho** mode, drag the mouse cursor up or down, and click.

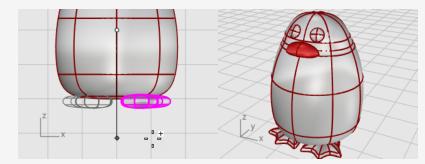

# Create a cutting plane

- 1. **Select** the feet, on the **Surface** menu, click **Plane** > **Cutting Plane**.
- 2. In the **Front** viewport, pick two points to make a planar surface that passes through the feet as illustrated.


Hold the **Shift** key to enable **Ortho** mode while picking the second point.

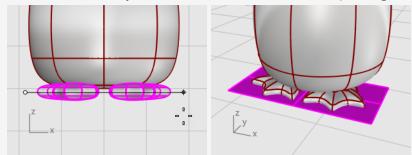


🕂 Trim and 🆏 Join the feet and the plane

Trim the bottoms of the feet off with the plane as the cutting object.

- 1. Select the feet and the cutting plane.
- 2. On the **Edit** menu, click **Trim**.
- 3. In the **Front** viewport, click the three positions as illustrated, and press **Enter**.

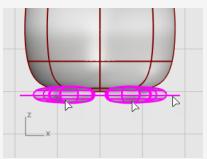


4. While the remaining surfaces are still selected, on the **Edit** menu, click **Join**. The surfaces are joined into two closed polysurfaces.

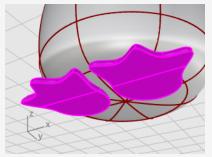

# The tail

The tail is another ellipsoid. It is joined to the body with a smooth blend surface.

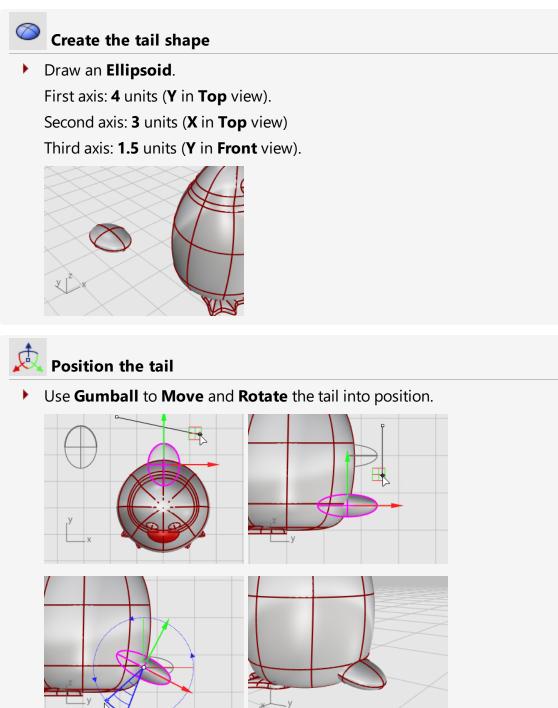

# P Union the tail and body

Combine the tail and the body shapes with a Boolean operation.


- 1. On the **Solid** menu, click **Union**.
- 2. At the **Select surfaces or polysurfaces to union** prompt, click the tail and the body, and press **Enter**.

The tail and body are combined into a single object.


# Smooth the sharp edge between the tail and body


The transition between the tail and body is rather abrupt; so replace this with a smooth blend surface.

- 1. On the **Solid** menu, click **Fillet Edge > Blend Edge**.
- At the Select edges to blend... prompt, type 0.6, and press Enter. The NextRadius option is set to 0.6 units.
- 3. Pick the edge between the tail and body, and press Enter twice.

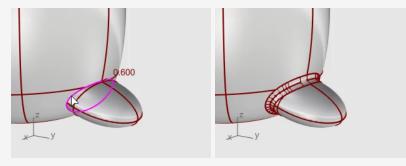


# The wings

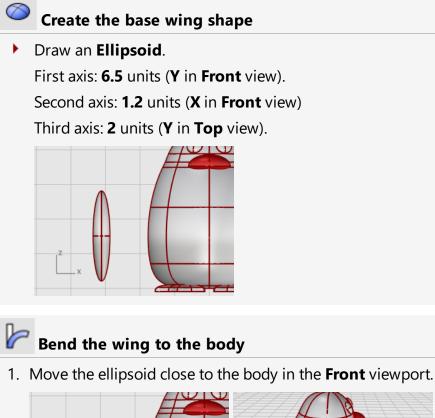


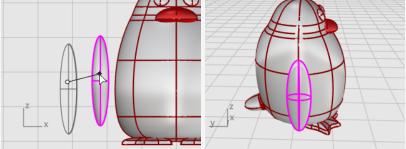


- 2. On the Transform menu, click Bend.
- 3. At the **Start of spine** prompt, in the **Front** viewport, pick near the bottom of the wing ellipsoid.

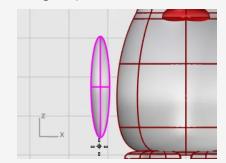


4. At the **End of spine** prompt, pick near the top of the wing.

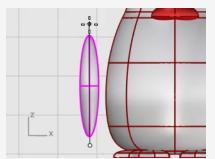

5. At the **Point to bend through...** prompt, drag the top of the wing toward the body to intersect.

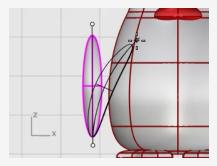


6. If further positioning is required, use **Gumball** to place the wing.

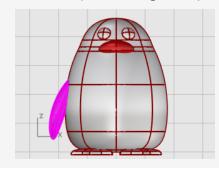




• Use the **Mirror** command to create the opposite wing.

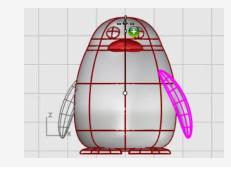

# Boolean Union the wings and the body

- 1. Select the body and wings.
- 2. On the **Solid** menu, click **Union**.

The body and wings are trimmed by each other and joined into a single object.

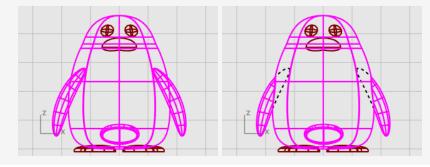


# **Finishing touches**

To finish the penguin, split the front part of the body so a different material can be applied to it.



Draw a curve from the beak down to the bottom.


- 1. On the **Curve** menu, click **Free-Form** > **Interpolate Curve**.
- 2. In the **Right** viewport, pick three points as illustrated, and press **Enter**.

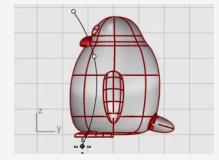

# Split the body with the curve

Split the body surface with the curve. This allows a different material for the front of the body.

- 1. On the **Edit** menu, click **Split**.
- 2. At **Select object to split...** prompt, select the body, and press **Enter**.
- 3. At **Select cutting objects...** prompt, select the curve, and press **Enter**.

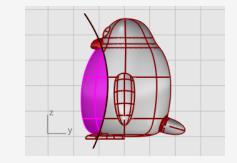


# Add a light and materials

To produce a realistic rendering of your model, materials and lighting will be required.


# Set up the light

0

- 1. On the Render menu, click Create Point Light.
- 2. In the **Top** viewport, click near the location as illustrated.

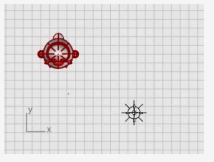

3. In the **Front** viewport, move the point light to be higher than the penguin.

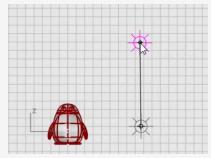


### **Create materials**

1. Type **Materials** and press **Enter**.

The Materials panel is opened on the right side.

- 2. Click the + button, and on the material template list, click **Plastic**.
- 3. Replace the name **Plastic** with the name **Body**.
- 4. Under Plastic, click the **Color** swatch to open the **Color** dialog.
- 5. Select a dark gray color.

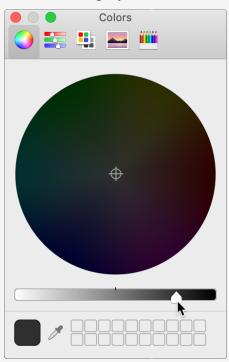

- 6. Create three more **Plastic** materials named **Eyes**, **Beak and Feet**, and **Belly**.
- 7. Set the **Eyes** color to black, the **Beak and Feet** color to orange, and the **Belly** color to white.

### Assign materials

- 1. Make the **Perspective** viewport current, on the **View** menu, click **Rendered**.
- 2. Drag the **Body** material from the **Material** panel, and drop it onto the penguin body.

The material is assigned to a single object.



- 3. Drag the **Belly** material from the **Material** panel, and drop it onto the front part of the penguin.
- 4. Select the beak and feet.
- 5. In the **Material** panel, right-click on the **Beak and Feet** material, and click **Assign to Objects**.


The material is assigned to multiple objects at once.

- 6. Select the eyes.
- 7. In the **Material** panel, right-click on the **Eyes** material, and click **Assign to Objects**.




### 18 - Tutorial: Trace Images - Dragonfly

This tutorial demonstrates how to get started modeling an object using photographs as reference material.

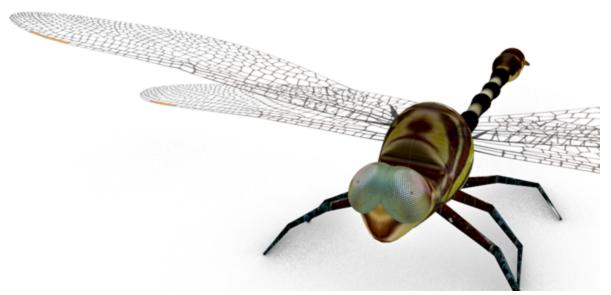

You will learn how to:

- Trace images to create profile curves.
- Sweep a cross-section along two rails to create the body segments.
- Create the tail from a curve network.
- Use blend surfaces to create the chest.
- Edit control points to change the shape of a surface for the head.

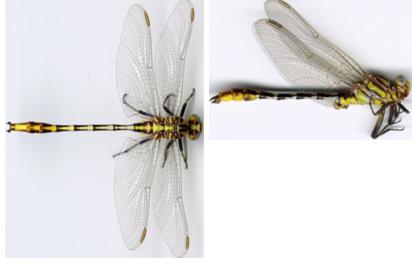

Starting images.

**Note**: The top and side views are actually of different specimens of this dragonfly. In the side view, the wings are folded up. We will be using the side view image only to draw the side view curves of the body.

#### To download the tutorial files

- 1. On the Rhino Help menu, click Learn Rhinoceros, and then click Tutorials and Samples.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial image files **Dragonfly Top.jpg** and **Dragonfly Side.jpg**.

### Place the reference images


#### Start the model

- 1. On the File menu, click New Using Template... to begin a new model.
- 2. On the **Splash screen**, in the template list, double-click **Small Objects -Millimeters.3dm**.

### **III** Place the top view image


- 1. Drag the image file **DragonFly Top.jpg** from **Finder** and drop it onto a Rhino viewport.
- 2. In the Image Options dialog, select Picture, and click Apply.
- 3. Move the cursor to the **Top** viewport, type **0**, and press **Enter**. This places the first corner at the construction plane origin, **0,0,0**.
- Type **50**, and press **Enter**.
   This sets the length of the **Picture plane** to **50 mm**.

5. Move the cursor above the **X axis**, and click.

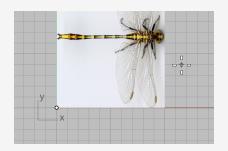

### Place the side view image


In the Front viewport, use the same steps to place the image file DragonFly Side.jpg.

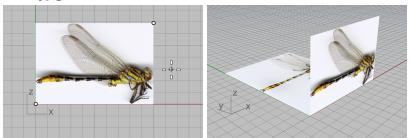


### Align the top view image

- 1. On the **Object Snap** panel, check **Midpoint** and **End**.
- 2. In the **Perspective** viewport, move the cursor near the tail of the top view image and hold the left mouse button.

The **Midpoint** tooltip appears to indicate the middle point of the edge is snapped. **Note**: Do not release the left mouse button.

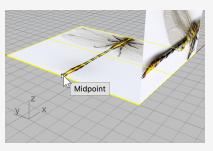

3. Drag the Picture plane, snap to the lower-left corner of the other Picture plane, and release the left mouse button.

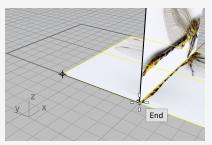


# 🙇 Align the side view image

1. In the **Top panel**, turn on **Gumball**.



- 2. In the **Perspective** viewport, select the side view Picture plane.
- 3. Drag the blue arrow down and align the body in the side view image with the top Picture plane.

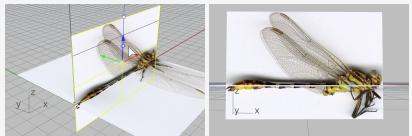

4. Turn off Gumball.

#### More about gumball

For more information about using Rhino's gumball feature, review the Help topic for the **Gumball** command.

Two video tutorials also help with learning to use the gumball




Hello Gumball! (https://vimeo.com/84954262)

Gumball Advanced (https://vimeo.com/260472052)


### Reduce visibility of Picture materials

The Picture command creates a **Picture** material with the selected image as the texture and assigns the material to the Picture plane. Reducing visibility of the Picture material makes tracing the image easier.

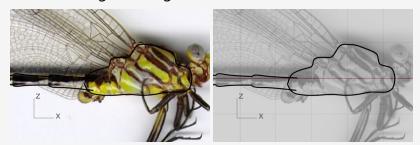

Black curves on the full color texture (left) and on a transparent grayscale texture (right).

1. In the Materials panel, two materials have been added by the Picture command.

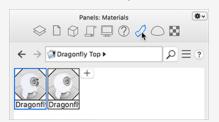

2. Select both materials in the **Materials** panel.

Tip: Select a material, hold **Shift**, and select the other.

3. In the **Texture** settings below, check **Grayscale**.

Picture	
Texture	
(click to assign texture)	
Self-illuminated	
Grayscale	

4. In the **Transparency** settings, drag the slider to **80%**.



## Lock Picture planes

Select the two Picture planes and run the Lock command.

(Edit > Visibility > Lock)

This makes it so the Picture planes cannot be selected. Selecting curves on or behind the Picture planes will be easier.

### Trace the chest and body

#### Draw chest profiles

- Start the **Curve** command.
   (Curve > Free-Form > Control Points)
- 2. In the **Front** viewport, start the curve at the neck (1).
- 3. Trace along the upper profile of the chest and end the curve at (2) where the chest and body connect.



4. Draw another curve along the lower profile of the chest.

Use the **End** object snap to start and end the curve at the endpoints of the first curve.




# Create body segment profiles

The body consists of several segments. We only need to draw the profiles of one segment.


- 1. Start a curve at (1) in the chest and above the ends of the chest profiles.
- 2. Reference the image and end the curve at the end of the first segment.

**Tip:** Use five points to draw the curve. Place the last two points close to form a curly end (2).

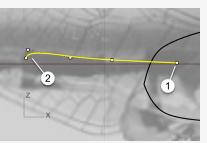

- Select the curve, and start the Mirror command. (Transform > Mirror)
- 4. Pick at (1) and then (2) to define the mirror plane.


Tip: The mirrored curve has to intersect with the lower chest profile.

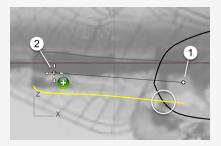


### Duplicate body segment profiles

 $\leq$ 


- Select the upper body segment profile, and start the **Orient** command. (*Transform* > Orient > 2 Points)
- 2. In the command options, check **Copy** and select **1 D** for **Scale**.
- 3. Snap to the right end of the curve, and click to place the first reference point.

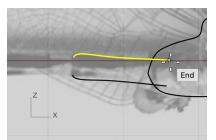


4. Snap to the left end of the curve, and click to place the second reference point.

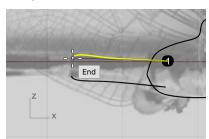


5. Snap to the same end again, and click to place the first target point.

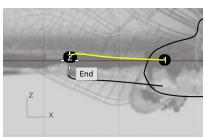


6. Using the image as a reference, click at the end of the second body segment.

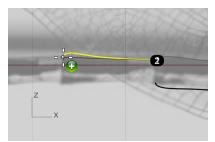


7. Snap to the current end, click, and continue duplicating more curves along the upper body profile.

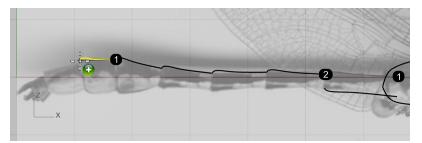

8. Click at the end of the last body segment, and press the **ESC** key to end the command.

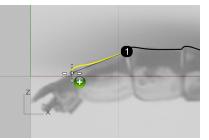


9. Use the same procedure to duplicate the other curve along the lower body profile.

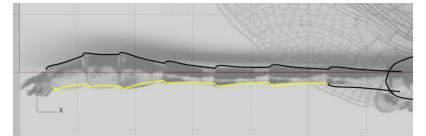


#### Fine-tune body segment profile curves


The last three lower body segment profile curves do not match the image. We will use control point editing to improve them.

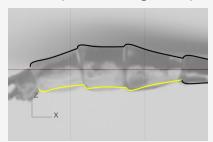


Select one of the curves.
 Its control points turn on automatically.

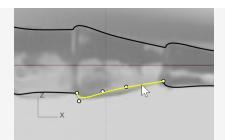


2. Move the control points to make the curve match the image.

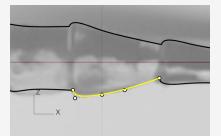

3. Adjust the other two curves.

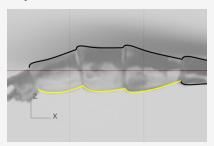


 Select all body segment profile curves, and **Join** them into two polycurves. (*Edit > Join*)

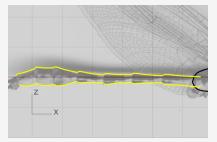

### **Create the body segments**

### Create the body cross-section

- Start the **Circle** command to draw a circle from its diameter. (Curve > Circle > 2 Points)
- 2. In the command options, click Vertical.
- 3. In the **Front** viewport, snap to the two ends of the body profile curves to create a circle.

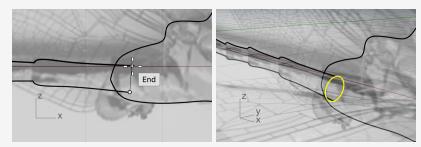


### Create the body segment surfaces

1. Start the **Sweep2** command.


(Surface > Sweep 2 Rails)

2

2. In the **Perspective** viewport, select the two body profile curves (1) and (2), and the cross-section circle (3) in order. Press **Enter** when done.

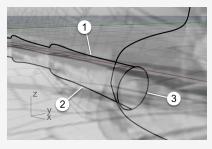


3. Press **Enter** one more time to accept the default seam location.

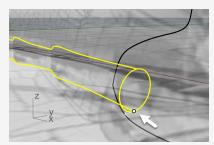


4. In **Sweep 2 Rail Options**, set the options as shown below, and click **Sweep** to create the surface.



5. On the **Perspective** viewport title menu, click **Shaded** to see the surface.

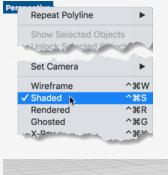


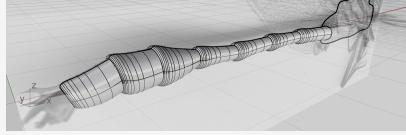


### **Create the tail**

### Draw the side profiles of the tail


- Start the **Curve** command.
   (Curve > Free-Form > Control Points)
- 2. Use the **Quadrant** object snap to start the curve from the top quadrant point of the body edge.

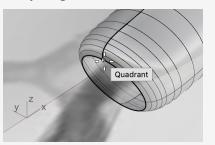


Continue drawing the curve in the **Front** viewport.
 Use four points to create the curve.

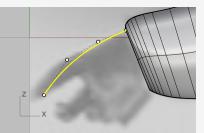

4. Create another curve from the bottom quadrant point of the body edge.

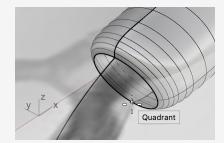


5. Continue drawing the curve in the **Front** viewport.

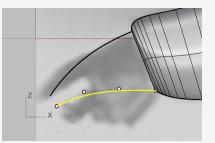


### Create the end cross-section of the tail

- Create an **Ellipse** from its diameter.
   (Curve > Ellipse > Diameter)
- 2. In the command options, click **Vertical**.
- 3. To draw the ellipse vertical to the Front construction plane, in the **Front** viewport, use the **End** object snap to place the first and second points of the ellipse at the ends of the two curves.

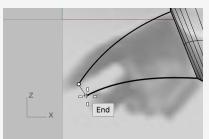


4. In the **Top** viewport, reference the image, and place the third point of the ellipse.

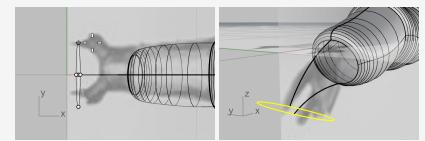


### Draw the top profiles of the tail

- Start the InterpCrv command.
   (Curve > Free-Form > Interpolate Points)
- 2. In the **Perspective** viewport, use the Quad object snap to start the curve from the left quadrant point of the body edge (1).
- 3. End the curve at the left quadrant point of the ellipse (2).

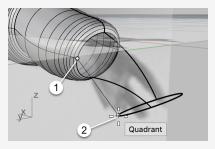

4. In the **Front** viewport, select the curve, and move the two control points up a small distance.

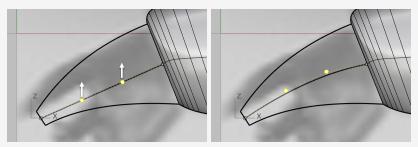


5. In the **Top** viewport, move the two control points in the vertical direction to make an "S" shape.

**Tip:** To maintain the curve's shape in the Front viewport, move the control points in the Top viewport only in the y-direction.



6. **Mirror** (*Transform > Mirror*) the curve to the other side.

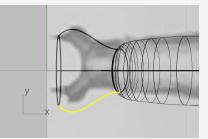


### Create the tail surface

Now we have a curve network that we can use to create the tail surface.

1. Start the **NetworkSrf** command.

(Surface > Curve Network)

2. In the **Perspective** viewport, select the four curves, the ellipse, and the body edge, and press **Enter**.

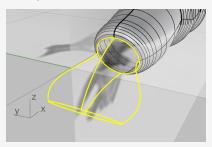


3. In the options dialog, set the options as shown below, and click **OK**.

Surface From Curve Network	
Tolerances	
Edge curves: 0.01	
Interior curves: 0.01	
Angle: 1.00	z
	y ×
Edge matching	
A B C D	
Loose	
Position • •	
Tangency O O O O O O O O O O O O O O O O O O O	
Preview	
Cancel OK	




1. Use the **SelCrv** command to select all the curves in the model.

(Edit > Select Objects > Curves)

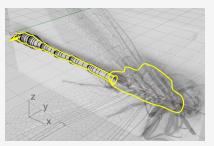

2. Hold the **Command** key and click on the two chest profile curves to deselect them.

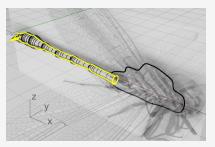


Hide all the curves that will not be used in the future.
 (Edit > Visibility > Hide)

### 🗞 🚺 Join body and tail surfaces

- Start the **Join** command.
   (Edit > Join)
- 2. Select the body and tail surfaces, and press **Enter**. The body and tail are joined into a single object.
- While the new body-tail object is still selected, run the Cap command. (Solid > Cap Planar Holes)

A planar surface is added to each open end to make it a closed object.

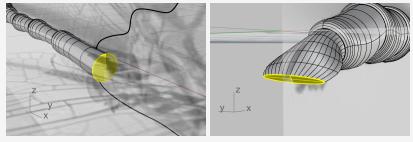


### Create the trimming cylinder

We will create a cylinder and use it to trim the tail.

1. Start the **Cylinder** command.


(Solid > Cylinder)

- 2. In the command options, check **Solid**, and click **2 Point**.
- 3. Use the **Quadrant** object snap to place the start (1) and end (2) of the cylinder base at the left and right quadrant points of the tail edge.

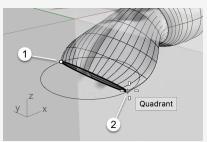


4. In the command options, select **None** for **Direction Constraint** and check **Both Sides**.

5. In the **Front** viewport, move the cursor to make the preview cylinder roughly perpendicular to the tail and click.

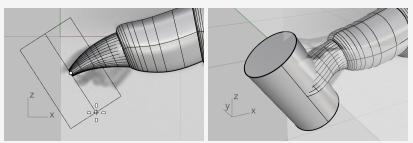

### У Trim the tail

- Start the **BooleanDifference** command. (Solid > Difference)
- 2. Select the body-tail object as the object to subtract from, and press Enter.
- 3. Select the cylinder as the object to subtract with, and press **Enter**.

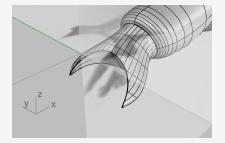


### **Create the chest**

### 🙇 Create the dummy surfaces

We will make two dummy surfaces to help create one side of the chest.

- 1. Turn on Gumball.
- 2. Select the two chest profile curves in the Perspective viewport.
- Drag the small dot on the green arrow of the Gumball widget for a short distance. The two curves are extruded into two surfaces. They are the dummy surfaces.

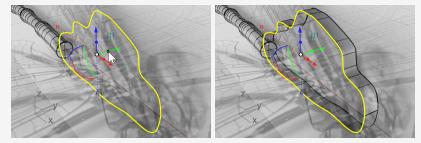


 While the curves are still selected, run the Hide command. (Edit > Visibility > Hide)



- Start the **BlendSrf** command.
   (Surface > Blend Surface)
- 2. Select the two edges of the dummy surfaces.

Tip: Select the two edges close to the same end.

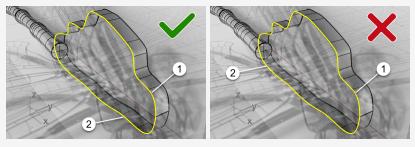


3. In the options dialog, click the lock icon to link the two sliders.




4. Set the options as shown in the illustration below.



5. Look at the **Top** viewport and drag the sliders to the left until the blend surface profile matches the chest profile in the top image.

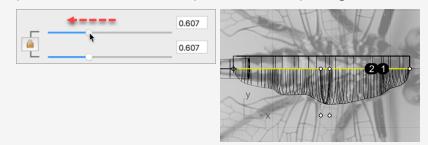

6. Click **OK** to create one side of the chest.

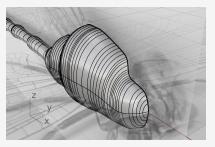

7. Delete the two dummy surfaces.

# Mirror the chest surface

- Select the chest surface, and start the **Mirror** command. (*Transform > Mirror*)
- 2. With the **Perspective** or **Top** viewport active, click the command option **XAxis**.




Join both sides into a whole chest.
 (Edit > Join)

### **Create the head**


The head is deformed by control points editing from an ellipsoid.

### Given Start the head from a sphere

- Start the **Sphere** command.
   (Solid > Sphere > Center, Radius)
- 2. In the **Front** viewport, pick at (1) for the sphere center and (2) for the radius.

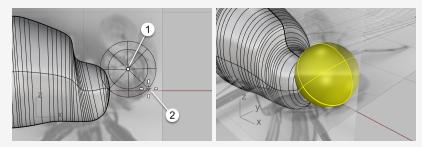

- 3. In the **Top** viewport, select the sphere, and turn on **Gumball**.
- Drag the **Y scale handle** (the small green rectangle) down for a short distance. The sphere became an ellipsoid.

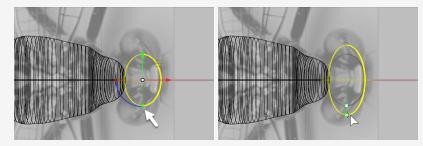


## Rebuild the ellipsoid

1. **Rebuild** the ellipsoid.

(Edit > Rebuild)

2. In the **Rebuild Surface** options dialog, set the options as shown in the illustration below, and click **Rebuild**.

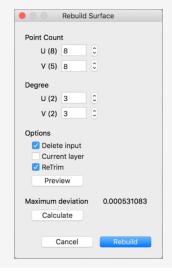


### **)** Shape the head


- 1. Select the head, and press F10 to turn on its control points.
- 2. Start the **SelCircular** command.

(Edit > Select Objects > Area and Volume Select > Circular)


- 3. In the **Front** viewport, as shown below, click at (1) to set the center of the selection circle.
- 4. Click at (2) between the outermost two rows of control points to define the size of the selection circle.

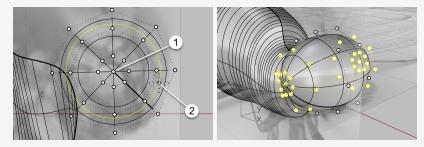


5. In the **Top** viewport, drag Gumball's **X move control** (the red arrow) to the left.

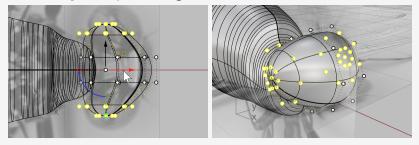

6. In the **Front** viewport, window-select the control points as illustrated.

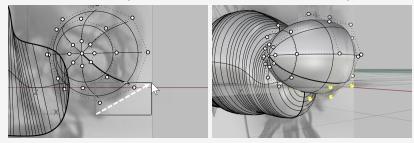

7. Drag Gumball's XY plane control toward the lower-right.

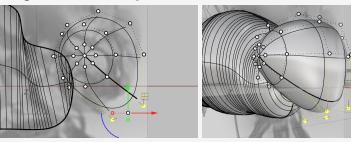

8. Press **ESC** to turn off control points.

### Add the neck

The neck is a blend surface between the head and body. You will first combine the head and body, and then create a blend surface along the edges between them.




1. In the **Front** viewport, move the head to enclose the endpoint of the chest as needed.


If the endpoint of the chest is not inside the head, the neck surface will fail to create.




 Select the head, chest, and body, and run the **BooleanUnion** command. (Solid > Union)

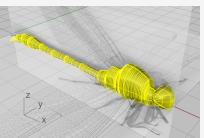

- Start the **BlendEdge** command.
   (Solid > Fillet Edge > Blend Edge)
- 4. Set the command option **NextRadius** to **0.5**, and check **Preview**.
- 5. Select the edges between the head and chest, and press **Enter**.

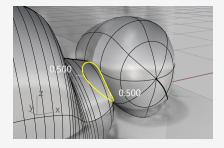


6. Preview the result, and press **Enter** to create the neck.

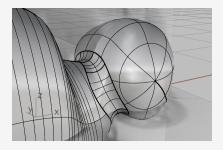


# **Create the eyes** The eyes are simple ellipsoids.



- 1. Start the **Sphere** command. (Solid > Sphere > Center, Radius)
- 2. In the **Perspective** viewport, pick two points around the head to create a sphere. The sphere size does not matter.

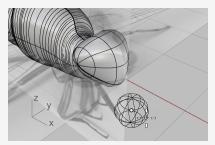


3. Tune on **Gumball** and drag the **Z scale handle** (the small blue rectangle) up to squeeze the sphere into an ellipsoid.

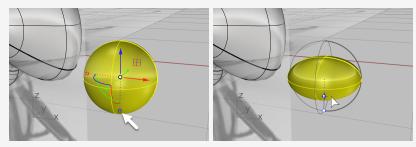


4. Turn off Gumball.

### ◇△ Position the eye

- Select the eye ellipsoid and start the **OrientOnSrf** command. (*Transform > Orient > On Surface*)
- 2. In the **Perspective** viewport, snap to the center of the ellipsoid, and click.

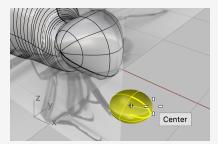


3. Pick another point on the construction plane as the reference point.

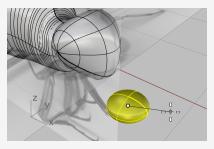


- 4. Select the head as the target surface.
- 5. In the options dialog, set the options as shown in the illustration below, and click **Orient**.

	1 Sullace	Orient Or		
	Rotation			Scale
	Prompt		rompt Iniform	
			1.00	X:
0.00	Angle:		1.00	Y:
			1.00	Z:
			id	🗸 Rigi
Orient	Cancel			
			1.00 1.00 1.00	X: Y: Z:

6. Move the ellipsoid on the surface to a proper location, and click.

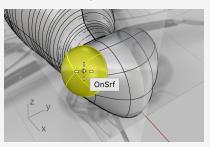


- 7. Disable all object snaps.
- 8. Move the cursor to define the size of the eye, and click.

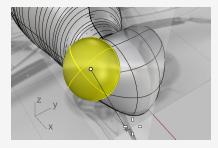

### Mirror the eye

- Select the eye and start the **Mirror** command. (*Transform > Mirror*)
- 2. In the top panel, click **History**.
- 3. Click the command option XAxis.
- 4. Use **Gumball** to adjust the position, size, and orientation of the first eye. History will update the mirrored eye on the other side.

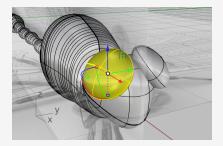

### Trace the wings

The wings are solids created from closed planar curves.



1. **Hide** the body.

(Edit > Visibility > Hide)


- 2. Double-click the **Top** viewport title to maximize the viewport.
- 3. Use the **Curve** command to trace a wing on one side.

(Curve > Free-Form > Control Points)

**Tip:** Place the last control point at the first control point to make a closed curve.




4. Draw the other wing on the same side.

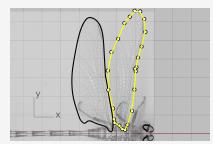

# **Extrude the curves to make solids**


- Select the two wing curves, and start the ExtrudeCrv command. (Solid > Extrude Planar Curve > Straight)
- 2. In the command options, uncheck **BothSides** and check **Solid**.
- 3. Set the extrusion distance to **0.1**, and press **Enter**. Two thin solid wings are created.

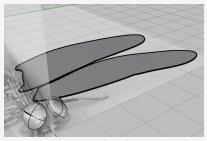




### Relocate and mirror the wings

Use **Gumball** to move the wings up.
 Place the front wing higher than the back wing.

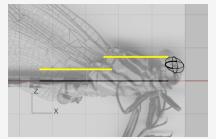

2. In the **Top** viewport, **Mirror** the wings to the other side.

(Transform > Mirror)

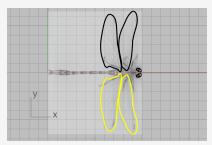


Hide the solid wings and the outline curves.
 (Edit > Visibility > Hide)

### **Create the legs**


The legs are pipes created from polylines with various radii.

#### Draw the center polyline

- Start the **Polyline** command.
   (Curve > Polyline > Polyline)
- 2. In the **Top** viewport, start every polyline close to the center line of the body.

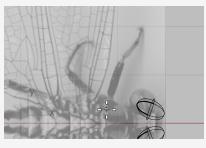


3. Trace down the center line of each leg with four points (three segments).

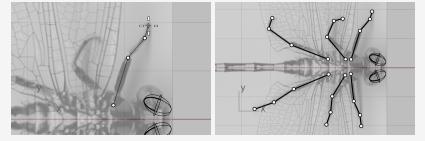

4. In the **Perspective** viewport, select a polyline, and use **Gumball** to move the control points down.


Tip: Look at the Front viewport to help locate the points.

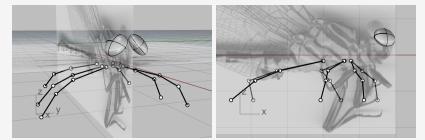


You will have to use your imagination a little for this since the two pictures do not show the legs of the same dragonfly.

# Generation Pipe the polylines


- Start the **Pipe** command and select a polyline. (Solid > Pipe)
- 2. Type **0.4**, and press **Enter** for the start radius.
- 3. Type **0.1**, and press **Enter** for the end radius.

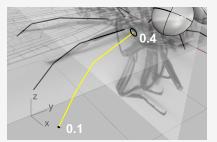


- 4. Use the **End** object snap to snap to the corner between the first and second segments and click.
- 5. Type **0.3**, and press **Enter**.

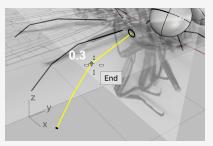


- 6. Snap to the corner between the second and third segments and click.
- 7. Type **0.2**, and press **Enter**.

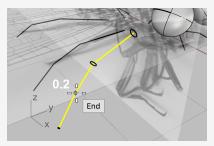

8. Press Enter again to create the pipe.

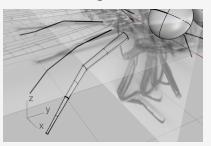


9. Create the other five legs with the same procedure.

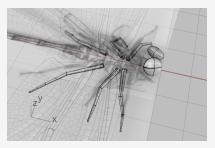

# 🙇 Unhide the body and wings

- Start the **ShowSelected** command.
   (Edit > Visibility > Show Selected)
- 2. Select the body and wings, and press Enter.
- Unlock the Picture planes and hide them.
   (Edit > Visibility > Unlock)
- 4. Use **Gumball** to rotate the wings slightly to add realism.

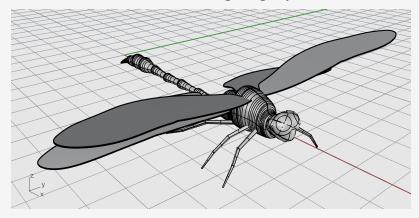

# 19 - Tutorial: Flow Along a Surface - Wrap Text

This tutorial demonstrates wrapping solid text objects onto a mug. These text objects could be used to Boolean with the mug.



You will learn how to:

- Create solid text objects.
- Wrap the text objects onto a surface.

#### To download the tutorial model

- 1. On the Rhino **Help** menu, click **Learn Rhinoceros**, and then click **Tutorials and Samples**.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Wrap.3dm**.

# **Create the planar reference plane**

The **CreateUVCrv** command generates the planar border and trimmed curves of a surface that can be used as a guide to orient your text objects.




1. Start the CreateUVCrv command.

(Curve > Curve from Objects > Create UV Curves)

2. Select the side surface of the mug, press **Enter**.

A rectangle and two circles are created on the Top construction plane starting from the origin. The rectangle represents the side surface boundary. The two circles are where the handle join to the side surface.

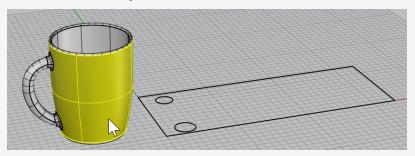


## Create the planar surface

- 1. Select the rectangle.
- 2. Run the **PlanarSrf** command.

(Surface > Planar Curves)

An untrimmed planar rectangle surface is created.

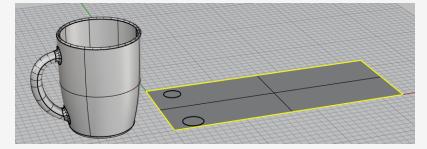


3. Delete the rectangle curve.

# Create text objects to wrap

# T Create text objects

- Start the **TextObject** command.
   (Solid > Text...)
- 2. Select a font and set **Height** to **1.0**.
- 3. Type your text.
- 4. Under Output, select Solids and set Thickness to 0.2.
- 5. Check Group output.
- 6. Click **Apply** and place the text on the planar surface inside the rectangle boundary.

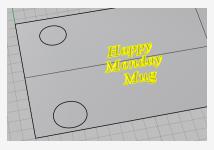




- 1. Select the text object group.
- 2. In the top panel, click **History**.
- 3. Start the **FlowAlongSrf** command.


(Transform > Flow along Surface)

- 4. In the command options, enable **Copy** and **Auto Adjust**, and disable **Rigid**.
- 5. Select the planar surface near the lower-left corner and close to the lower edge. This is the base surface.

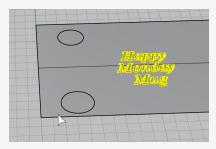

6. Select the mug side surface at the corresponding position. This is the target surface.

The text objects are wrapped onto the mug.

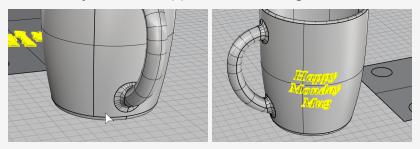


If the base or target surface is not selected at the correct corresponding position, the text objects will be wrapped with a wrong orientation. When it happens, undo the command and try again.

### Position the text objects

1. Use **Gumball** to **Move**, **Rotate**, and **Scale** the text objects on the planar surface inside the rectangle boundary.

Let History update the text objects on the mug.

2. Move the text objects down to intersect with the planar surface.

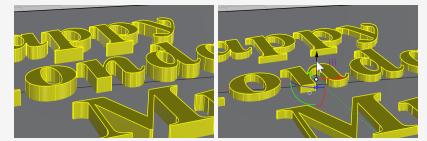

History updates the text objects to intersect with the mug.

# Solean the text objects with the mug

Boolean operations will break History connection. Click **OK** when you see the History Warning.

• Use the **BooleanDifference** command to subtract the text objects from the mug.

(Solid > Difference)



Or, use the **BooleanUnion** command to combine the text objects into the mug.
 (Solid > Union)



# 20 - Tutorial: Blocks - Mechanical Part

This example shows how to use Rhino to model a simple mechanical part. You will learn how to:

- Create extrusion objects.
- Boolean-difference shapes.
- Drill holes.
- Create a 2-D line drawing from the 3-D shapes.
- Dimension the 2-D line drawing and modify dimension text.

#### To download the tutorial model

- 1. On the Rhino Help menu, click Learn Rhinoceros, and then click Tutorials and Samples.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Toolblock.3dm**.

## **Create solid shapes**


Start by creating two basic solid shapes from the profile curves on layers **Profile-01** and **Profile-02**.

#### Set up the layers


In the Layers panel, confirm that the Profile-01 layer is current.

#### Extrude the profile curve

- 1. On the **Solid** menu, click **Extrude Planar Curve > Straight**.
- 2. Turn on the **End** object snap.
- 3. At the **Select curves to Extrude** prompt, select the blue profile curve, and press **Enter**.

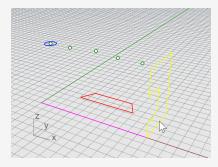

- 4. At the **Extrusion distance** prompt, in the command options, check **Solid** and uncheck **Delete Input**.
- 5. Snap to the end of the magenta construction line, and click.

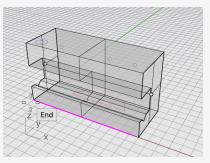

The extruded shape is a solid because it forms a closed volume in space.



#### Hide the solid


• Select the solid, on the Edit menu click Visibility > Hide.



In the Layers panel, make layer Profile-02 current.




1. **Select** the red profile curve.

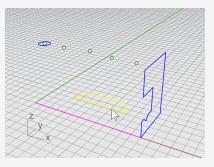


- 2. On the **Solid** menu, click **Extrude Planar Curve > Straight**.
- 3. At the **Extrusion distance** prompt, in the command options, check **Solid** and uncheck **Delete Input**.

4. At the **Extrusion distance** prompt, in the **Front** viewport, drag the extrusion above the height of the blue curve and click.

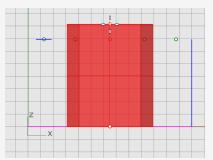


The solid appears on the current red layer Profile-02.

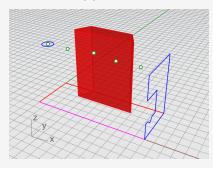




• On the **Edit** menu click **Visibility** > **Show**.

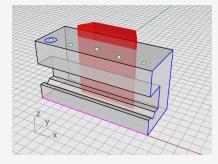

# Soolean the two solids

- 1. On the **Solid** menu, click **Difference**.
- 2. At the **Select surfaces or polysurfaces to subtract from** prompt, select the blue solid, and press **Enter**.
- 3. At the **Select surfaces or polysurfaces to subtract with** prompt, in the command options, check **Delete Input**.
- 4. **Select** the red solid, and press **Enter**.

The result will be a new solid or polysurface. A polysurface is a collection of surfaces that can be closed or open. A solid is a collection of surfaces that are closed.

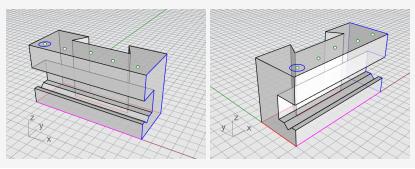


# **Drill the holes**

A construction circle is already in place for creating the first hole.




#### Make holes in the solid


1. **Select** the blue circle as shown in the illustration below.

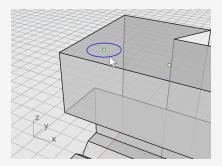

- 2. On the **Solid** menu click **Solid Edit Tools > Holes > Make Hole**.
- 3. At the **Select a surface or polysurface** prompt, select the gray polysurface.
- 4. At the **Depth point...** prompt, drag the hole through the upper portion of the object.

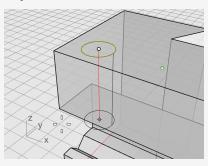

5. Pick a point in the **Right** view.

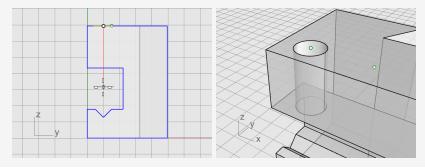


# Copy the holes


After one hole is drilled, you can copy the others.

# Copy the holes


- 1. In the **Osnap** panel, turn on the **Point** object snap.
- 2. On the **Solid** menu, click **Solid Edit Tools > Holes > Copy Hole**.
- 3. At the **Select holes in one planar surface** prompt, select the first hole, and press **Enter**.
- 4. At the **Point to copy from** prompt, snap to the point object in the center of the first circle, and click.

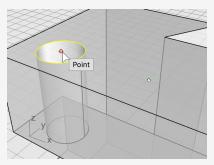


5. At the **Point to copy to...** prompt, snap to the next point that makes the center of the next hole, and click.

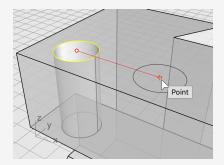

6. Repeat this for the two holes that are on the other side of the part.

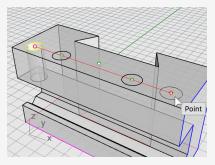

Do not use the point in the center of the part.

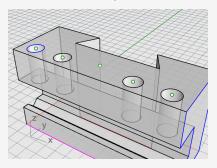




The center hole does not pass entirely through the upper part of the blue solid. There is no reference circle to start from.

- 1. On the **Solid** menu, click **Solid Edit Tools > Holes > Round Hole**.
- 2. At the **Select target surface** prompt, select the top surface of the gray solid.
- 3. At the **Center point** prompt, set the command options as below:

Depth=0.5 Radius=0.156 DrillPointAngle=180 Through=Unchecked Direction=CPlaneNormal 4. Snap to the point object in the middle of the gray solid to finish creating the hole.

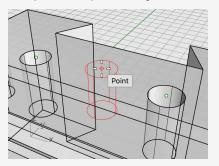

#### Test the solid

The resulting polysurface is a closed solid. A solid defines a closed volume in space. Object properties will report if this part is a closed solid.

- 1. Select the part.
- 2. On the Edit menu, click Object Properties (F3).
- 3. In the **Properties** panel, click **Details**.

In the **Object Description** window, you will find the listing to confirm that the object is valid and closed.

```
Geometry:
Valid polysurface.
Closed solid polysurface with 23 surfaces.
```

## Make a 2-D drawing

The Make2D command generates 2-D lines from the 3-D solid.

#### Create a 2-D line drawing

- 1. Select the part.
- 2. On the **Dimension** menu, click **Make 2-D Drawing**.
- 3. In the 2-D Drawing Options dialog box:

Under Projection, select Third angle projection.

Under **Options**, select **By output layers**, and check the **Tangent edges** and **Hidden lines** boxes.


4. Click Apply.

# **Dimension the 2-D drawing**

Using the 2-D drawing, add dimensions to the part.

### Set up the layers

- 1. In the Layers panel, make the Dimensions layer current.
- 2. Turn off all layers except the **Dimensions** and **Make2D** layers.
- 3. In the Linetype column for the Make2D > Hidden > Curves layer, click Continuous.
- 4. In the Select Linetype dialog box, select Hidden.

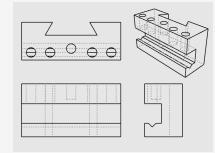


#### Set up the viewport

Double-click the viewport title to maximize the **Top** viewport.

#### **〕** I↔Î Dimension the part

- 1. On the **Dimension** menu, click **Linear Dimension**.
- 2. In the **Osnap** panel, turn on the **End** object snap; turn off the **Point** object snap.
- 3. At the **First dimension point** prompt, pick the upper left corner of the part.
- 4. At the **Second dimension point** prompt, pick the upper right corner of the part.
- 5. At the **Dimension location** prompt, pick a location for the dimension line.
- 6. Repeat to generate a vertical dimension on the right side of the part.

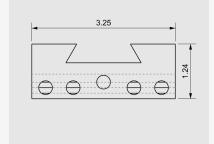


# $\overline{\underline{t}}_{\rightarrow}^{\circ}$ Chain dimension the part horizontally

- 1. On the **Dimension** click **Linear Dimension**.
- 2. At the First dimension point, in the command options check Continue.


This will generate a chain of dimensions.

**Tip:** If the current dimension continues a previous dimension, click the **NewChain** button.

- 3. At the **First dimension point** prompt, snap to the lower left corner of the part with the **End** object snap, and click.
- 4. At the **Second dimension point** prompt, snap to the center of the first circle with the **Center** object snap, and click.

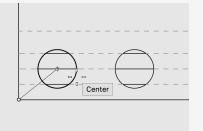


5. At the **Dimension location** prompt, pick below the part.

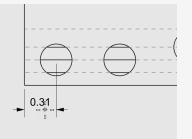


6. At the next **Dimension location** prompts, continue picking the centers of the circles.

7. Finish by picking the lower right corner of the part, and press Enter.

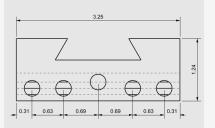


**Note**: If the dimension text and arrows do not fit inside the dimension lines, you can fix this later in the dimension Properties. Dimension properties let you specify the location of the text and arrows.

Properties: Linear Dimension	**
Match	
Fit arrow Inside ᅌ	
Fit text Inside	
Dimension lines	
Arrows	
Length units	
Alternate units	
▶ Tolerance	

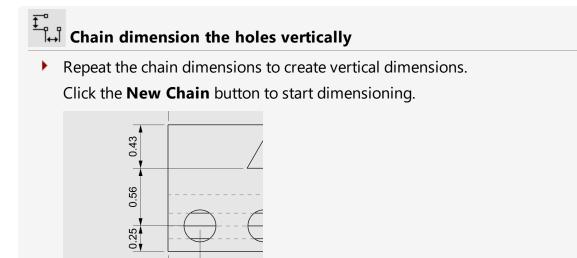


## . ∧<sup>®</sup> Add radial dimensions

- 1. On the **Dimension** menu, click **Radial Dimension**.
- 2. At the **Select curve for radius dimension** prompt, select the circle on the far right.
- 3. At the **Dimension location** prompt, pick above the part.

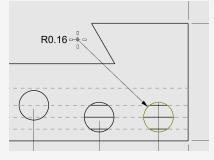

4. Double-click the radial dimension text, and in the text edit box, add the text: **Typ. 5 Places.** 

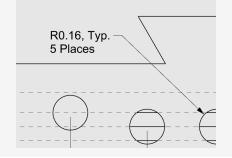


# 21 - Tutorial: Layouts - Title Block

This example shows how to use Rhino to model a simple mechanical part. You will learn to create a layout with a title block for printing.

#### To download the tutorial model

- 1. On the Rhino **Help** menu, click **Learn Rhinoceros**, and then click **Tutorials and Samples**.
- 2. In the **Tutorials** panel, under **User's Guide**, double-click the tutorial model file **Toolblock\_Layout.3dm**.

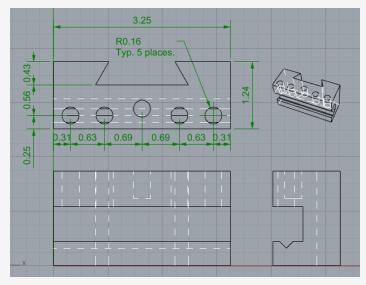


# Layout viewports

Use a layout to arrange the 2-D lines for the printer.

#### Add a layout

1. On the Viewport control bar, click the Layout button.




2. In the **New Layout** dialog, select the following and click **Apply**.

Initial Detail Count=1

Size=*Letter* (8.5" x 11")

#### **Orientation**=Landscape

Page 1 will appear in the Layout window.

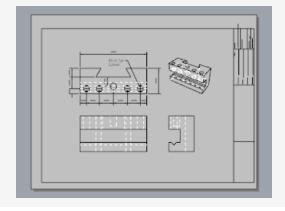

## Insert a title block

In this section you will add a title block and re-size the detail to fit.

#### Set up the layers


- 1. In the **Model layers** panel, make the **Title Block** layer current.
- 2. Confirm that you are in layout space.

# Market Insert the title block

- 1. On the Edit menu, click Block > Insert Block Instance.
- 2. From the name list, select **Ansi\_A\_TB**.
- Under Insertion point, clear the Prompt box, and click Apply.
   The corner of the title block will be placed at 0,0.
- 4. Select the detail.

**Note:** Double-click outside the detail frame to make sure the detail is not active. Click on the detail edge to select it.

5. On the Edit menu click Control Points > Control Points On.

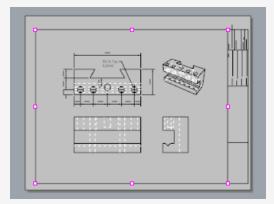

- 6. Drag the corner points to re-size the detail to fit in the title block.
- 7. Press the **Esc** key to turn off the control points.

#### Lock the detail view

- 1. Select the detail.
- 2. In the **Properties** panel on the **Detail** page, under **Scale Value**, set the **inches on page** and **inches in model** to **1.0**.
- Check the Locked box This prevents future panning and zooming when the detail view is active so the drawings stay in the correct size.

#### Solution Add print widths

1. In the **Model layers** panel, click **Default** in the **PrintWidth** column, and set the values to the following:

Dimension=0.35

Title Block=0.5

#### Make2D > Visible > Curves=0.70

Note: On the View menu, click Print Preview to display print widths in viewports.

